

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	3002521663
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit	
8. Well No.	12
9. Pool name or Wildcat	Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Texaco E&P Inc.	
3. Address of Operator P.O. Box 730 Hobbs, NM 88240	
4. Well Location Unit Letter <u>H</u> : <u>2310</u> Feet From The <u>North</u> Line and <u>987</u> Feet From The <u>East</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3991	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-1-95 Notify NMOCD of intent to plug. Talked with Jerry Sexton.
2-2-95 MIRU Pool W.O rig & cmt. equip. TIH tag cmt. on CIBP @ 4385'. Circ. csg. w/25# per bbl salt gel mud. Spot 25sx cmt. plug 3900-3586. WOC & tag 2-3-95 @ 3586.
2-3-95 POOH to 3000'. Spot 45sx cmt. plug 3000' WOC & tag 2400'. Talked with NMOCD, Jerry Sexton
2-3-95 POOH to 1800'. Spot 45sx cmt. plug from 1800' WOC & tag 1137' Talked with NMOCD Buddy Hill.
2-6-95 POOH to 400'. Spot 40sx cmt. plug from 400-surface.
2-6-95 RD Pool W.O. Unit & cmt. equip. Dig out cellar & cut off well head, cap well, & install dry hole marker. Clean location & move off.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Calder TITLE P&A Supervisor DATE 2-9-95

TYPE OR PRINT NAME J. Calder TELEPHONE NO. _____

(This space for State Use)


APPROVED BY Carry W. Hill TITLE OIL & GAS INSPECTOR DATE MAY 16 1995

CONDITIONS OF APPROVAL, IF ANY: _____

PAID in 2000
9/27/99

P&A: 2-06-95

TEXACO E&P INC
CENTRAL VACUUM UNIT No. 12
API# 30025216630000

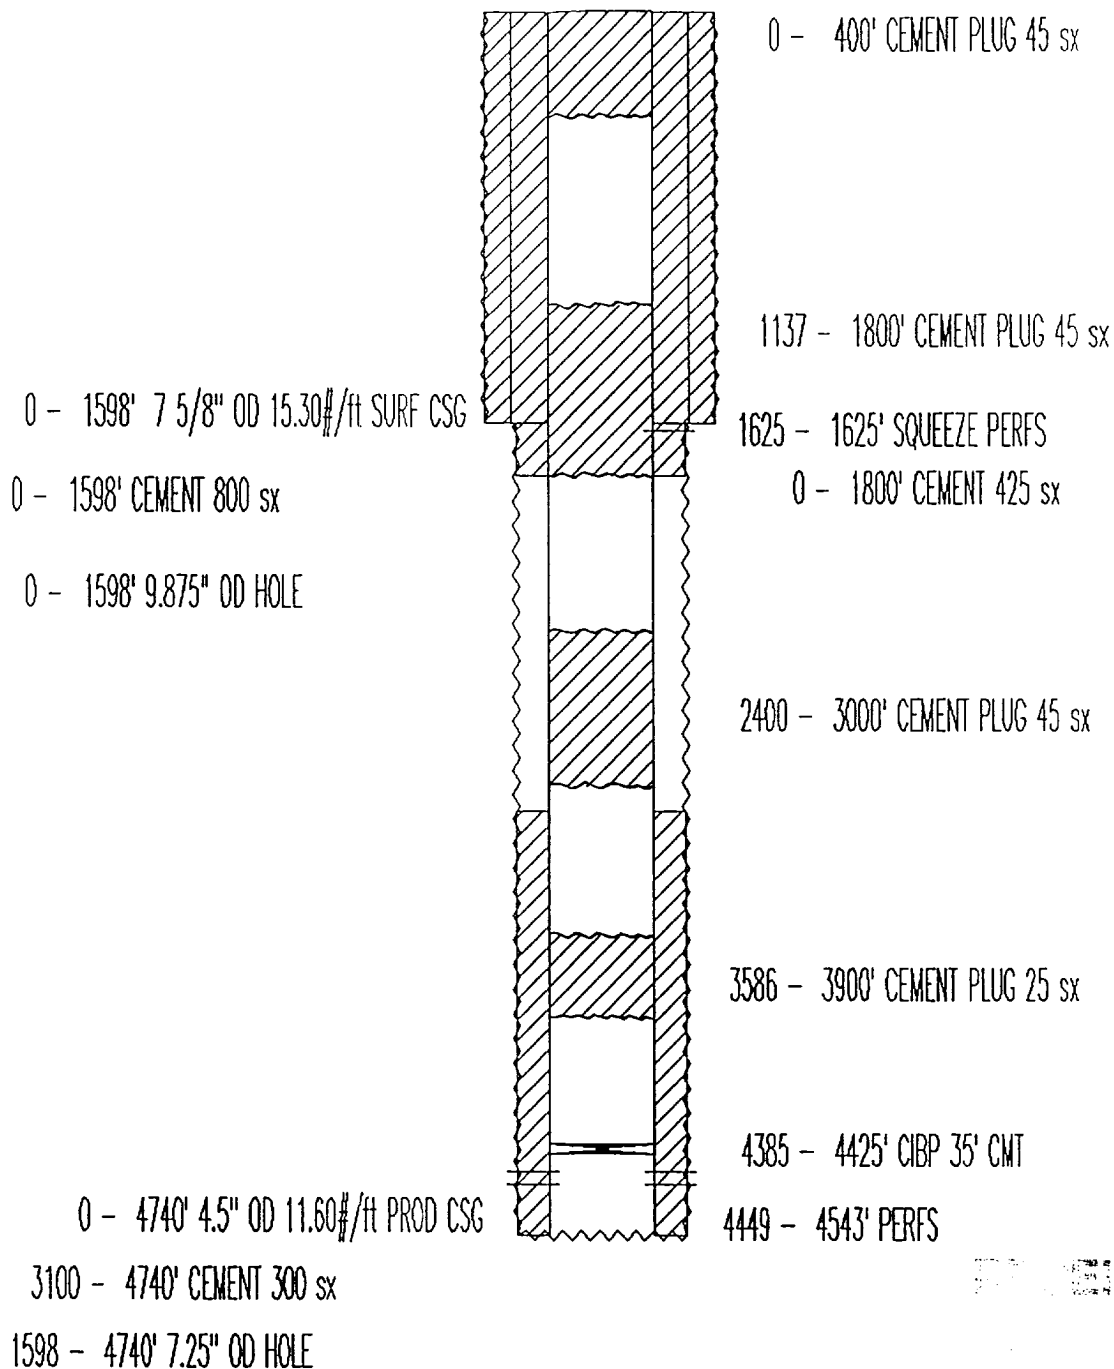

2310 FNL & 987 FEL
SEC 25, T11N 17 S, RANGE 34 E
ELEVATION: 4004 DF
COMPLETION DATE: 04-05-66

COMPLETION INTERVAL: 4449 - 4543 (GESA)
Former NM "T" State NCT-1 #3

RECEIVED

OFFICE