

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

HOBBS OFFICE O. C. C.
NEW MEXICO OIL CONSERVATION COMMISSION
APR 15 11 37 AM '69

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. OG 2001
7. Unit Agreement Name -
8. Farm or Lease Name State "C"
9. Well No. 1
10. Field and Pool, or Wildcat Quail Queen (undesignated)
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>
2. Name of Operator Charles B. Read
3. Address of Operator P. O. Box 2126 Roswell, New Mexico 88201
4. Location of Well UNIT LETTER K 2080 FEET FROM THE South LINE AND 1980 FEET FROM THE West LINE, SECTION 11 TOWNSHIP 19S RANGE 34E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 3976' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input checked="" type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>


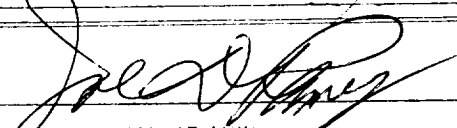


17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-29-69: Spudded @ 12 noon.

Ran 14 jts 8 5/8", 32#, J-55, csg - 414' set @ 407' RKB. Cmt w/150 sx class C w/2% cacl w/8# slt per sx. Plug down @ 4:10 PM. Cmt circ. WOC 18 hrs. Press test to 1500# for 30 min. Test OK.

4-11-69: Ran 163 jts 5 1/2", 14# & 15.5# csg - 5172' set @ 5168' RKB. Cmt w/250 sx class C, w/8# slt per sx. Plug down @ 1:30 AM. WOC 18 hrs. Press test to 1500# for 30 min. Test OK.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Agent	DATE 4-14-69
APPROVED BY 	TITLE 	DATE 
CONDITIONS OF APPROVAL, IF ANY:		