

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-24387
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-1400-3
7. Lease Name or Unit Agreement Name	EAST VACUUM GB/SA UNIT TRACT 3315
8. Well No.	011
9. Pool name or Wildcat	VACUUM GRAYBURG/SAN ANDRES

1. Type of Well:	GAS WELL ☐ OTHER
2. Name of Operator	Phillips Petroleum Company
3. Address of Operator	4001 Penbrook Street, Odessa, TX 79762
4. Well Location	Unit Letter 0 : 890' Feet From The FSL Line and 2300' Feet From The FEL Line
Section 33 Township 17-S Range 35-E NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3941' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
Phillips Petroleum Company

3. Address of Operator
4001 Penbrook Street, Odessa, TX 79762

4. Well Location
Unit Letter 0 : 890' Feet From The FSL Line and 2300' Feet From The FEL Line

Section 33 Township 17-S Range 35-E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3941' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

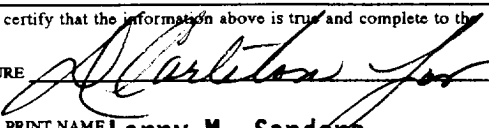
SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: REPAIR CSG LK, ACIDIZE, SQZ, SWAB & RET ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

04/30/97 MIRU DA&S WS #234, KILL, COOH W/RODS & PMP, NU BOP & PAN, COOH W/TBG (CSG LEANING HAD T/PULL SLOW).
05/01/97 GIH W/RBP & PKR, SET RBP @ 3000' & PKR @ 2996', LD & TST RBP T/1000# OK, DMP 2 SX SD ON TOP RBP, CIRC CSG CLN, COOH W/TBG & PKR, ND BOP & PAN, SISD.
05/02/97 DIG OUT CELLAR W/BKHoe TRY T/GET SPEAR INTO CSG (LEANING TOO MUCH T/HAVE GOOD HOLD).
05/05/97 CO WH, MIRU HES EQMT, PERF @ 4 SPF @ 2906' F/SURF, RDMO HES, GIH W/PKR & 1 JT TBG, MIRU PMP TRK, TRY T/ESTAB PI RATE DWN CSG, CAUGHT PRESS & COULDNT PI, BLEED OFF PRESS, SISD.
05/06/97 GIH W/RETAINER, SET @ 2842', SQZ 23.5 SX CMT INTO PERFS DISPLACING W/10.5 BBL FR WTR COOH W/TBG, GIH PERF @ 4 SPF @ 420' F/SURF, GIH W/PKR, CIRC SURF CSG CLN, COOH W/PKR, ESTAB PI RATE, MIX & PMP 52 BBL CMT, FLUSH W/1 BBL FR WTR, RDMO HES, WOC, CONTINUED ON BACK

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE 
TYPE OR PRINT NAME Larry M. Sanders

TITLE Senior Regulation Analyst DATE 9-5-97
TELEPHONE NO. (915) 368-1488

(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY _____ TITLE _____ DATE OCT 06 1997

CONDITIONS OF APPROVAL, IF ANY:

05/06/97 PULL 70 PTS INTO 5-1/2" CSG, CUT 8-5/8" SURF CSG, SISO.

05/07/97 SLACK OFF SPEAR, CSG DIDN'T MOVE, CHG OUT J-55 TBG F/N-80, INSERT SPEAR & PULL 90 PTS, CSG DIDN'T MOVE, MI WELDER, CUT & DRESS UP 8-5/8" & 5-1/2", WELD ON 5-1/2" BELL NIPPLE & PLATE ON 8-5/8", SCREW ON 5-1/2" COLLAR & NIPPLE, REPLACE OUT-OF-DATE WH W/NEW WH, SISO.

05/08/97 MIRU REV UNIT, PU GIH W/4-3/4" BIT, 4-3-1/2" COLLARS & TBG, DRL F/317-347', COOH W/TBG, PU GIH W/4 MORE 3-1/2" COLLARS, DRL F/347-348', SISO.

05/09/97 DRL OUT REST OF RETAINER, FELL OUT OF CMT @ 430', CIRC CLN, SISO.

05/12/97 GIH W/TBG, TAG CMT @ 2838', DRL RET & CMT T/2920', TST SQZ T/500# OK, WASH SD OFF RBP @ 3000', COOH STD COLLARS, SISO.

05/13/97 GIH W/RETRIEVING TL, COOH W/RBP, GIH W/SD PMP, TAG FILL @ 4637', GIH W/COLLARS, COOH LD, TST IN HOLE W/PKR & TBG, SET PKR & LD & TST BK SIDE, WOULDN'T HOLD 500#, SISO.

05/15/97 PPCO HAD 2 HR MTG ON SUCKER ROD HANDLING, OPEN UP W/30# ON TBG, CIRC CSG & RETEST T/500#, DROP T/240#, RU SWAB, W/FL @ 1000' MAKE 4 RUNS & REC 18 BBLs, END FL @ 2300', MIRU HES ACID EQMT, TST LINES, PMP 3000 GAL 15% FERCK ACID, 3000# RK SALT IN 3000 GAL XLINK GELL BRINE W/BRKR & FLUSH PER: PMP 1000 GALS ACID, DROP 300# SALT IN 260 GALS XLINK; 2000 GAL ACID, FLUSH W/31 BBLs FR WTR, ISIP 1385# 5 MIN 645# 10 MIN 400# 15 MIN 268# MAX PRESS 2821# AVG RATE 4.8 BPM, SI, RDMO HES, RU SWAB OPEN UP W/200# ON TBG & FL @ SURF, REC 72 BBL W/END FL @ 1600', SISO.

05/16/97 OPEN UP W/200# ON TBG, FL @ 1200', REC 155 BBL, END FL @ 2200', SISO.

05/19/97 BLD DWN, REL PKR, TST CSG WHICH COOH, FOUND LEAK @ +/-420', COOH W/TBG & PKR GIH W/RBP, PKR & TBG, SET RBP @ 2250' & PKR @ 2240', LD & TST RBP T/1000# OK, DMP 2 SX SD ON RBP, COOH W/TBG & PKR, SISO.

05/20/97 GIH W/14 JTS TBG OPEN END, WO DOWELL CMT CREW, MIRU DOWELL, MIX & SPOT 35 SX CL C CMT T/434', COOH W/TBG, SQZ CMT INTO PERFS, SISO.

05/21/97 MIRU REV UNIT, PU GIH W/4-3/4" BIT, 7-3-1/2" COLLARS & TBG, TAG CMT @ 240', DRL OUT T/370', CMT STILL GREEN, PRESS CSG T/350#, SISO.

05/22/97 DRL OUT CMT F/370-450', CIRC CLN, COOH LD COLLARS, GIH WASH SD OFF RBP, RETRIEVE & COOH, GIH W/PROD TBG: SN, IPC SUB, BLAST JT, 5 JTS TBG, TAC, 137 JTS TBG, ND BOP FLANGE UP WH, SISO.

05/23/97 GIH W/PMP & RODS, LOAD & TST PMP ACTION, RD DDU.

05/24/97 RE-SET PMPG UNIT, START PMPG, NO TEST.

05/25/97 PMPG, NO TST, TEMP DROP F/REPORT

07/24/97 TST 33 BOPD 636 BWPD 1 MCF 49.4% CO2.

07/25/97 TST 36 BOPD 570 BWPD 1 MCF 30% CO2.

07/26/97 TST 32 BOPD 604 BWPD 1 MCF 41.7% CO2. COMPLETE DROP F/REPORT

08/02/97 TST 38 BOPD 706 BWPD 1 MCF 17.85 CO2.

08/03/97 TST 27 BOPD 655 BWPD 1 MCF 14.2% CO2. COMPLETE DROP F/REPORT