

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO	30-025-25808
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	857943
7. Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8. Well No.	5
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐ INJECTION WELL ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>D</u> : <u>1310</u> Feet From The <u>NORTH</u> Line and <u>1238</u> Feet From The <u>WEST</u> Line Section <u>30</u> Township <u>17S</u> Range <u>35E</u> NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	REPAIR CSG LEAK & ADD PERFS ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-27-00: MIRU. NDWH. NUBOP. TIH W/BIT & SCRAPER ON WS. TAG @ 4355'. TIH W/PKR. ISOLATE LEAK 476-507. PKR SET @ 450'.
6-30-00: REL PKR. MIX & PMP DN CSG 200 SX CL C W/2% CACL. TAIL IN W/200 SX CL C NEAT. DISPL TO 300'.
7-05-00: TIH W/NEW BIT, DC'S ON WS. TAG @ 240'. DRILL HARD CMT 240-394'.
7-06-00: DRILL HARD CMT 394-496. FELL THRU. PRESS TEST SQZ TO 300#. LEAK OFF TO 100#.
7-07-00: TIH W/TBG TO 563'. SPOT 5 BBLS SQUEEZE CRETE FR 563-250'.
7-10-00: TIH W/BIT, DC'S ON WS. TAG @ 194'. DRILL CMT 194-586. TEST TO 300#-30 MIN.
7-11-00: TEST & CHART CSG 4255-SURF FOR 30 MINS-540#-OK. TIH W/BIT, DC'S ON WS. TAG @ 4255'. WASH FILL 4255-4443. DRILL CIBP @ 4443.
7-12-00: TIH W/CONE BUSTER MILL, DC'S ON TBG. TAG @ 4470'. MILL 4470-4541'. C/O SCALE, JUNK.
7-13-00: TAG @ 4511'. MILL 4511-4566. TIH W/CONE BUSTER MILL, DC'S ON TBG TO 3860'.
7-14-00: MILL 4511-4566. TIH W/JUNK MILL #4 ON TBG TO 3860'.
7-17-00: TIH W/TOOLS. TAG @ 4511'. C/O IRON & FORM. MILL TO 4748.
7-18-00: MILL 4525-4580. PULL MILL TO 4440'.
7-19-00: TAG @ 4540'. MILL 4540-4615. TIH W/TAPER MILL, DC'S TO 3813'.
7-20-00: TAG @ 4560'. MILL 4560-4607.
7-21-00: TAG @ 4540'. MILL 4540-4610.
7-24-00: MILL 4545-4626. 4549-4638. 4549-4633. MILL QUIT. MILL 4549-4638
7-31-00: PERF VGSAU FORMATION 4425-4455. TIH W/PKR, SN, & TBG. PSA 4358.
8-01-00: ACIDIZE PERFS 4425-4622 W/10,000 GALS 15% NEFE ACID. RU SWAB. END FL @ 3600'. TIH W/TBG & TAG @ 4570'. WASH 4570-4738.
8-03-00: NDBOP. NUWH. SET PKR @ 4390. RESET @ 4359. TIH W/RBP & PKR. SET RBP @ 4390. PKR @ 4377. LOCATE CSG LEAK 476-507.
DUMP 2 SX SAND ON RBP @ 4390. SQZ CMT LEAK @ 476-507 W/200 SX CL C, & 200 SX CL C W/2% CC. SQZ TO 686 PSI. DRILL HARD CMT 126-345 & 345-495. TEST & CHART CSG 4390-SURF WASH SD 4365-4390. LATCH FSH & RBP @ 4390.
8-14-00: TIH W/TBG. NDBOP. NUWH. PSA 4358. TEST CHART CSG TO 540 PSI. RIG DOWN. 8-24-00: INJ'G 686 BWPD @ 925 PSI. FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 8/25/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)


APPROVED

CONDITIONS OF APPROVAL IF ANY: TITLE

DATE

SEP 28 2000
DeSoto/Nichols 12-93 ver 1.0

JCS

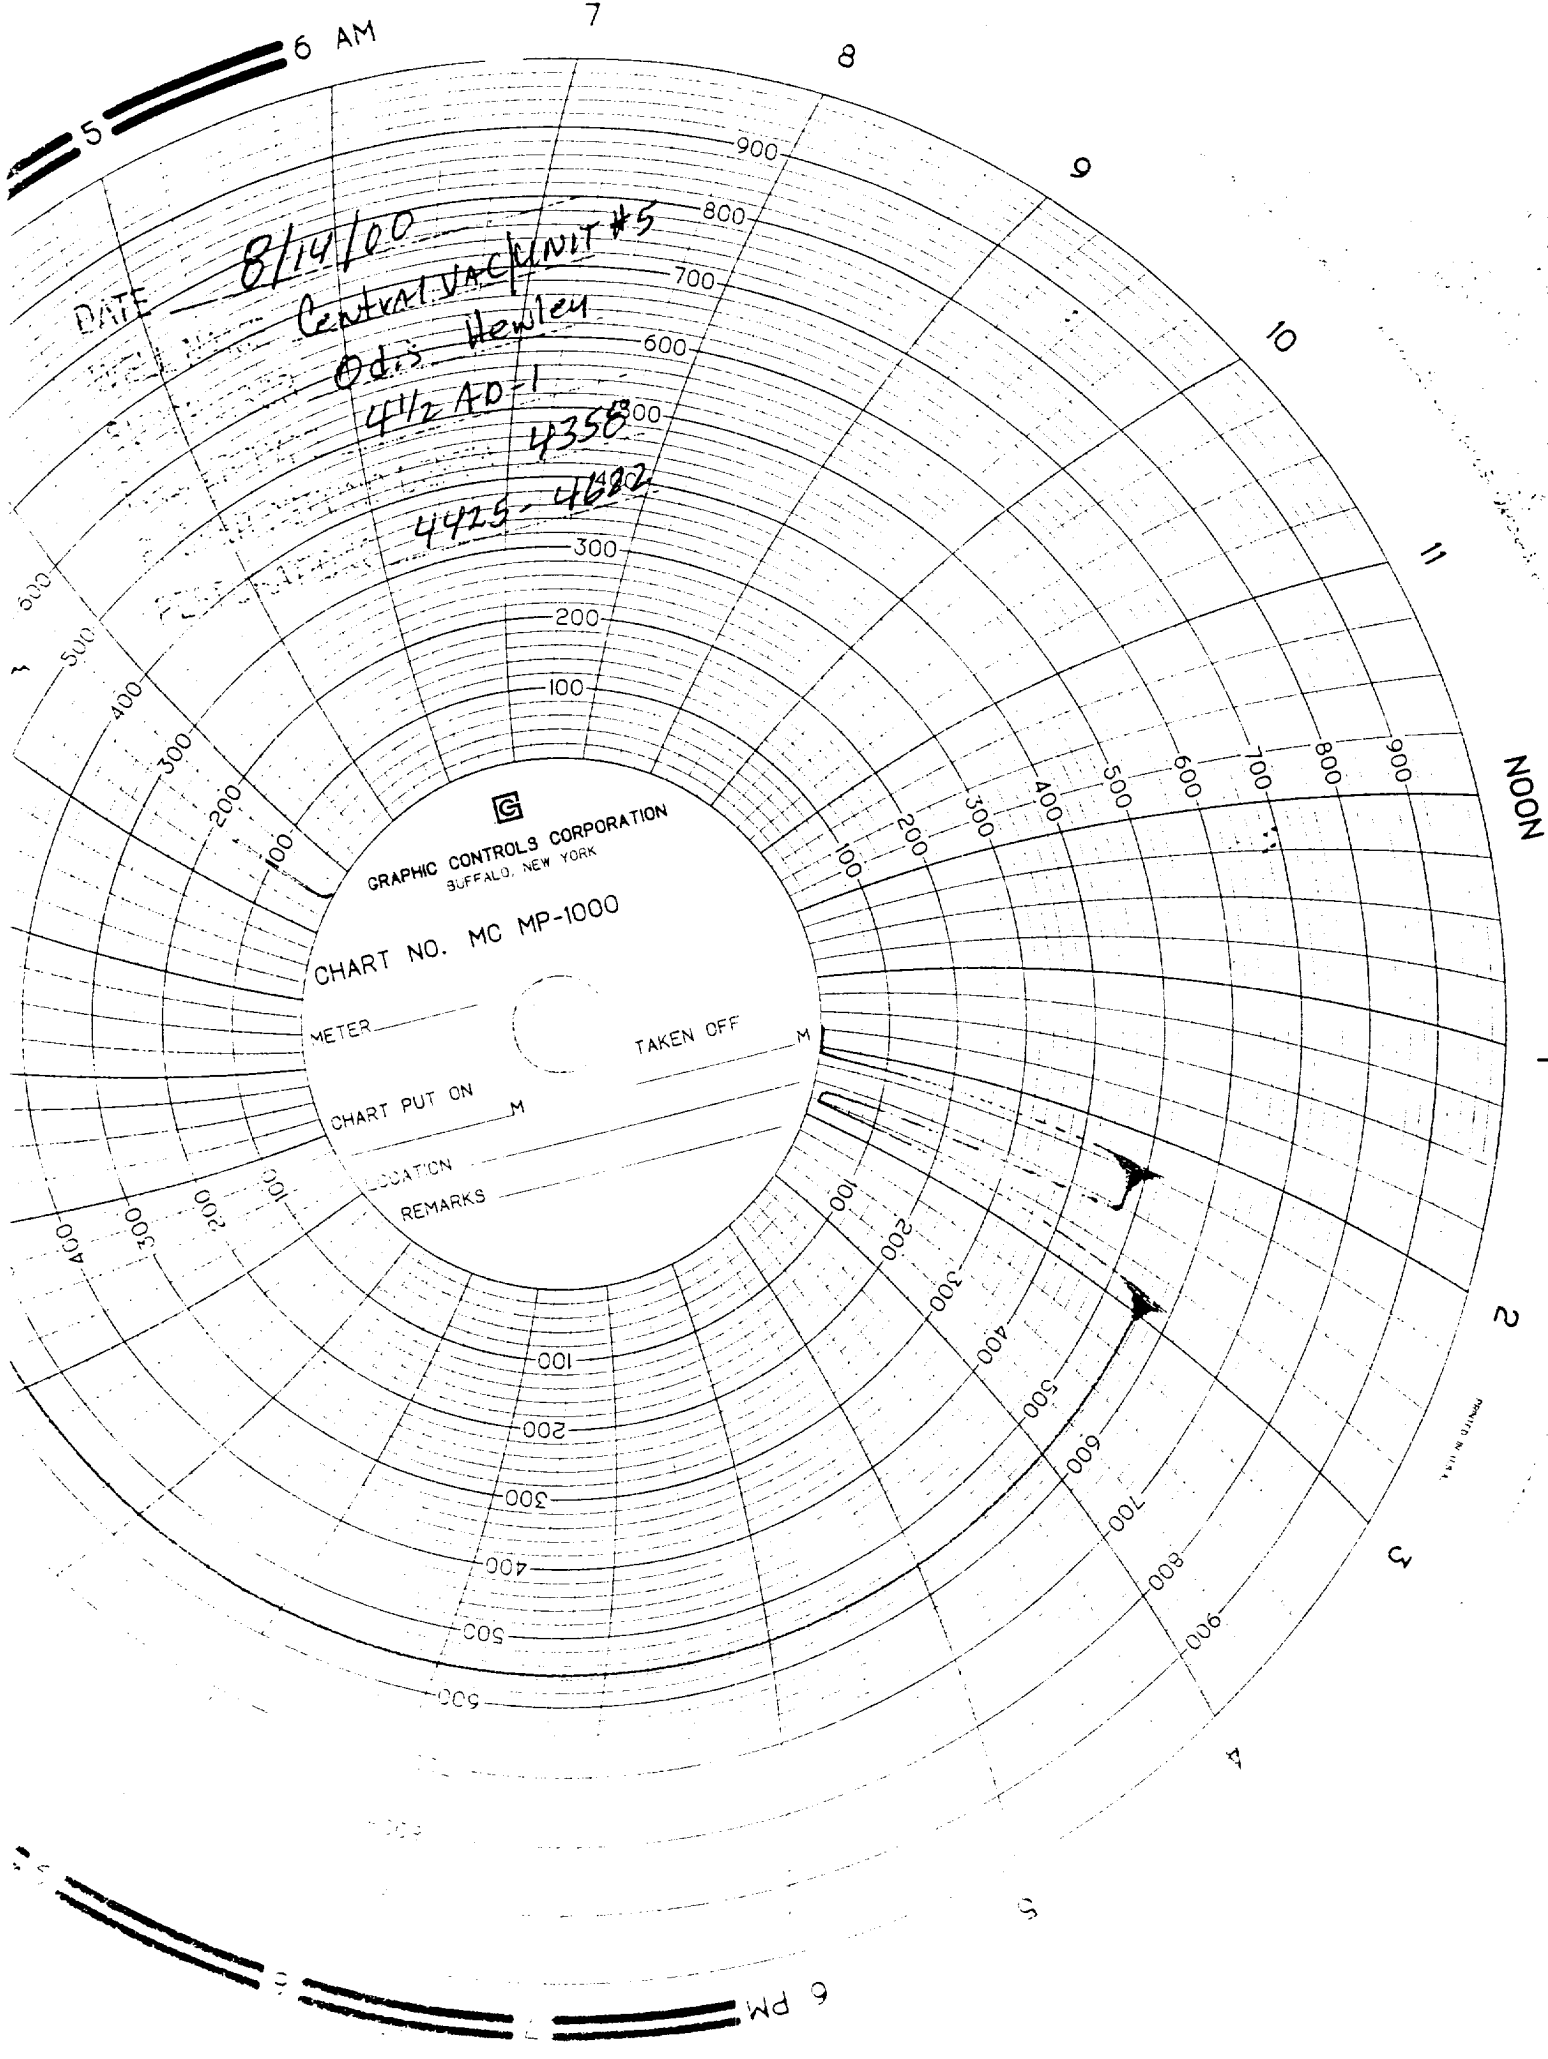

DATE

8/14/00

Central Vac Unit #5

Odessa, New York

4 1/2 AD-1

4358

4425 - 4602

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

CHART NO. MC MP-1000

METER

TAKEN OFF

CHART PUT ON

LOCATION

REMARKS

NOON

2

3

4

5

6 PM