

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25999
5. Indicate Type of Lease	STATE ☒ FEE
6. State Oil / Gas Lease No.	B-155-1
7. Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8. Well No.	138
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL ☐ GAS WELL ☐ OTHER ☐ WATER INJECTION ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter P 10 Feet From The SOUTH Line and 70 Feet From The EAST Line Section 36 Township 17S Range 34E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3986' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK ☒	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPERATION	PLUG AND ABANDONMENT
PULL OR ALTER CASING		CASING TEST AND CEMENT JOB	
OTHER:		OTHER: CLEAN OUT, FRAC, CONVERT	☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-06-01: MIRU. BLED WELL DN.
4-09-01: INSTL NEW 3000# SPOOL NUBOP. REL PKR. PKR @ 4225'. PU MILL, DC'S & WS.
4-10-01: TAG FILL @ 4247'. C/O TO PBTB @ 4780'. CIRC CLN. PULL BIT ABOVE PERFS.
4-11-01: TAG FILL @ 4320'. C/O TO 4484'. TIH W/TBG OPEN ENDED TO 4484'. PUMP 3000# SAND.
4-12-01: TIH TO TAG SAND @ 4332'. BREAK CIRC. C/O TO 4360'. TIH W/MILL, DC'S & TBG. TAG FILL @ 4355'. DRILL ON BAD CSG @ 4360-4365, 4393-4396. C/O TO 4421'.
4-13-01: TAG @ 4421. C/O TO 4774. TIH W/TBG TO 3955. PLUG BACK TO 4410.
4-16-01: TAG FILL @ 4750. PULL TBG TO 4175'. PUMP 4000# 20/40 SAND. TAG SAND @ 4365'. C/O SAND TO 4410'. TIH W/FRAC PKR. TEST TBG TO 8500 PSI TO 1784'.
4-17-01: SET PKR @ 4188'. FRAC TREAT UPPER VGSAU PERFS 4276-4410 W/30,277 GALS YF-135.
4-18-01: FLOW WELL. REL PKR & CLEAN OUT.
4-20-01: TAG FILL @ 4330. BREAK CIRC. C/O TO 4520'. PULL BIT TO 4206'.
4-23-01: TIH TO 4415'. C/O TO 4780'.
4-24-01: WORK STUCK PIPE. TIH W/STRING SHOT. SET DN @ 510'. DID MANUAL BACKOFF. UNSCREW TBG @ 1026. TIH W/TBG. SCREW BACK ONTO FISH. WORK PIPE LOOSE. DRUG TO 4270'. TIH W/TBG TO 1870.
4-25-01: TIH W/PKR W/ON-OFF TOOL W/PROFILE. TEST TBG IN HLE TO 3500 PSI W/NITROGEN TO 3277.
4-26-01: SET PKR @ 4220'. REL ON/OFF TOOL. CIRC W/PKR FLUID. LATCH ONTO PKR. NDBOP. NU CIW CO-2 TREE. TEST SAME TO 3000 PSI-OK. LOAD/TEST CSG & PKR TO 550 PSI-OK. CHART FOR NMOC. SHEAR PUMP OUT PLUG @ 1800 PSI. RIG DOWN.
5-21-01: ON 24 HR OPT. INJ'G 1003 BWPD @ 1525 PSI.

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 5/30/01


TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____ DATE _____

JCS

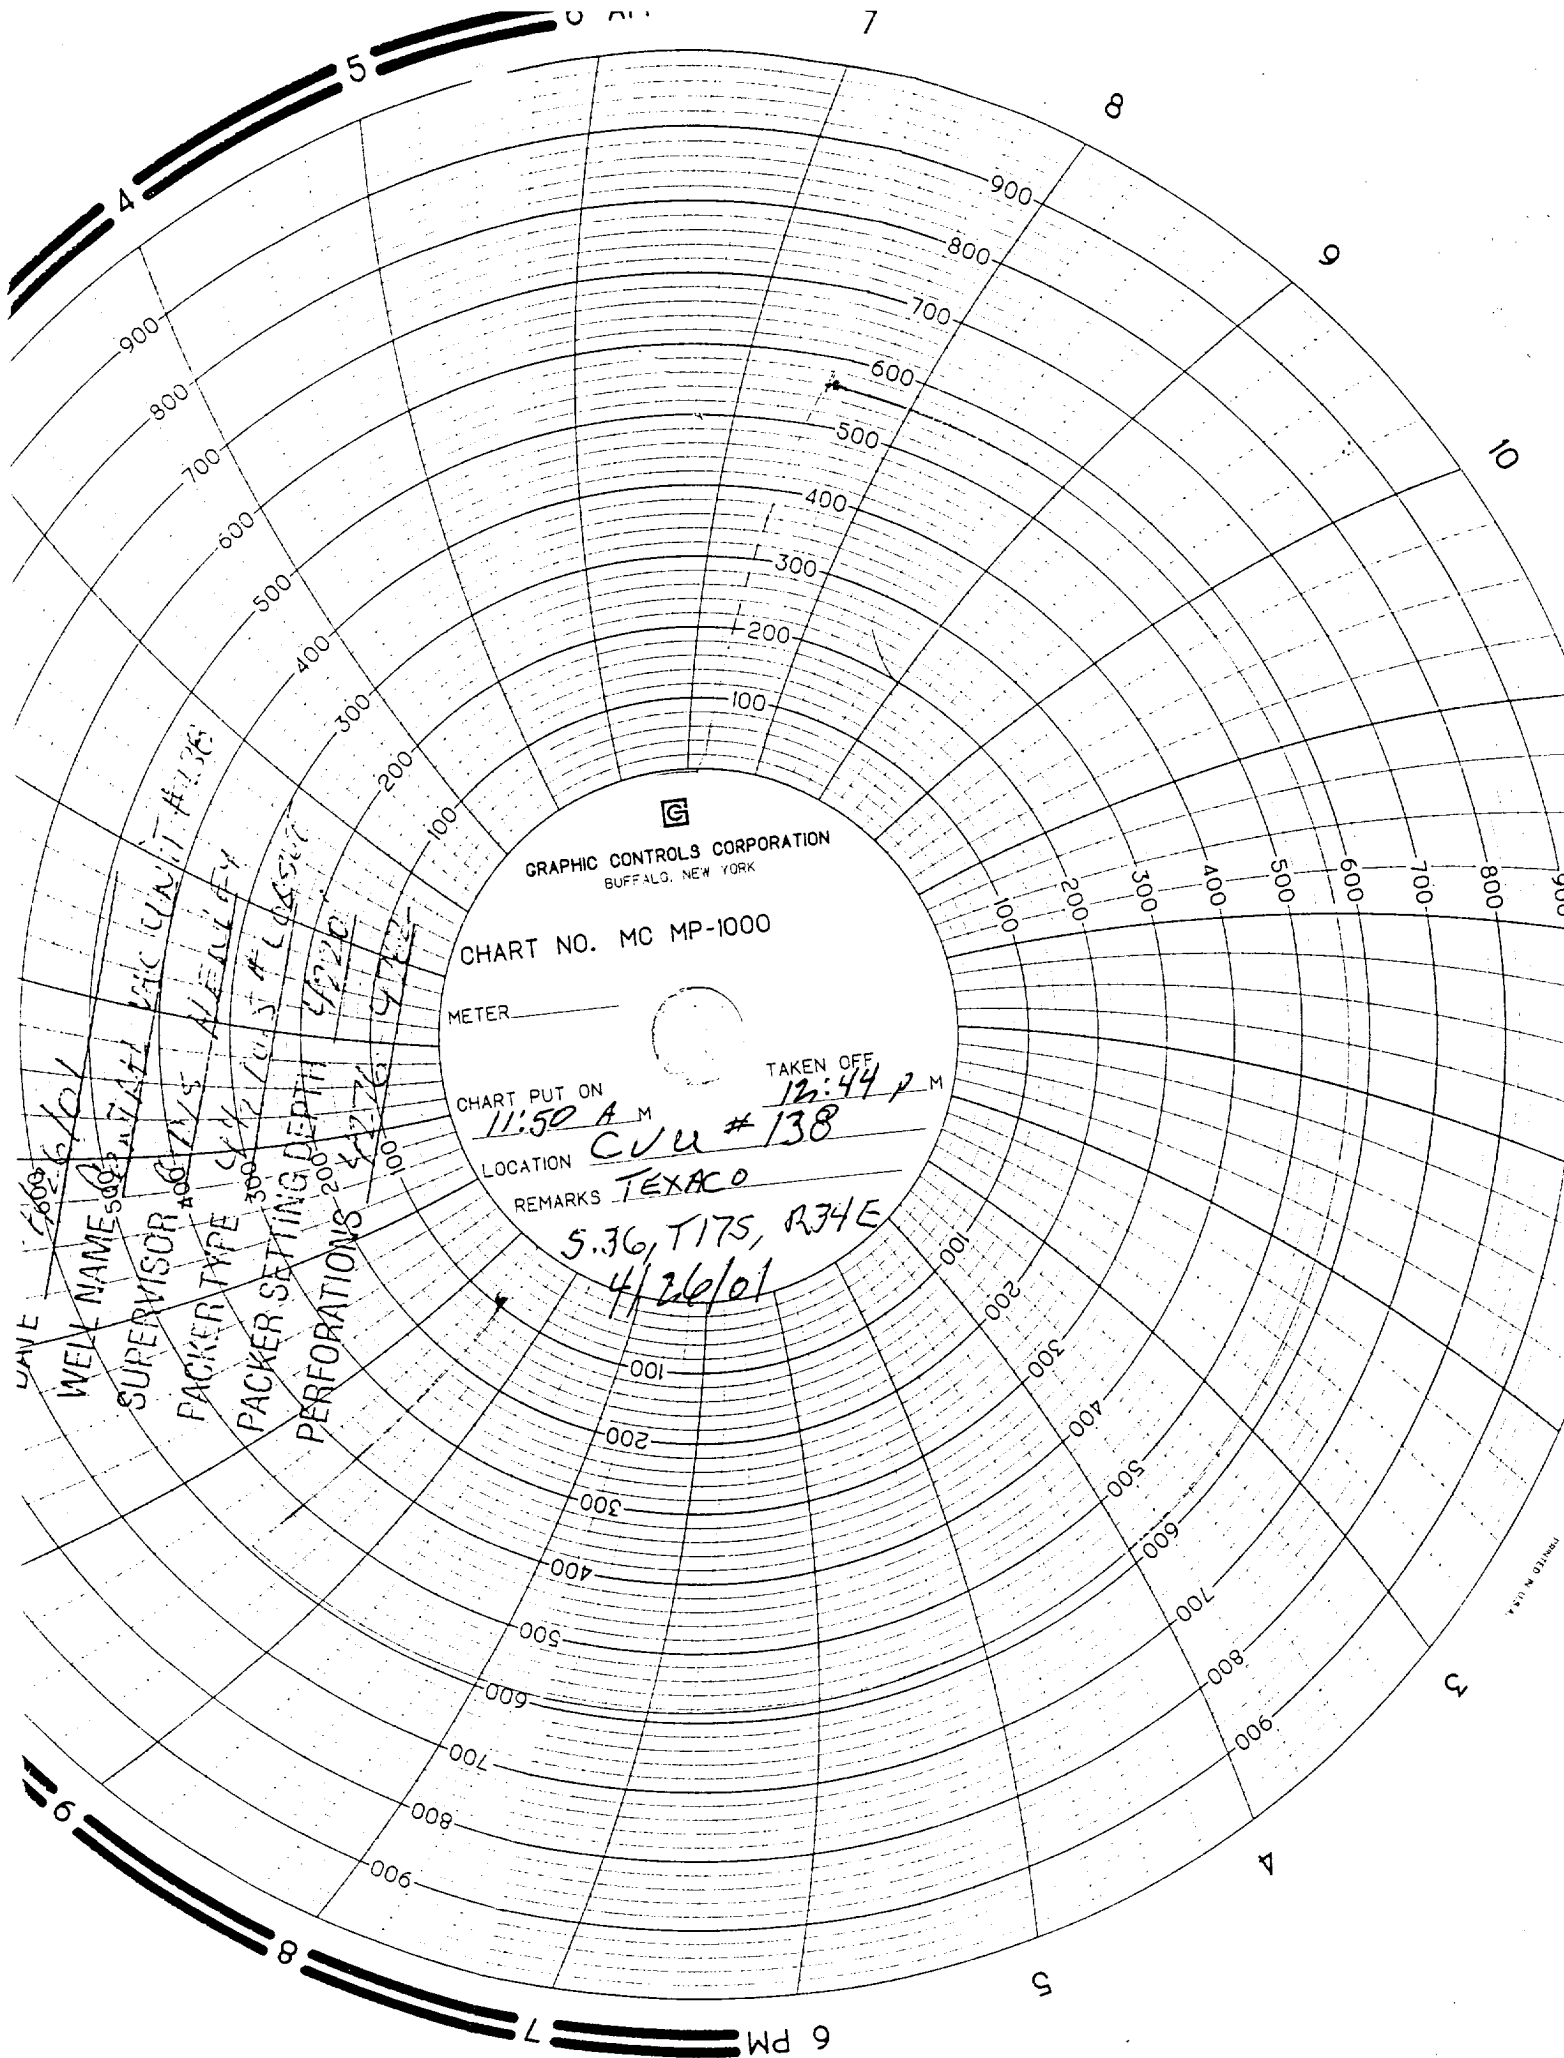

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

CHART NO. MC MP-1000

METER

CHART PUT ON

11:50 A.M.

TAKEN OFF

12:44 P.M.

LOCATION

CVU #138

REMARKS

TEXACO

5.36, T175, R34E

4/26/01

DATE 4/26/01
WELL NAME 5003 WATKINS
SUPERVISOR 40015 WATKINS
PACKER TYPE 300 1/2 IN. ST # L04500
PACKER SETTING DEPTH 4720
PERFORATIONS 4720-4740

PRINTED IN U.S.A.