

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-26794
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit
8. Well No. 150
9. Pool name or Wildcat Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER injection
2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, Tx 79702
4. Well Location Unit Letter <u>B</u> : <u>10</u> Feet From The <u>North</u> Line and <u>1330</u> Feet From The <u>East</u> Line Section <u>30</u> Township <u>17S</u> Range <u>35E</u> NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3972

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-23-95 Notify NMOCD of intent to plug & abandon well.
2-24-95 Set CICR @ 4492'. Sqz. 140sx cmt. below ret. at 1½ BPM-1700PSI.
Shut in 2700 PSI Cap CICR w/10sx cmt. CIRC well w/25# per bbl. salt gel mud.
2-24-95 POOH to 3900' Spot 25sx cmt. f/3900-3630'. WOC & tag 2-27-95 @ 3630'.
2-27-95 POOH to 3000' Spot 25sx cmt. f/3000-2579. WOC & tag 2579'.
2-27-95 POOH to 1800' Spot 35sx cmt. f/1800-1210. WOC & tag @ 1210.
2-28-95 POOH to 400' spot 30sx cmt. f/400-surface.
2-28-95 Dig out cellar; cut off well head; cap well & install dry hole marker.
clean location; rig down POOL & move off.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Calder TITLE P&A Supervisor DATE 3-3-95


TYPE OR PRINT NAME J. Calder TELEPHONE NO. _____

(This space for State Use)

APPROVED BY Carmy M. Lipp TITLE OIL & GAS INSPECTOR DATE MAY 08 1995

CONDITIONS OF APPROVAL IF ANY: _____

TEXACO E&P INC.
CENTRAL VACUUM U NO. 150 WW
API# 30 025 26794

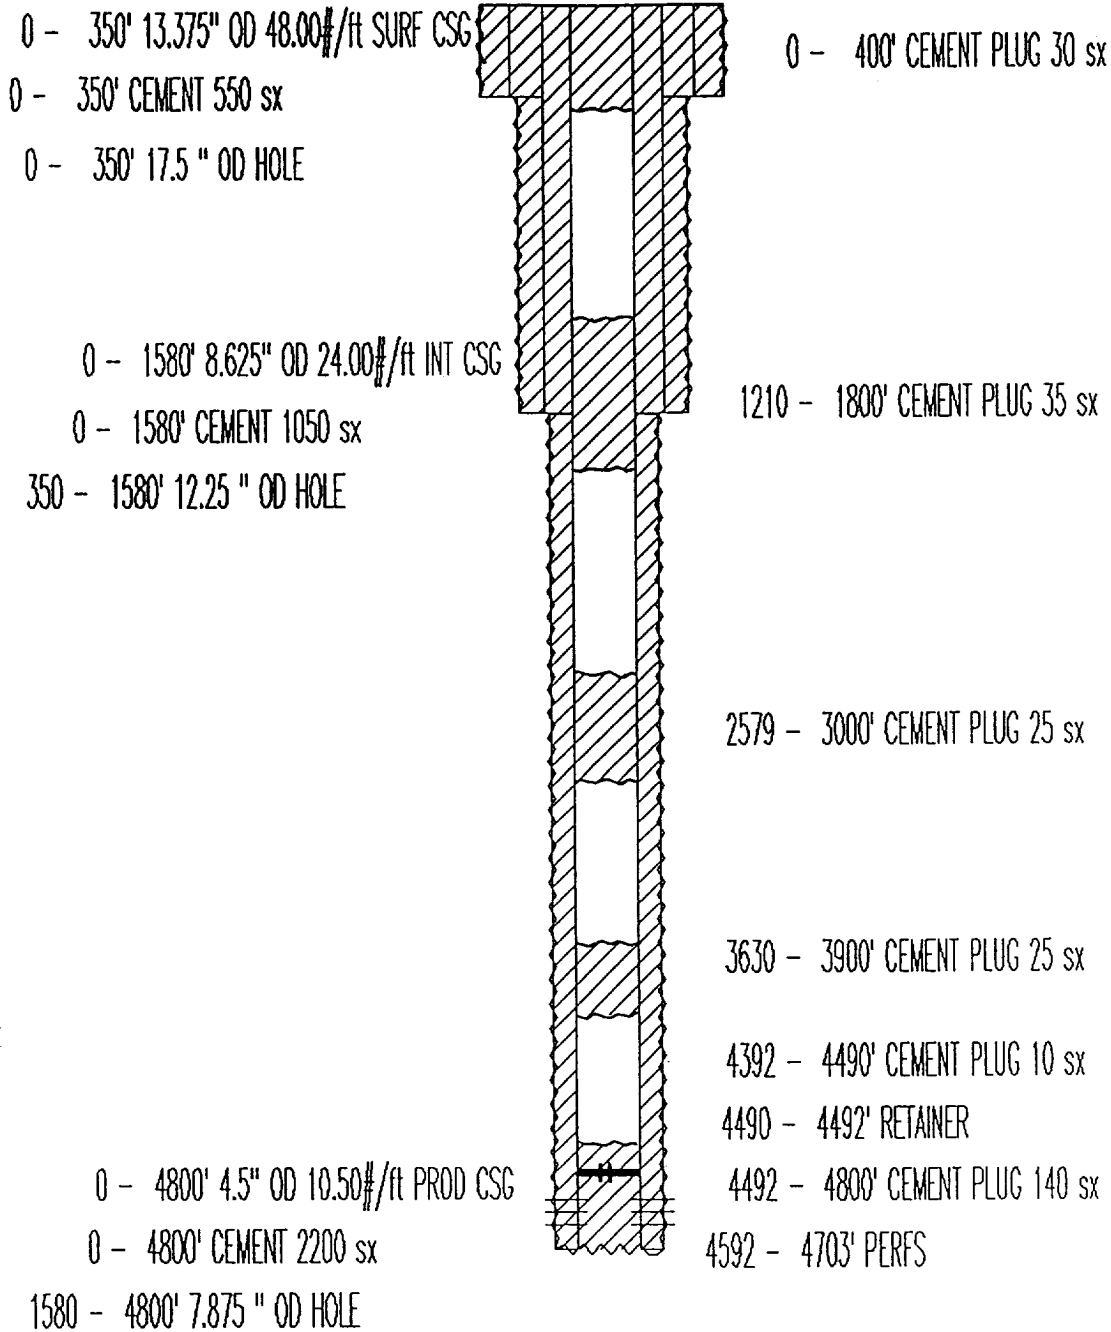

10 FNL & 1330 FEL
SEC 30 , TWN 17 S, RANGE 35 E
ELEVATION: 3972 GR
COMPLETION DATE: 12-24-80