

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-27236
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1056-1
7. Lease Name or Unit Agreement Name	VACUUM GLORIETA WEST UNIT
8. Well No.	35
9. Pool Name or Wildcat	VACUUM GLORIETA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3998' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter J : 2310 Feet From The SOUTH Line and 2308 Feet From The EAST Line
Section 25 Township 17-S Range 34-E NMPM LEA COUNTY

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: SQZ LOWER, PERF/STIM UPPER GLOR ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-01-00: MIRU. NUBOP.
5-02-00: TIH W/BIT, DC'S. RUN WS. TAG UP @ 5909'. LOAD/PSI CSG TO 500-OK. DRILL OUT CIBP @ 5909-5911'. RUN BIT TO 6010'. TAG FILL. C/O 6010-6058'.
5-03-00: TIH W/PKR, SN, & TBG TO 5895'. TEST CSG TO 500-OK. REL PKR. TIH W/CMT RET, TBG TO 5895'.
5-04-00: SET RET @ 5896'. TEST TBG TO 3000 PSI-OK. MIX 100 SX CL C CMT. PULL RET TO 5446'. REV OUT. LOWE4R TBG TO 5864'. TIH W/BIT, DC'S TBG TO 3400'.
5-05-00: TAG CMT @ 5865'. DRILL OUT CMT 5865-5895'. DRILL OUT RET 5895-97'. DRILL HARD CMT 5897-5960. NEW PBTD. DISPL W/130 BBLs 2% KCL WTR.
5-08-00: PERF GLORIETA FORM 5844-60, 5865-82, 5884-98, 5902-10, 5914-48. TIH W/PKR, SN, TBG. PSA 5800'. LOAD PSI CSG TO 500 PSI-OK.
5-09-00: ACIDIZE GLORIETA PERFS 5844-5948 W/7000 GALS 15% NEFE HCL ACID. FL @ 1400'. END FL @ 3800.
5-10-00: REL PKR. TIH & TAG @ 5996'. RESET PKR @ 5800'.
5-11-00: FL @ 1800. END FL @ 2800'.
5-12-00: REL PKR. TIH W/CIBP & PKR ON TBG TO 5800'. SET CIBP @ 5800. TEST & CHART CSG & CIBP FOR NMOCVD. INSTL WH FLANGE.
5-15-00: RIG DOWN.
WELL IS TA STATUS. FINAL REPORT

{INTERNAL STATUS: ASD-RFD}

This Approval of Temporary
Abandonment Expires

7-5-2005

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 6/26/00

TYPE OR PRINT NAME J. Denise Leake


Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: TITLE

DATE

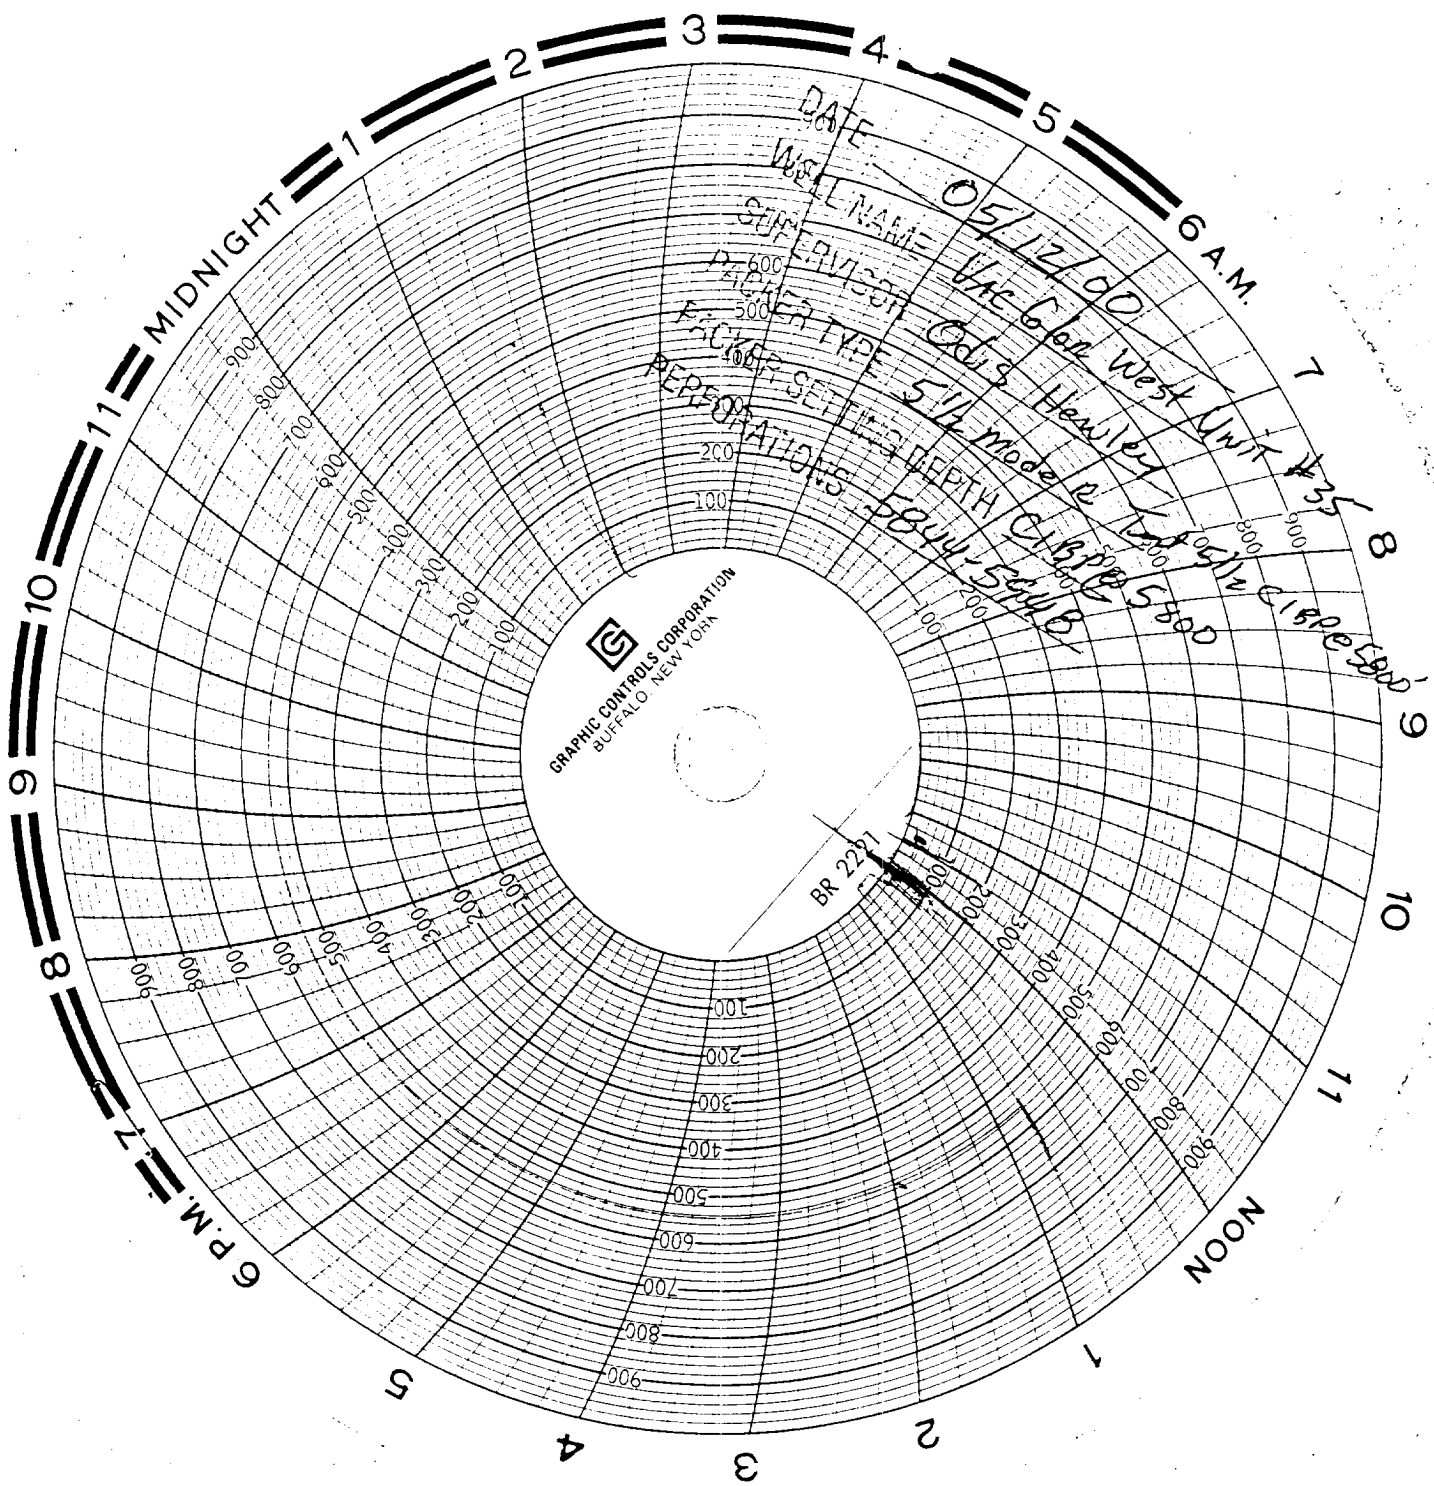

GRAPHIC CONTROLS CORPORATION
BUFFALO NEW YORK

Date 05/12/00
Well Name Vte Glen West Unit #35
Supervisor C. S. Hewley
Recorder Type 5 1/2 Model e
Personnel C. B. B. 5800
5844-5848
5849-5850

BR 2221