

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Sante Fe, NM 87505

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-28429

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
8015

7. Lease Name or Unit Agreement Name

Bridges State

8. Well No.
188

9. Pool name or Wildcat
Vacuum; Grayburg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other **Injector**

2. Name of Operator

Mobil Producing TX. & N.M. Inc.

3. Address of Operator **P.O. Box 4358**

Houston TX 77210-4358

4. Well Location

Unit Letter **F** : **2340** Feet From The **north** Line and **2630** Feet From The **west** Line

Section **25** Township **17S** Range **34E** NMPH **Lea** County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
4001' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
MULTIPLE COMPLETION <input type="checkbox"/>	PLUG & ABANDONMENT <input type="checkbox"/>
OTHER: <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: Temporarily Abandon <input checked="" type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion)

8/07/02 Inspected rig. Checked H2S monitor. Tested anchors, ok. MIRU WSU. Unflange well, installed and tested BOP. OK

8/08/02 Inspected rig. Checked H2S monitor. Opened well up, 0 psi. Unset packer. RU pump truck and vacuum truck. Circulated well clean. POOH with tubing and packer (142 joints 2-3/8" CL tubing). RU WLU. RIH with gauge ring to 4385', ok. POOH with gauge ring. RIH with CIBP and set at 4380'. RIH with cement bailer and dumped 35' cement on top of CIBP. RD WLU. RIH open end tubing to cement. SIFN.

8/09/02 Inspected rig. Checked H2S monitor. Opened well up. RU pump truck, and pressure test casing to 600 psi for 10 minutes, ok. Bled off psi. Pumped 120 bbls of packer fluid. RD pump truck and vacuum truck. POOH laying down tubing. Laid down 142 joints 2-3/8" CL tubing. Picked up 10 joints 2-3/8" for kill string. Removed BOP, flanged up. Closed in and RDMO WSU. Clean location.

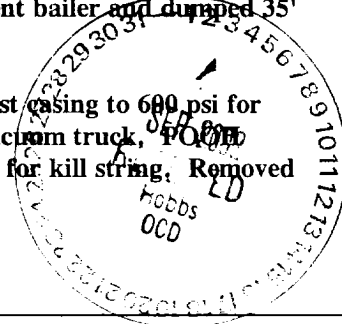

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Tiffany Stebbins TITLE Staff Office Assistant DATE 08/30/2002

TYPE OR PRINT NAME Tiffany A. Stebbins TELEPHONE NO. (713) 431-1207

(This space for State Use)
ORIGINAL SIGNED BY
GARY W. WINK
OC FIELD REPRESENTATIVE II/STAFF MANAGER

APPROVED BY _____ DATE _____

CONDITIONS OF APPROVAL IF ANY:

SEP 26 2002