

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-31840
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-155-6
7. Lease Name or Unit Agreement Name	VACUUM GLORIETA WEST UNIT
8. Well No.	82
9. Pool Name or Wildcat	VACUUM GLORIETA

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐ WATER INJECTION WELL ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter I : 2576 Feet From The SOUTH Line and 149 Feet From The EAST Line Section 36 Township 17-S Range 34-E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3986' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ CLEAN OUT & ACIDIZE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-27-01: MIRU. NDWH. NUBOP. REL PKR. LEFT PKR SWINGING @ 1538'.
3-28-01: TIH W/BIT & DC'S ON WS. TAG SCALE @ 5903'. BREAK CIRC W/15 BBLS 10# BRINE. CLEAN OUT SCALE TO 5998'. PULL BIT TO 5900'.
3-29-01: LOWER TBG. TAG SCALE 5998. CLEAN OUT TO 6296'. CIRC CLN. TIH W/PKR, & SN ON WS. SET PKR @ 5910'. TEST BACKSIDE TO 500#-OK.
3-30-01: ACIDIZE GLORIETA PERFS 5962-6085 W/2000 GALS 15% NEFE HCL. RU SWAB. FL @ SURF. END FL @ 1400'.
4-02-01: REL PKR. TIH W/PKR W/ON/OFF TOOL W/PROF ON TBG. TEST TO 3000#. STOP PKR @ 3733'.
4-03-01: TIH & TEST 67 JTS 2 3/8" TBG. SET PKR @ 5910'. REL ON/OFF TOOL. CIRC W/130 BBLS PKR FLUID. NDBOP. NUWH. LATCH BACK ON PKR & SET W/10,000# TENSION. PUMP OUT PLUG @ 1600#. PRESS CSG TO 500# & CHART FOR 30 MINS FOR NMOCD. (CHART ATTACHED). RIG DOWN.
4-15-01: ON 24 HR OPT. INJ'G 859 BWPD @ 1159 PSI.
GLORIETA PERFS: 5962-6085

FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 4/18/01

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405


(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____

DATE 4/18/01

JCS

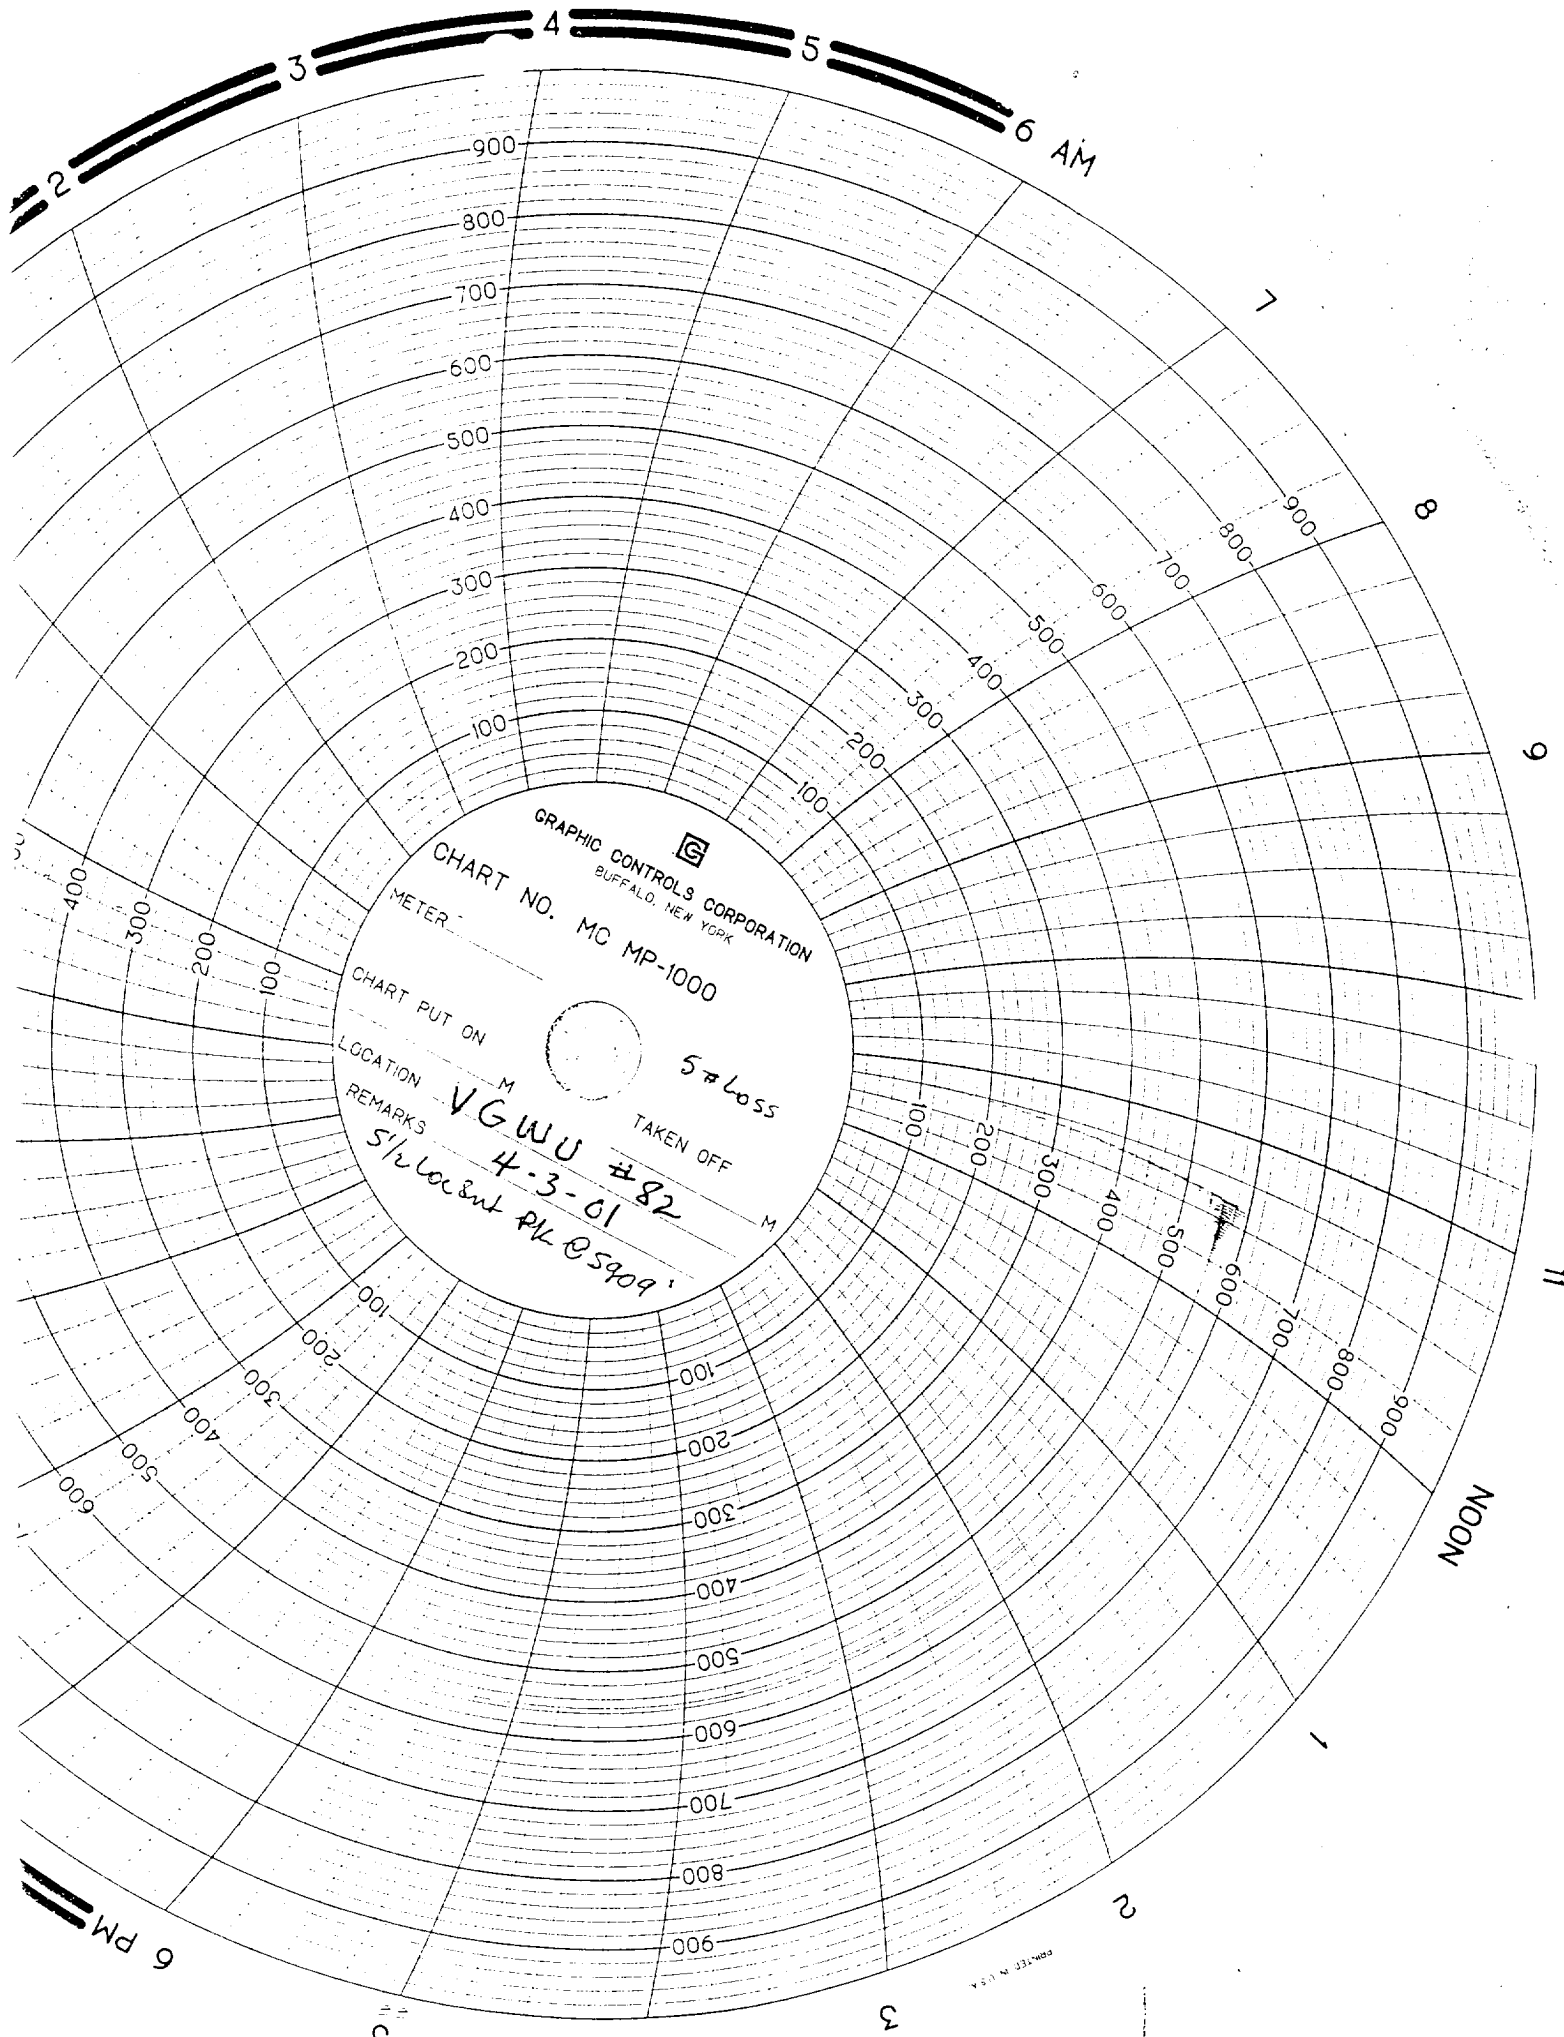

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

CHART NO. MC MP-1000
METER

CHART PUT ON

LOCATION

REMARKS

VGWU #82
4-3-01
S 1/2 Loc & PK @ 5909'

5# Loss

TAKEN OFF

PRINTED IN U.S.A.