


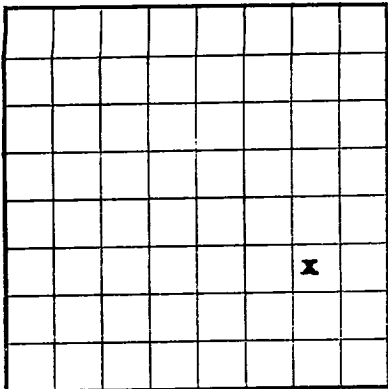

LOCATE WELL CORRECTLY

Company Drilling & Exploration Co., Inc. Address Box 2075 Hobbs, New Mexico
Lessor or Tract Fletcher "A" Field Lynch State New Mexico
Well No. 3 Sec. 27 T. 20S R. 34E Meridian NMPM County Lea
Location 1650ft. {N.} of S. Line and 990ft. {W.} of E. Line of Section 27 Elevation 3703
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.

Date April 1, 1957 Signed [Signature] Title Division Prod. Superintendent

The summary on this page is for the condition of the well at above date.
Commenced drilling January 23, 1957 Finished drilling March 6, 1957

OIL OR GAS SANDS OR ZONES
(Denote gas by G)

No. 1, from 3589 to 3595 No. 4, from _____ to _____
No. 2, from 3644 to 3688 No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from 940 to 980 No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
<u>13 3/8</u>	<u>48#</u>	<u>8</u>		<u>62</u>					<u>Surface</u>
<u>10 3/4</u>	<u>32#</u>	<u>8</u>		<u>718</u>		<u>718</u>			<u>Cave String</u>
<u>8 5/8</u>	<u>24#</u>	<u>8</u>		<u>1233</u>		<u>1233</u>			<u>Water String</u>
<u>7</u>	<u>23#</u>	<u>8</u>		<u>2843</u>		<u>2843</u>			<u>Cave String</u>
<u>5 1/2</u>	<u>14#</u>	<u>8</u>		<u>3640</u>	<u>Guide</u>		<u>1559</u>	<u>1560</u>	<u>Cil String</u>

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
<u>13 3/8</u>	<u>62</u>	<u>50</u>	<u>Bailer</u>		
<u>5 1/2</u>	<u>3640</u>	<u>1580</u>	<u>Pump & Plug</u>		

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out

TOOLS USED

Rotary tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet
Cable tools were used from 0 feet to 3688 feet, and from _____ feet to _____ feet

DATES

_____, 19____ Put to producing March 25, 1957

The production for the first 24 hours was 191 barrels of fluid of which 100 % was oil; _____ % emulsion; _____ % water; and _____ % sediment. Gravity, °Bé. 28.9

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____
Rock pressure, lbs. per sq. in. _____

EMPLOYEES

_____, Driller _____, Driller
_____, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
<u>0</u>	<u>45</u>	<u>45</u>	<u>Surface sand and caliche</u>
<u>45</u>	<u>910</u>	<u>865</u>	<u>Red Shale</u>
<u>910</u>	<u>970</u>	<u>60</u>	<u>Sand</u>
<u>970</u>	<u>1120</u>	<u>150</u>	<u>Sandy Shale</u>
<u>1120</u>	<u>1574</u>	<u>454</u>	<u>Red Shale</u>
<u>1574</u>	<u>1625</u>	<u>51</u>	<u>Anhydrite, Top Anhydrite 1574'</u>
<u>1625</u>	<u>1773</u>	<u>148</u>	<u>Anhydrite and Shale</u>
<u>1773</u>	<u>1810</u>	<u>37</u>	<u>Salt Top Salt 1773'</u>
<u>1810</u>	<u>2785</u>	<u>975</u>	<u>Anhydrite, Salt and Shale</u>
<u>2785</u>	<u>2849</u>	<u>64</u>	<u>Blue Shale</u>
<u>2849</u>	<u>3345</u>	<u>496</u>	<u>Anhydrite and Salt Base Salt 3345'</u>
<u>3345</u>	<u>3520</u>	<u>175</u>	<u>Lime and Anhydrite Top Yates 3520'</u>
<u>3520</u>	<u>3558</u>	<u>38</u>	<u>Shale and Lime</u>
<u>3558</u>	<u>3622</u>	<u>64</u>	<u>Lime and Sand</u>
<u>3622</u>	<u>3644</u>	<u>22</u>	<u>Lime</u>
<u>3644</u>	<u>3688</u>	<u>44</u>	<u>Sand and Lime Top Seven Rivers 3644'</u>

