

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIP DATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ Water Injection well		5. LEASE DESIGNATION AND SERIAL NO. LC-070397
2. NAME OF OPERATOR Gulf Oil Corporation		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR Box 670, Hobbs, New Mexico		7. UNIT AGREEMENT NAME West Pearl Green Unit 29
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 890 FWL, 1650 FWL, Sec 29, 19-S, 35-E		8. FARM OR LEASE NAME
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3758 GL	9. WELL NO. 29-20
		10. FIELD AND POOL, OR WILDCAT Pearl Green
		11. SEC. T., R., N., OR BLK. AND SURVEY OR AREA Sec 29, 19-S, 35-E
		12. COUNTY OR PARISH Lea
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) Convert to water injection	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐

(Other) _____
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

5000' MD. It is proposed to convert to water injection as follows: Clean out to 5000' with sand pump. Run 1 1/2" 11.60# Griberson Type "A" drillable packer and set at approximately 4547'. Run 2 joints of 2-3/8" J-55 plastic coated spacer pipe, 1, 1 1/2" 11.60# Griberson Type NEK dual packer, set at approximately 4767' (packers will straddle perforated interval 4511' to 4820') and 1 1/2" plastic coated tubing to surface. Land seal nipple in Type "A" packer and set dual packer in compression with 7000 - 8000#. Run short string of 1 1/2" plastic coated tubing and land in dual packer with 7000 - 8000 compression. Start injecting water.

18. I hereby certify that the foregoing is true and correct


SIGNED ORIGINAL SIGNED BY G. D. BORLAND TITLE Area Production Manager DATE March 1, 1965

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

*See Instructions on Reverse Side

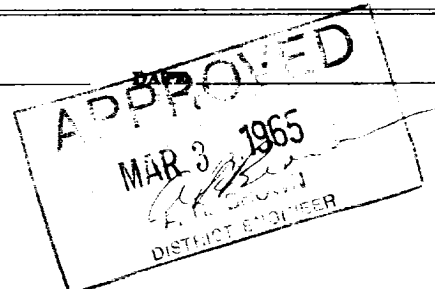

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.