

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-04107
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Rhombus Operating Co., Ltd.		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 8316, Midland, Texas 79708-8316		7. Lease Name or Unit Agreement Name: Northwest Eumont Unit
4. Well Location Unit Letter D : 660 feet from the North line and 660 feet from the West line Section 34 Township 19-S Range 36-E NMPM County Lea		8. Well No. #150
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eumont Yates

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.


08/08/02 Notified OCD, Sylvia Dickey. MIRU Triple N #25 and plugging equipment. POOH w/ rods and pump. ND wellhead, NU BOP. POOH w/ tubing. SDFN.

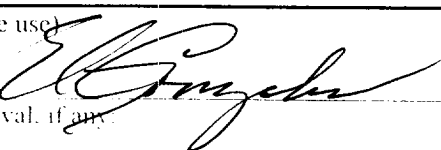
08/09/02 RIH w/ workstring to 3,826'. RU cementer and loaded hole w/ mud, pumped 25 sx C cmt @ 3,826'. PUH w/ 20 stands and WOC. RIH and tagged cmt @ 3,673'. RIH w/ tbg to 2,822' and pumped 25 sx C cmt 2,822 - 2,677'. POOH w/ tbg to 1,003' and pumped 25 sx C cmt 1,003 - 858'. POOH w/ tubing. RIH w/ wireline and perforated casing @ 388'. RIH w/ packer to 30' and loaded hole, set packer. Established circulation in 7 x 9-5/8" annulus and squeezed 50 sx C cmt 388 - 218'. SD for weekend.

08/12/02 POOH w/ packer. RIH w/ wireline and tagged cmt @ 210', POOH. RU cementer and pumped 10 sx C cmt 50' to surface. RDMO to #153.

08/14/02 Cut off wellhead and capped well, installed marker. Backfilled pit and cellar, cut off anchors.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE **Engineer** DATE **08/28/02**
Type or print name **James F. Newman, P.E.** Triple N Services, Inc. Telephone No. **915-687-1994**
(This space for State use)

APPROVED BY  TITLE **Field Rep** DATE **1-29-03**
Conditions of approval, if any:

GWW