
## OIL CONSERVATION COMMISSION

SCELLANGERE REPORTS ON HIFTLS

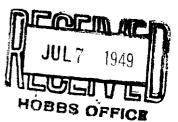

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below

| Indicate nature of r  | report by checking below.  |                     |
|---|--|---------------------|
| REPORT ON BEGINNING DRILLING OPERA-   | REPORT ON REPAIRING WELL   | x                   |
| REPORT ON RESULT OF SHOOTING OR CHEM-<br>ICAL TREATMENT OF WELL                               | REPORT ON PULLING OR OTHERWI<br>ALTERING CASING  | SE                  |
| REPORT ON RESULT OF TEST OF CASING SHUT-OFF   | REPORT ON DEEPENING WELL   |                     |
| REPORT ON RESULT OF PLUGGING OF WELL  |  |                     |
|   | July 6, 1949, Midland,   | Texas               |
| OIL CONSERVATION COMMISSION,<br>SANTA FE, NEW MEXICO<br>Gentlemen:                            | Date Pla   | ace                 |
| Following is a report on the work done and the results ob<br>Company's State of New Mexico "I | tained under the heading noted above at the The Well No. 4   | e Texas             |
| Company or Operator   | Leasewen No  | in the              |
|   | T  | _, N. M. P. M.,     |
| The dates of this work were as follows: See be  |  | County.             |
| The daves of this work were as follows:   |  |                     |
| Notice of intention to do the work was (was not) subm   |  | 19                  |
| and approval of the proposed plan was (was not) obtain  |  |                     |
|   | K DONE AND RESULTS OBTAINED  |                     |
|   | 353-Lime (Ground Heasurement   | s)                  |
| 5½" casing cemented at 3810' with   | 225 sacks.   |                     |
| Acidized well with 1,000 gals. Doon 4-29-49 well swabbed and flowed look hours.               | 1 $33\frac{1}{2}$ bbls oil and 11 bbls. w  | ,-20-49<br>water in |
| (See ba   | .ek)   |                     |
| Witnessed byName  | Company  | Title               |
| Subscribed and grown before we thin   | I hereby swear or affirm that the information  | on given above      |
| Subscribed and sworn before me this  6 day of July 19 49                                      | Name Name  | _                   |
| 1   |  | <del></del>         |
| MADELL PO Notary Public   | Position Dist. Supt.   |                     |
| MADELL PARTY Public   | Representing The Texas Company  Company or Operator  |                     |
| My commission expires June 1, 1951  | Address Box 1270, Midland, Te  | voo                 |
| my commission expires tutto 1, 1//1   | Address DOX 1270, MIGIANG, 16  | , Aas               |
| Remarks:  | Rou Harke  | BUMAC               |
| APPROVEL  | OIL & GAS INSPECT  | Name                |
| DateJUL 7   | · · · · · · · · · · · · · · · · · · ·  | Title               |
| The forest ages   | the state of the s |                     |

eas it, of gas. by gas lift 66 bbls oil and 350 bbls water in 24 hours. Used 584,000 8 Merla flow valves. Micked well off 6-27-49. In 6-30-49 well flowed with anall show oil in 3 hours. Ran Spinner Burvey. Ran 2" tubing with with 500 gals Chemical Process 15% actd on 6-15-49. Swebbed 48 bbis water 115# lead wool and 20 putty. Ran tubing to 1' off bottom. pertpioy Plugged back to 3853 with II pple off and 37 bble water in to hours. out coment plug to 3865. Dusped 2 sacks coment in hole to 3856:. On 5-30-69 awabbed 36 bbls water and 13 bbls oil in 5 hours. Drilled Dumped 7 gals hydromite in hole. "Alled up to 3824. 70 ponta, 5-24-49. 3832' with 350# hydromite. Swebbed 118 bbis werer and 31 bbis cil in Pulled tuping and drilled out cement plug 3843-3872. Plugged back to Swabbed 242 buls water and 15 bbls oil in 16 hours, 5-18-49. .Jnemeo Mo off or gas. TO PORTE ?=TS-P8" Plugged back to 3843 with A sack 2 2/3 sacks cement to 3855. Ren tubing and swaobed 237 bbls, water in 3878-3810 OU 2-2-69 Well swabbed 132 bbla, water in 8 hrs. No oil. Acidized well with 3,000 gale, nowell 15% acid