

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
A-166	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Atlantic Richfield Company		8. Farm or Lease Name O. O. Bradley
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240		9. Well No. 3
4. Location of Well UNIT LETTER <u>B</u> , <u>330</u> FEET FROM THE <u>North</u> LINE AND <u>1650</u> FEET FROM THE <u>East</u> LINE, SECTION <u>6</u> TOWNSHIP <u>19S</u> RANGE <u>38E</u> NMPM.		10. Field and Pool, or Wildcat Bowers Seven Rivers
15. Elevation (Show whether DF, RT, GR, etc.) 3637' DF		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☒  
CHANGE PLANS ☒  
OTHER ☐

SUBSEQUENT REPORT OF:

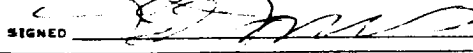
REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to change plug and abandon procedures as approved by your office on C-103 dated 6/4/75 as follows: (will leave 5½" OD casing in hole)

1. Rig up, install BOP & POH w/compl assy.
2. Run & set CIBP @ 3126'. Spot 35' cmt plug on top.
3. Fill hole w/heavy gelled mud between all plugs.
4. Spot 100' cmt plug inside 5½" OD csg across top of salt @ 1600'.
5. Spot 10 sk cmt plug @ surface, install regulation dry hole marker, clean & level location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <u>Dist. Drlg. Supv.</u>	DATE <u>9/10/75</u>
Orig. Signed by John Runyan Geologist		
APPROVED BY _____	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		

SEP 10 1975