

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

<p align="center">SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<p>5a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/></p> <p>5. State Oil & Gas Lease No.</p>
<p>1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/></p> <p>2. Name of Operator TEXACO Inc.</p> <p>3. Address of Operator P.O. Box 728 Hobbs, New Mexico 88240</p> <p>4. Location of Well UNIT LETTER F 1980 FEET FROM THE West LINE AND 1985 FEET FROM THE North LINE, SECTION 12 TOWNSHIP 20S RANGE 37E NMPM.</p>	<p>7. Unit Agreement Name</p> <p>8. Farm or Lease Name C.H. Weir 'A'</p> <p>9. Well No. 8</p> <p>10. Field and Pool, or Wildcat Monument Tubb</p>	
<p>15. Elevation (Show whether DF, RT, GR, etc.) 3574 (DF)</p>		<p>12. County Lea</p>

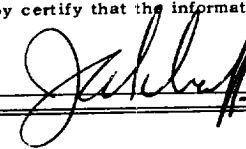
16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

<p>NOTICE OF INTENTION TO:</p> <p>PERFORM REMEDIAL WORK <input type="checkbox"/></p> <p>TEMPORARILY ABANDON <input type="checkbox"/></p> <p>PULL OR ALTER CASING <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>PLUG AND ABANDON <input type="checkbox"/></p> <p>CHANGE PLANS <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>SUBSEQUENT REPORT OF:</p> <p>REMEDIAL WORK <input type="checkbox"/></p> <p>COMMENCE DRILLING OPNS. <input type="checkbox"/></p> <p>CASING TEST AND CEMENT JOB <input type="checkbox"/></p> <p>OTHER <input checked="" type="checkbox"/> Complete in Monument Tubb</p>	<p>ALTERING CASING <input type="checkbox"/></p> <p>PLUG AND ABANDONMENT <input type="checkbox"/></p>
---	---	---	--

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Killed Drinkard string w/brine water.
- Set CIBP in Drinkard string @ 6790' and dumped 2½ sx cement on top of plug PBD 6750'.
- Tubb (previously Drinkard) - perforate 2 7/8 casing w/2 JSPF @ 6370-90, 98-99, 6410-30, 6444-52, 60-64, 6480-6500, 6540-44, 6616-25 by orientation.
- Acidize perforations w/6000 gals 15% NEA using 350 # benzoic acid flakes and 350 # rocksalt. Flush w/50 bbls lsa crude.
- Swabbed
- SI pending gas connection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Asst. Dist. Supt.	DATE August 26, 1974
APPROVED BY Joe D. Ramey	TITLE Dist. I, Supv.	DATE Aug 26 1974

CONDITIONS OF APPROVAL, IF ANY: