

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYCOPY TO O.C.C.
SUBMIT IN TRIPlicate*
(Other instructions on
reverse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐ JUN 2 8 30 AM '64		5. LEASE DESIGNATION AND SERIAL NO. LC 031621 (b)	
2. NAME OF OPERATOR Continental Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR Box 460, Hobbs, New Mexico		7. UNIT AGREEMENT NAME NMPU	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FWL & 1980' FWL, Sec 15, T-20S, R-37E, Lea County, New Mexico, NMPM.		8. FARM OR LEASE NAME Britt B	
14. PERMIT NO.		9. WELL NO. 10	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3566 RT		10. FIELD AND POOL, OR WILDCAT NMPU Field	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 15-20-37	
		12. COUNTY OR PARISH Lea	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

Isolate Gas Production

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

It is proposed to isolate gas production in the Britt B Well No. 10.

The proposed procedure for isolating the gas production is as follows:

1. Set bridge plug at 6550 & packer at 6480 to test intervals at 6496-6505, 6508-6512, & 6524-6534'.
2. Retrieve bridge plug & set at 6480 w/packer at 6420 to test interval 6430-6444'.
3. If gas zone can be located, isolate with straddle pkrs & produce from below straddle.
4. If gas zone cannot be located because of communication behind casing, spot cement behind casing through perfs at 6496' & squeeze all perfs w/100 sx low water loss cement using a drillable squeeze tool.
5. Perforate the intervals 6496-6505, 6508-6512, & 6524-6534' w/1 JSPF.
6. Acidize intervals w/3000 gals at the slowest rate & lowest pressure possible & swab back acid immediately after treatment.
7. Set Model "D" packer at 6200'.
8. Rerun tubing & place both zones on production.

Your approval is requested for the above work.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Assistant District Manager

DATE 5-22-64

(This space for Federal or State office use)


APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

USGS(5) NMCC(2) ARS PanAm-Hobbs(3) At1-Ros(2) Calif-Mid&Hou(1 ea)

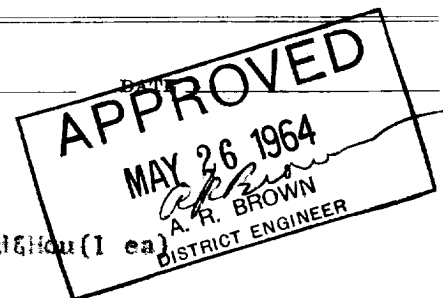

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.