

Submit 3 Copies To Appropriate District
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06286
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd., Midland, Texas 79704		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>I</u> : 1980 feet from the <u>South</u> line and <u>660</u> feet from the <u>East</u> line Section <u>30</u> Township <u>20S</u> Range <u>37E</u> NMPM Lea County		8. Well No. 114
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument Grayburg SA

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU.
2. Set 7" CIBP @ 3690', (Grayburg-San Andres)
3. Spot 75 Sx plug 3690'-3400' (Queen) WOC Tag.
4. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
5. Cut 7" Csg @ 2553', L/D Csg.
6. Spot 75 Sx plug 2603'-2400', (9 5/8" shoe, B-Salt) WOC Tag.
7. Perf 4 holes @ 1100', Sqz 100 Sx plug 1100'-1000' (T-Salt) WOC Tag.
8. Perf 4 holes @ 325', Sqz 100 Sx plug 325'-150' (12 1/4" shoe) WOC Tag.
9. 10 Sx Surface, Install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe

TITLE HES Specialist

DATE 5/22/2002

Telephone No. 915.687.7153

Type or print name G.R. Bledsoe
(This space for State use)

APPROVED BY
Conditions of approval, if any:


ORIGINAL SIGNED BY
GARY W. WALKER
OC FIELD REPRESENTATIVE/STAFF

DATE

PLUGGING & ABANDONMENT WORKSHEET

OPERATOR CHEV USA INC
 LEASE NAME EUNICE MONUMENT SOUTH UNIT
 WELL # 114

SECT 30 TWN 20-S RNG 37-E
 FROM 1980 N/S L 660 E/W L
 TD 3915 FORMATION @ TD GRAYBURG
 PBTD FORMATION @ PBTD S. ANDRES

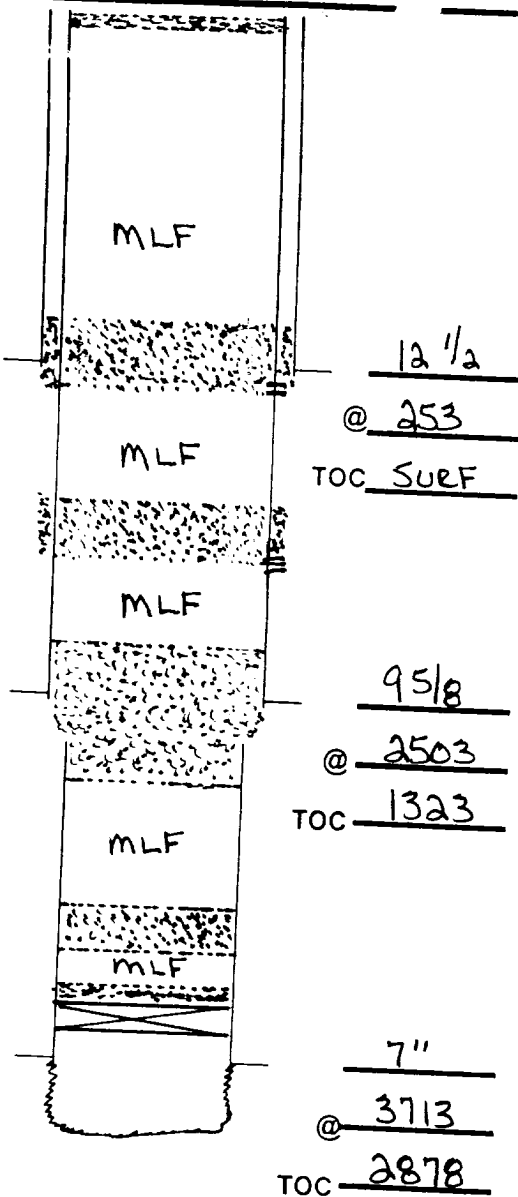

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	12 1/2	253	SURF	Circ
INTMED 1	95/8	2503	1323	CALC
INTMED 2				
PROD	7"	3713	2878	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	
INTMED 2		
PROD	2553	3713 - 3915

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	GRAYB. SA	CIBP	3690
YATES	2	QUEEN	75	3690
QUEEN	3	95/8 SHOE	75	2603
GRAYBURG	4	T-SALT	100	1100
SAN ANDRES	5	12 1/2 SHOE	100	325
CAPITAN REEF	6	SURF	10	10'
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

TD 3915

