

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

4. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
8-1481

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator CITIES SERVICE OIL COMPANY	8. Turn of Lease Name State F
3. Address of Operator P.O. Box 69, Hobbs, N.M. 88240	9. Well No. 3
4. Location of Well UNIT LETTER P 660 FEET FROM THE South LINE AND 660 FEET FROM THE East LINE, SECTION 30 TOWNSHIP 20S RANGE 37E N.M.P.M.	10. Field and Pool, or Willard Eunice-Grayburg S.A.
15. Elevation (Show whether DF, RT, GR, etc.) 3535 GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐


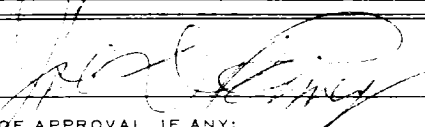
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 3838', Eunice-Monument. We propose to plug and abandon this well in the following manner:

1. Load hole with mud laden fluid.
2. Spot 50 sack cement plug (250') from TD 3838-3500'.
3. Shoot off and recover approximately 3000' of 7" casing.
4. Displace 40 sack cement plug (105') $\frac{1}{2}$ in and $\frac{1}{2}$ out of 7" casing stub.
5. Displace 40 sack cement plug (105') $\frac{1}{2}$ in and $\frac{1}{2}$ out of 9 5/8" casing shoe at 2528'.
6. Dump 10 sack cement plug in top of 9 5/8" casing from ground level to 30'.
7. Reclaim well head and install 4" dry hole marker.
8. Clean location of all materials and debris.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE District Manager	DATE Nov. 1, 1971
APPROVED BY 	TITLE	DATE NOV 3 1971
CONDITIONS OF APPROVAL, IF ANY:		