

FILE NO.	
DATE RECEIVED	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR APPLICATIONS TO DRILL OR TO REOPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROCEEDINGS.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Dual Oil/Gas Well	5a. Indicate Type of Lease State ☐ Fee ☒
2. Name of Operator ARCO Oil and Gas Company Division of Atlantic Richfield Company	5b. State Oil & Gas Lease No.
3. Address of Operator Box 1710, Hobbs, New Mexico 88240	7. Unit Agreement Name
4. Location of Well UNIT LETTER 0 660 FEET FROM THE South LINE AND 1980 FEET FROM East TOWNSHIP 26 RANGE 37E	8. Name of Lease Owner J. R. Cone "B"
15. Elevation (Show whether DF, RT, GR, etc.) 3376' GR	9. Well No. 2
	10. Field and Pool, or Whent Drinkard/Blinebry Gas
	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPER. ☐	PLUG AND ABANDONMENT ☐
FULL OR ALTER CASING ☐	OTHER Add Perfs & Treat - Both Zones ☒	CASING TEST AND CEMENT JOBS ☐	


17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up, kill well, install BOP & POH w/compl assy.
2. Clean out to PBD 6548'.
3. Perforate add'l Drinkard 6384, 88, 6400, 14, 28, 36, 42' w/1 JSPF.
4. Set RBP @ 6450'. RIH w/pkr, set pkr @ 6410'. Treat perfs w/2000 gals 15% NE HCL acid, 8000 gals 20% NE HCL acid, 8000 gal Versagel 1400 w/8000# sd.
5. Recover load, retrieve BP & POH w/pkr & BP.
6. Perforate add'l Blinebry Gas 5476, 83, 94, 5502, 10, 22, 32, 5542, 48, 56, 70, 80, 5617, 30, 37' w/1 JSPF.
7. RIH w/RBP, set BP @ 5900', pkr @ 5430' & treat perfs w/4000 gals 15% NE HCL acid, 18,000 gals 20% NE HCL acid & 18,000 gals Versagel 1400 carrying 12,000# sd in 2 stages. Recover load.
8. POH w/BP & pkr.
9. RIH w/dual completion assy & return both zones to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <i>Jerry Sexton</i>	TITLE Dist. Drlg. Supt.	DATE 8/29/79
Orig. Signed by Jerry Sexton Dist. L. Supr.	TITLE	DATE
APPROVED BY	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY		

SEP 4 1979

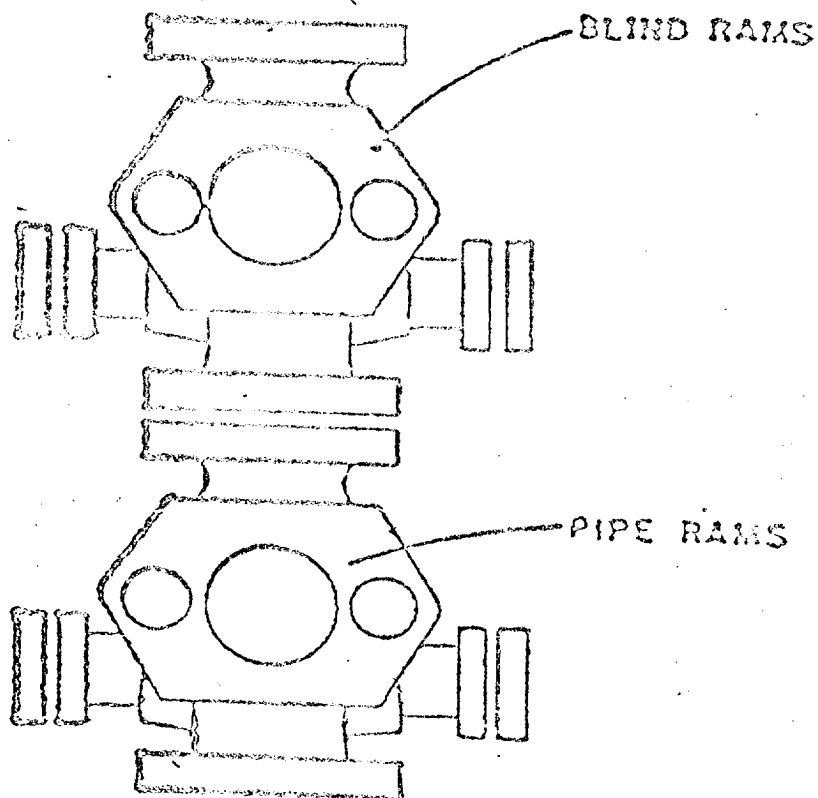

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name J. R. Cone "B "

Well No. 2

Location 660' FSL & 1980' FEL
Sec 26-21S-37E, Lea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. A wellhead fittings to be of sufficient pressure to operate in a safe manner.