

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.
30-025-06970

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

J.N. Carson (NCT-C)

8. Well No.

2

9. Pool name or Wildcat
Blinebry

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator Chevron USA, Inc.

3. Address of Operator 15 Smith Rd. Midland, Tx 79705

4. Well Location

Unit Letter A 460 feet from the north line and 635 feet from the east line

Section 33

Township 21-S

Range 37-E

NMPM

County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU

2. RIH set 7" CIBP @ 5410' spot 20sx plug 5410-5310(Blinebry) WOC Tag.

3. Displace hole w/MLF, 9.5 # Brine w/25# Gel p/BBL.


4. Spot 40sx plug 3800-3600(Queen)

5. Perf 4 holes @ 2900' sqz 75sx plug 2900-2700 (9 5/8 shoe, B-salt, Yates) WOC Tag.

6. Perf 4 holes @ 1400' sqz 75sx plug 1400-1200 (T-salt).

7. Perf 4 holes @ 350' sqz 100sx plug 7" X 9 5/8" X 13 3/8 csgs 350'-200' (13 3/8 shoe) WOC Tag.

8. 10 sx surf, Install dry hole marker.

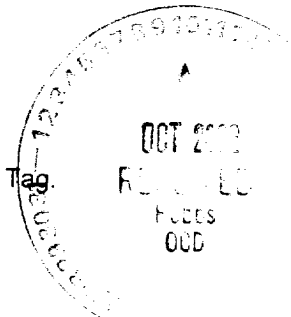

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G. R. Bledsoe TITLE HES Specialist DATE 10/9/2002

Type or print name G. R. Bledsoe Telephone No. 915.687.7153

(This space for State use) ORIGINAL SIGNED BY

GARY W. WINK

APPROVED BY OC FIELD REPRESENTATIVE DATE OCT 11 2002

Conditions of approval, if any: