

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-08876
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease: STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator: Chevron USA, Inc.		6. State Oil & Gas Lease No.:
3. Address of Operator: 15 Smith Rd. Midland, Tx 79705		7. Lease Name or Unit Agreement Name: Arrowhead Grayburg Unit
4. Well Location: Unit Letter H : 2310 feet from the North line and 350 feet from the East line Section 11 Township 22-S Range 36-E NMPM County Lea		8. Well No. 193
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Field name or Well name: Arrowhead-Grayburg


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Tag CIBP @ 3643 in 7" csg spot 40sx plug fr/3643' to 3420' (T/Queen) Tag @ 3391'
2. Displace hole w/MLF 9.5# Brine w/25# Gel p/BBL
3. Spot 40sx plug fr/2672' to 2572' (B-salt)
4. Spot 40sx plug fr/1483' to 1383' (T-salt) Tag @ 1273'
5. Perf 4 holes @ 423; circ cmt between 7" X 10 3/4" csg w/175sx (10 3/4" shoe) Tag @ surf
6. Install dry hole marker 9-9-02

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

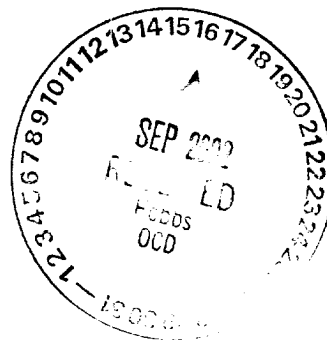

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Jimmy Bagley

TITLE **MANAGER / SUNSET**

DATE **9-9-02**

Type or print name

Jimmy BAGLEY

Telephone No. **915 520-8756**

(This space for State use)

Gary W. Wink

APPROVED BY

GARY W. WINK

TITLE

DATE **FEB 13 2003**

Conditions of approval, if any: **DC FIELD REPRESENTATIVE II/STAFF MANAGER**

GWW