

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
157

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" FORM C-101 FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator	8. Farm or Lease Name
Atlantic Richfield Company	State 157 "D"
3. Address of Operator	9. Well No.
P. O. Box 1710, Hobbs, New Mexico 88240	1 6
4. Location of Well	10. Field and Pool, or Wildcat
UNIT LETTER O 330 FEET FROM THE North LINE AND 1650 FEET FROM THE East LINE, SECTION 12 TOWNSHIP 22S, RANGE 36E NMPM.	Arrowhead Grayburg
11. Elevation (Show whether DF, RT, GR, etc.)	12. County
3466' GR	Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

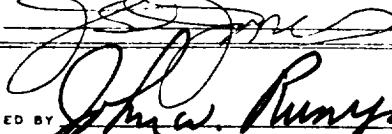
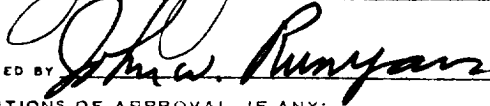
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rigged up to P&A on 11/20/75. Installed BOP.
2. Ran 2-3/8" OD EUE tbg OE to 3650'. Spotted 30 sx Cl C cmt 3250-3650' (400' plug). Tagged top of cmt plug @ 3250'.
3. Filled hole w/heavy gelled mud between all cmt plugs.
4. Ran free point on 5 1/2" OD csg. Free point indicated @ 312'. Cut 5 1/2" csg @ 312' & rec 312'.
5. Ran 2-3/8" OD EUE tbg OE & spotted 85 sx Cl C cmt cont'g 4% gel & 2% CaCl across 5 1/2" OD csg stub @ 312' & to top of csg @ surface.
6. Installed regulation dry hole marker, clean & levelled location. P&A eff 11/25/75.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Dist. Drlg. Supv.	DATE 12/4/75
APPROVED BY 	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

17 8 1975

CONSERVATION COMM.

1975. 11. 11.