

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO.
30-025-20336

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

B-1167

7. Lease Name or Unit Agreement Name

State J

15323 (Property Code)

8. Well No. 6

9. Pool name or Wildcat

Oil Center Blinberry

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil ☒
Well

Gas ☐
Well

OTHER ☐

2. Name of Operator

David H. Arrington Oil & Gas, Inc.

3. Address of Operator

PO Box 2071; Midland, Texas 79702

4. Well Location

Unit Letter N 330 Feet From The South Line and 1980 Feet From The West Line

Section 32 Township 20S Range 32E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3536' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER ☐

SUBSEQUENT REPORT OF

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work; SEE RULE 1103.)

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

1. Rig up P&A equipment. Dig and line work pit. NU BOP.

2. Tally in hole w/ bit and scraper

3. RIH w/ open ended tubing. Tag TD at 5860'.

4. Spot a 30 sx. plug. PUH & WOC. Tag top of plug @ 5725'.

5. PUH to 2750'. Spot a 20 sx. plug. PUH & WOC. Tag plug @ 2600'. (Base of salt)

6. Perforate casing at 1900' (top of salt)

7. RIH w/ packer. Set packer at 1600'. Squeeze perms w/ 55 sx. cement. WOC & tag.

8. Pull 4-1/2" casing from free point.

9. RIH w/ tubing to 1219'. Spot 55 sx. plug. PUH & WOC. Tag top of plug at ?

10. RIH w/ 8-5/8" packer. Find casing leak

11. RIH w/ tubing to 50' below casing leak. Fill hole w/ cement.

12. POOH w/ tubing. Close BOP. Displace cement w/ 3 bbls. SWI and WOC.

13. Tag top of plug at 45'.

14. Cut off wellhead. Fill hole w/ cement. Install P&A marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

H. Boatright

TITLE Agent

DATE 11/14/02

TYPE OR PRINT NAME

H. Boatright

TELEPHONE NO 915/570-5382

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY
GARY W. WINK

TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER

NOV 29 2002



WELL NAME AND NUMBER

State J #6

David H. Arrington Oil & Gas, Inc.
Lea County, New Mexico

State Lease No. B-1167

WELLBORE CONFIGURATION

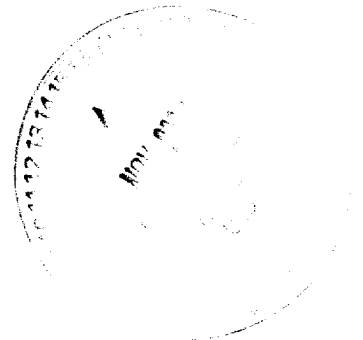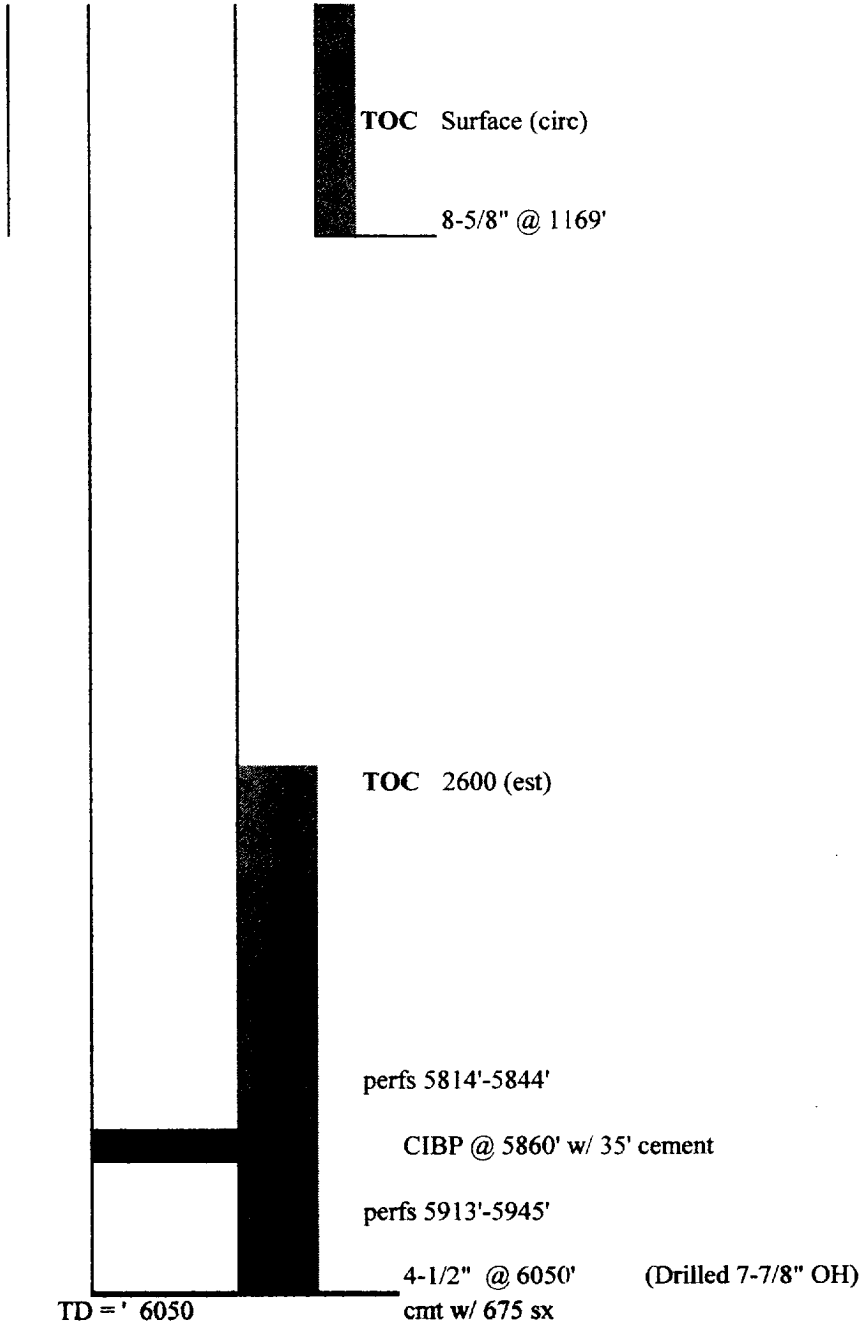

WELL NAME AND NUMBER

State J #6

David H. Arrington Oil & Gas, Inc.

Lea County, New Mexico

After Plug and Abandonment

State Lease No. B-1167

WELLBORE CONFIGURATION

