

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPlicate
(Other instructions on
reverse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC-031736 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR PAN AMERICAN PETROLEUM CORPORATION	8. FARM OR LEASE NAME GILLULLY B Federal
3. ADDRESS OF OPERATOR BOX 68, HOLDS, N. M. 88240	9. WELL NO. 13
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface	10. FIELD AND POOL, OR WILDCAT WEIR DANKARD
14. PERMIT NO. 2086 FNL x 1814 FEL Sec 22 (Unit G, SW 1/4 NE 1/4)	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 22-20-37 NMDM
15. ELEVATIONS (Show whether LF, RT, GR, etc.) 3451' R.D.B.	12. COUNTY OR PARISH LEA
	13. STATE NM

10. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE DRILLED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

All possible pay zones have been evaluated and no further attempts justified. Propose to P+A as follows: (all intervals to be filled w/mud laden fluid.)
Spot 35 st. cement plug across perfor 6600-6706.
Pull 5 1/2" from appt 4600 (Est TCMT 4600)
Spot 30 st cement plug in & out of 5 1/2" stub.
" " " " " 9 7/8" shoe @ 3777.
Pull 9 7/8" from appt 1500 (Est TCMT-1500)
Spot 50 st. cement plug in & out of 9 7/8" stub.
" " " " " 13 3/8" shoe @ 339'
" 10 st " " @ surface and erect P+A marker.
Make final cleanup and restore ground to contour.
13 3/8" CSA 324; 9 7/8" CSA 3777; 5 1/2" CSA 7803.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE AREA SUPERINTENDENT

DATE MAY 6 1970

(This space for Federal or State office use)

APPROVED BY


CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

O+ 4-1555-H
1-HCJ
1-SUSP
1-RRY

*See Instructions on Reverse Side

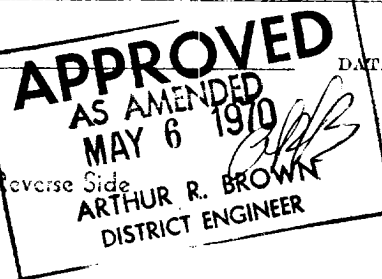

AMENDMENT:

If 9-5/8" casing is pulled from below 1300 feet
place this plug at 1200-1300 feet, or an additional
25 sack plug (minimum) at 1200-1250 feet.

RECEIVED

MAY 12 1970

OIL CONSERVATION COMM.
HOBBS, N. M.