

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒ **XX**

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Imperial-American Management Company	8. Farm or Lease Name Walker
3. Address of Operator 507 Midland Savings Bldg., Midland, Texas 79701	9. Well No. 2
4. Location of Well UNIT LETTER E , 1980 FEET FROM THE North LINE AND 660 FEET FROM THE West LINE, SECTION 30 TOWNSHIP 21-S RANGE 38-E NMPM.	10. Field and Pool, or Wildcat Wantz Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3417.6' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:


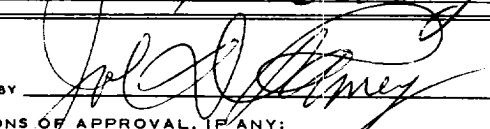
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/> XX	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We propose to plug and abandon this well as follows:

1. Load hole w/9.5# mud.
2. Set 35 sx cement plug from 6850-7050' in 7" csg.
3. Shoot off 7" csg at free point, est. 2400' & pull same.
4. Set 100' cement plug at base of salt section 2650-2750'.
5. Set 100' cement plug at top of salt section 1470-1570'.
6. Set 50 sx cement plug from 810-910', half in - half out of 9-5/8" csg.
7. Set 10 sx cement plug from 0-20'.
8. Set surface marker and clean up location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Division Manager	DATE 3-17-71
APPROVED BY 	TITLE SUPERVISOR DISTRICT	DATE MAR 19 1971

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

MAR 10 1971

OIL CONSERVATION COMM.
HOBBS, N. M.