

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>B-1638-1</b>

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <b>Injection</b>	7. Unit Agreement Name
2. Name of Operator <b>TEXACO Inc.</b>	8. Farm or Lease Name <b>Eunice-Monument Unit</b>
3. Address of Operator <b>P. O. Box 728, Hobbs, New Mexico 88240</b>	9. Well No. <b>24</b>
4. Location of Well UNIT LETTER <b>I</b> , <b>660</b> FEET FROM THE <b>East</b> LINE AND <b>1980</b> FEET FROM THE <b>South</b> LINE, SECTION <b>19</b> TOWNSHIP <b>20-S</b> RANGE <b>37-E</b> NMPM.	10. Field and Pool, or Wildcat <b>Eunice (Grayburg-San Andres)</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3536' (DF)</b>	12. County <b>Lea</b>

16.

### Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

#### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

OTHER ☐

PLUG AND ABANDON ☐

CHANGE PLANS ☐

OTHER ☐

#### SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

COMMENCE DRILLING OPNS. ☐

CASING TEST AND CEMENT JOBS ☐

OTHER **Perforate** ☒

ALTERING CASING ☐

PLUG AND ABANDONMENT ☐

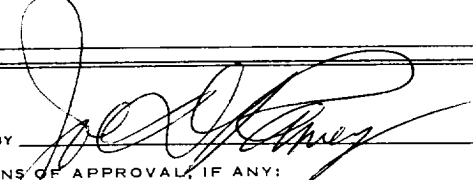
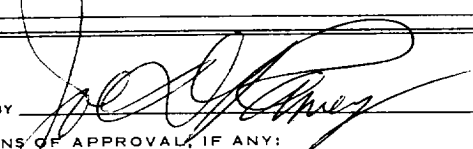
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**Total Depth 3950'**  
**Plug Back Total Depth 3932'**  
**4-1/2" O.D. 9.50# Casing Set At 3950'**

**Perforate 4-1/2" O.D. casing w/2 JSPI at 3647', 3651', 3670', 3675', 3711', 3733', 3766', 3803', 3811', 3816', 3820', 3826', 3831', 3836', 3840', 3848', 3854', 3860' and 3866'.**

**Run tubing w/packer and set at 3601', Acidize perforations from 3647' to 3866' w/6000 gals 15% NE Acid in 4 stages with a total of 1400# grated rock salt between stages. Pulled packer and tubing.**

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <b>District Superintendent</b>	DATE <b>July 30, 1970</b>
APPROVED BY 	TITLE <b>SUPERVISOR DISTRICT</b>	DATE <b>JUL 31 1970</b>
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

JUL 3 1970

OL CONSERVATION, C. M.  
HARRIS, N. M.