

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CONQUEST INC

3. Address and Telephone No.

10 Dasta Drive STE 100W, Midland, TX 79705 (915) 688-6551

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SEC. 21, T-20S, R-38E, LTR "M"

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice


TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other ADDITION PAY
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completions on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

10-18-94 MIRU. POH PUMP & TBG. RIH W/6 1/2 BIT. SCRAPER ON 2 7/8 WS. CO TO PBTD @ 6704. POH. PERF TUBE W/1JSNE AS FOLLOWS: 6531, 40, 46, 52, 65, 68, 70, 80, 87, 90, 93, 95, 8816, 20, 43, 48, 55, 57, 61, 64, 67, 73, 78, 86, 89, 92, 94, 96. RIH W/TREATING PKR. SN. 3 1/2 WS TO 5800. FRAC TUBE W/60,000 GAL SPECTRA -G-4000 & 101,000# 16/30 OTTAWA SAND & 40,000# 16/30 RCS @ 40-45 BPM. SPEARHEADED W/3000 GAL 15% NEFE HCL. REL PKR. POH 3 1/2. RIH W/BIT. TAGGED FILL @ 6626. CO TO PETD. POH. RIH W/RBP & PKR. SET RBP TO 2000PSI. POH. PERF BLINEBRY 1SPF @ 6218. 23, 35, 40, 42, 90, 92, 96, 6305, 13, 22, 27, 32, 39, 47, 77, 80, 86, 88, 97, 99, 6414, 30, 38, 40, 42, 44, 47. RIH W/PKR ON 4 1/2. SET PKR @ 6179. FRAC BLINEBRY W/SPEARHEAD 3000 GAL 15% NEFE-PUMP 238 BBL TAGGED DUMMY FRAC. SAND FRAC W/ 1150 BBL PAD - 863 BBL CROSS-LINK. RAMPING 168,000# 16/30 OTTAWA. RIH W/3 3/4 BIT & 2 3/8 PROD TBG. POH. RIH W/2 3/8 TBG. DO SAND TO PKR @ 6179. POH W/ 2 3/8. REL PKR. POH 4 1/2 WS. RIH W/RET HEAD ON 2 7/8 WS. CO SAND TO RBP @ 6520. REL RBP. POH. RESET RBP @ 6200. POH. RIH W/PKR & SET @ 5798. ACID UPPER BLINEBRY W/4500 GAL 15% ONE SHOT ACID & 20 BRADY SAND @ 5BPM. REL PKR & RIH & ENGAGED RBP. POH. RIH W/PROD STRING. RIH W/PUMP & RODS. RIGGED DOWN 11-11-94.

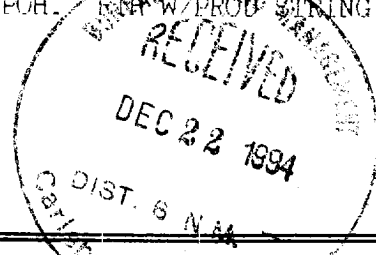

14. I hereby certify that the foregoing is true and correct

Signed

Title

STAFF REGULATORY ASSISTANT New Mexico

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

RECEIVED

JUN 10 1935

HOBBSS
OFFICE