

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.

30-025-28639

Indicate Type of Lease

STATE ☒

FEE ☐

State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

Name of Operator

Exxon/Mobil

Well No.

1

Address of Operator

Pool name or Wildcat

East grama Ridge

Well Location

Unit Letter K : 1980 Feet From The South Line and 1980 Feet From The West Line

Section 11 Township 22S Range 34E NMPM Lea County

Elevation (Show whether DF, RKB, RT, GR, etc.)

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1.) Notify NMOCD of Intent to plug and abandon
 - 2.) Set wireline CIBP @ 12,640'
 - 3.) Cap CIBP with 25 sks of "H" cement
 - 4.) Spot 30 sks of "H" cement @ 11,056'-10,956' (liner top)
 - 5.) Spot 30 sks of "H" cement @ 8,300'-8,200'
 - 6.) Spot 30 sks of "C" cement @ 7,455'-7,355' (DV tool)
 - 7.) Cut & pull 7 5/8 casing @ freepoint
 - 8.) Spot 100' of cement @ casing cut 50' in, 50' out WOC & Tag
 - 9.) Spot 50 sks of "C" cement @ 5,245'-5,145' (10 3/4 shoe) WOC & Tag
 - 10.) Spot 50 sks of "C" cement @ 3,335'-3,235' (DV Tool)
 - 11.) Spot 50 sks of cement @ 2,250'-2,150' (salt)
 - 12.) Spot 50 sks of "C" cement @ 1,115'-1,015' (16" shoe) WOC & Tag
 - 13.) Spot 20 sk surface plug 30'- surface
 - 14.) Cut off wellhead & anchors 3' BGL. Cap well w/ steel plate. Install dry hole marker.
- NOTE: 10# Mud laden fluid inbetween cement plugs.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE [Signature] TITLE Agent DATE 11-21-00

TYPE OR PRINT NAME Jack Shelton TELEPHONE NO. 915-523-5155

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

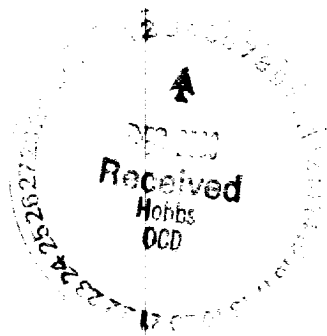

KB 3567 - 22' ABOVE GL

LEASE & WELL NAME: EAST GRAND RIDGE STATE OH #1
 FIELD: E. GRAND RIDGE COUNTY: LEA ST.: NM
 LOCATION: 1980' FBL, 1980' FWL, SEC. 11, T22S, R34E

DATE: 9-14-80 BY: RBB REV.: _____ BY: _____

HOLE SIZE: 20
 TOC: SURF circ 50x

16 • 1065
 CMT 700 SX

HOLE SIZE: 14 3/4
 TOC: 800' OMC

BEFORE
 WO

10 3/4 • 5195
 CMT 3000 SX

HOLE SIZE: 9 1/2
 TOC: ?

TOL @ 11006'

7 5/8 • 11312
 CMT 1575 SX

5 1/2 @ 13443'

TD: 13443 PBD: 13396

400 SX
 TOC @ 12800'

CASING RECORD

SURFACE CASING

O.D.	WT/FT	GRADE	SET AT
16	65	N-40	1065
10 3/4	51,455	J-55	5195

PRODUCTION CASING

7 5/8	29.7		11312
5 1/2 LNC	20		11046 - 13443

TUBING

NO. JTS.	O.D.	THD.	TYPE	WT.	GDE.	SET AT
	2 3/8				N-80	12670

WELL HISTORY:

9/84 D&C BY L&B OIL COMPANY UNDER THE
 NAME EAST GRAND RIDGE STATE OH 2-11
 PERF 13150'-60' (48DF). ACIDIZE W/ 2000 GAL
 7.5% HCL
 PERF 12800'-10', 12819'-23' (48DF)
 STRUP 8000', SITP 6429', RHT = 184°F

11/85 SIRUP 48HRS 6393#

12/88 SIRUP 1724#

3/89 SIRUP 1927# (ST 4 DAYS)

6/89 ADD PERFS 12743'-49' (48DF). INSTALL
 COMPRESSOR

BHA: OTIS WD PRR W/ 2.75" I.D.
 2'-8" SEAL BORE EXTENSIONS
 10' PUP
 OTIS RH MOORE W/ 1.79 I.D. (5' BEHIND TOP OF PRR)
 MINERALS CORROSION

BEFORE
 WORKOVER
 SKETCH

