

Mexico Oil Conservation Division, Hobbs, NM 88240
1625 N. French Drive
UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
NM-2379

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Covington A Federal #38

9. API Well No.
30-025-34753

10. Field and Pool, or Exploratory Area
W. Red Tank Delaware

11. County or Parish, State
Lea County, NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Pogo Producing Company

3. Address and Telephone No.

P. O. Box 10340, Midland, TX 79702-7340 (915)685-8100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1650' FNL & 2620' FEL, Section 26, T22S, R32E

G

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice


TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other **Add Pay**
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

07/25/02 TOH w/ rods, pump & tbq.
07/26/02 Perf Delaware 7983-88, 7997-8002 w/ 1 jspf. TIH w/ RBP & set @ 8470'. Test to 3000# ok.
Acdz 7983-8002 (OA) w/ 1000 gals 7-1/2% acid. Swab.
07/30/02 TIH. Catch & release RBP @ 8470. Pull RBP to 7916 & set. Test to 3000# ok. Perf Delaware
7842-52 w/ 1 jspf.
07/31/02 Acdz 7842-52 w/ 1000 gals 7-1/2% acid. Swab.
08/02/02 Release RBP @ 7916. TIH to 8467 & set RBP. Test to 3500# ok.
08/03/02 Frac Delaware perfs 7842-52 & 7983-8002 (OA) w/ 44,000# 20/40 TLC + 44,000# 20/40

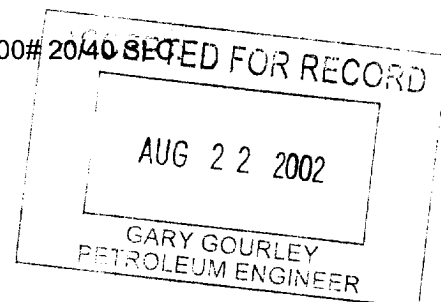

14. I hereby certify that the foregoing is true and correct

Signed

Cathy Smith

Title **Sr. Operation Tech**

Date **08/12/02**

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date