

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06740
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	ARGO A
8. Well No.	8
9. Pool name or Wildcat	WANTZ ABO
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3438' DF

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	Shell Western E&P Inc.
3. Address of Operator	P.O. Box 576 Houston, TX 77001-0576 (WCK 4587)

4. Well Location	Unit Letter D : 990 Feet From The NORTH Line and 990 Feet From The WEST Line
Section 22	Township 21S Range 37E NMPM LEA County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	SUBSEQUENT REPORT OF:		
NOTICE OF INTENTION TO:			
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: TA'D <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7-02 TO 7-09-92:

NOTIFIED NMOCD OF WELL BEING TA'D. POH W/PROD EQMT. CO TO 6800'. SET CIBP @ 6777'. PT CSG TO 500# FOR 30 MIN. WOULD NOT HOLD DUE TO GAS IN CSG. CIRC HOLE W/25 BBLS FW. PT BACKSIDE TO 500#, DID NOT HOLD. POH W/2-3/8 IN. TBG. RIH W/PKR TO 6755'. PT CIBP TO 500# FOR 15 MIN, HELD. PU PKR TO 6380'. PT SQZD DRINKARD PERFS 6409' - 6634' TO 500#, LOST 70# IN 10 MIN. PT BACKSIDE TO 500# FOR 30 MIN, HELD. (CHART ATTACHED) POH W/TBG & PKR. SECURED WELL FOR TA'D STATUS. CLN LOC. WELL TA'D.

PURSUANT TO THE PROVISIONS OF NMOCD RULE 203, SHELL WESTERN HEREBY REQUESTS TEMPORARY ABANDONMENT STATUS FOR A PERIOD OF FIVE YEARS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Marcus Winder TITLE TECH. MANAGER - ENVIR. ENG. DATE 7/14/92


TYPE OR PRINT NAME W. F. N. KELLDORF TELEPHONE NO. 713/870-3797

(This space for State Use)
ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE JUL 27 1992

CONDITIONS OF APPROVAL, IF ANY:

This Approval of Temporary
Abandonment Expires 7-14-93

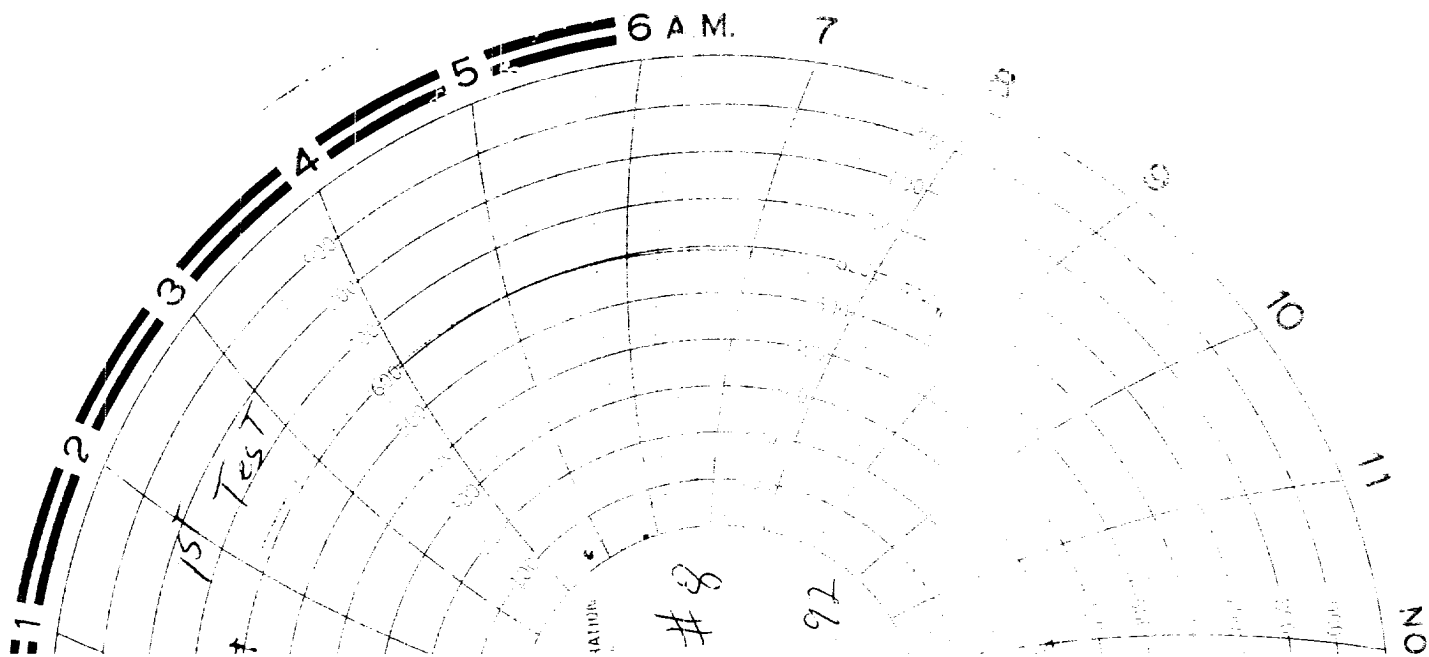

Skell Western

ARGO "A" No. 8

T A '1

Plot 11. Hydro