

Submit 3 Copies to Appropriate District

Office

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

811 South First, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

DISTRICT IV

1220 South St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

**OIL CONSERVATION DIVISION**  
1220 South St. Francis Drive  
Santa Fe, NM 87505

FORM C-103  
Revised March 25, 1999

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. <b>30-025-06753</b>
1. Type of Well: <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		5. Indicate Type of Lease <input type="checkbox"/> STATE <input checked="" type="checkbox"/> FEE
2. Name of Operator <b>Apache Corporation</b>		6. State Oil & Gas Lease No.
3. Address of Operator <b>2000 Post Oak Blvd., Ste. 100, Houston, Texas 77056-4400</b>		7. Lease Name or Unit Agreement Name <b>Turner</b>
4. Well Location Unit Letter <b>N</b> : <b>915</b> Feet From The <b>South</b> Line and <b>1650</b> Feet From The <b>West</b> Line Section <b>22</b> Township <b>21S</b> Range <b>37E</b> NMPM <b>Lea</b> County		8. Well No. <b>11</b>
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <b>3409' GR</b>		9. Pool name or Wildcat <b>Penrose Skelly, Grayburg</b>

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


- |  |   |
|--|---|
| <input type="checkbox"/> Perform Remedial Work | <input type="checkbox"/> Plug and Abandon |
| <input type="checkbox"/> Temporarily Abandon   | <input type="checkbox"/> Change Plans     |
| <input type="checkbox"/> Pull or Alter Casing  |   |
| <input type="checkbox"/> Other                 |   |

SUBSEQUENT REPORT OF:

- |   |   |
|---|---|
| <input type="checkbox"/> Remedial Work                | <input type="checkbox"/> Altering Casing      |
| <input type="checkbox"/> Commence Drilling Operations | <input type="checkbox"/> Plug and Abandonment |
| <input type="checkbox"/> Casing Test and Cement Job   |   |
| <input checked="" type="checkbox"/> Other             | Plugback to Grayburg                          |

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 10/12/2001 MIRU and pull out of hole w/ production equipment.
- 10/15/2001 Run in hole w/ CIBP and set @ 5190' w/ 35' cement on top.
- 10/17/2001 Perforate Grayburg 3740-3748, 3768-3772, 3777-3790, 3802-3825, 3832-3842, 3851-3882.
- 10/18/2001 Acidize Grayburg 3740' - 3882' w/ 4500 gals 15% HCL.
- 10/23/2001 Frac Grayburg 3740' - 3882' w/ 23200 gals gel & 44000# 16/30 sand
- 10/24/2001 Run in hole and tag sand @ 3590'. Clean out sand to 4200'. Circulate hole clean.
- 10/25/2001 Run in hole w/ 2-7/8" production tubing and set @ 3912'. Set pumping unit. Return well to production in Grayburg pool.

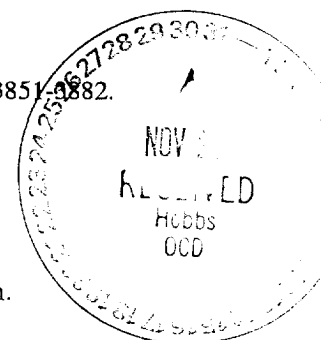

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Debra J. Anderson*  
Debra J. Anderson

TITLE

Sr. Engineering Technician

DATE

11/28/2001

TYPE OR PRINT NAME

TELEPHONE NO.

713-296-6338

(This space for State Use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

2A Paddock

JAN 15 2002