

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

3a. Indicate Type of Lease	
State ☐	Fee ☐
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL ☒ Dual GAS ☐ WELL ☐ OTHER- ☐		7. Unit Agreement Name
2. Name of Operator ARCO Oil and Gas Company Division of Atlantic Richfield Co.		8. Farm or Lease Name S.J. Sarkeys
3. Address of Operator P.O. Box 1710, Hobbs, NM 88240		9. Well No. 6
4. Location of Well UNIT LETTER J, 2310 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 23 TOWNSHIP 21S RANGE 37E NMPM.		10. Field and Pool, or Wildcat Drk/Wantz Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3368' GR		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPNS. ☐
PULL OR ALTER CASING ☐	CASING TEST AND CEMENT JOBS ☐
PLUG AND ABANDON ☐	ALTERING CASING ☐
CHANGE PLANS ☐	PLUG AND ABANDONMENT ☐
OTHER Commingle Drk/Wantz Abo DH ☒	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to commingle Drk & Wantz Abo down hole per Administrative Order #DHC-454 in the following manner:

1. Rig up, POH w/rods & pump. Install BOP & POH w/2-3/8" OD production assy.
2. RIH w/bit, CO cmt to top of CIBP @ 6650', dirll & push to btm @ 7370'.
3. Run csg inspection log.
4. Perf Wantz Abo w/2 JSPF @ 6893, 6920, 22, 98, 7063, 65, 71, 74, 7108, 15, 22, 29, 77, 7228, 41, 87'.
5. Set pkr @ 6800', establish injection rates and acidize Abo perfs 6893-7330' w/7500 gals 15% NEFE acid. Swab & test. POH w/pkr.
6. Set RBP @ 6850', pkr @ 6332' & acidize Drk perfs 6432-6611' w/6500 gals 15% NEFE acid. Swab & test.
7. POH w/ pkr & rec RBP @ 6850'.
8. RIH w/single comp assy. RIH w/rods & pump. Test for production, return to production w/ Drk & Wantz Abo commingled down hole.


18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Edith W. Seay</u>	TITLE <u>DRUG ENG</u>	DATE <u>2/15/84</u>
Oil & Gas Inspector		FEB 16 1984
APPROVED BY	TITLE	DATE

RECEIVED

FEB 15 1984

C.C.D.
HALLS OFFICE

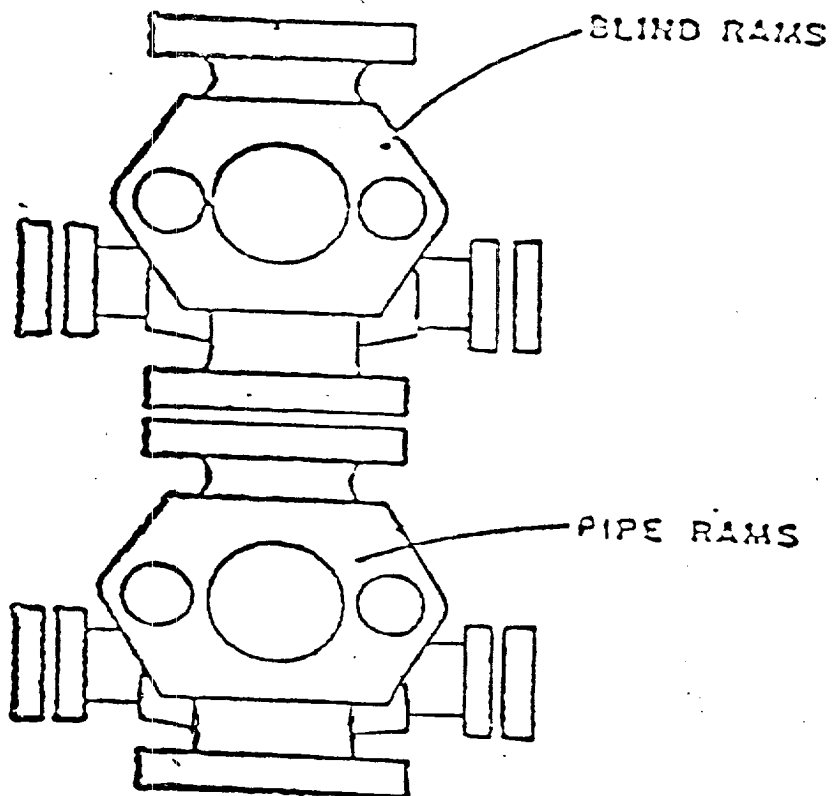

ARCO Oil & Gas Company
 Division of Atlantic Richfield Company
 Blow Out Preventer Program

Lease Name S.J. Sarkeys

Well No. 6

Location 2310' FSL & 1980' FEL
Sec 23, T21S, R37E

Lea County, NM
 BOP to be tested when installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.

RECEIVED

FEB 15 1984

U.S.
HOUSE OF REPRESENTATIVES