

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

HOBBES, NEW MEXICO 88240 NM 17252

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Colvin Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 17, T-20-S, R-39-E

12. COUNTY OR PARISH

Lea

13. STATE
New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Alpha Twenty-One Production Company

3. ADDRESS OF OPERATOR

P.O. Box 1206, Jal, NM 88252

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660' ENL & 330' FEL, Sec. 17, T-20-S, R-39-E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3539' Ground Level

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Completion Attempt

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

4-9-82 Attempted completion in the San Andres by perforating the following: 4300, 4310, 4312, 4314, 4316, 4328, 4329, 4330, 4331, 4332, 4333. (11 Perfs)
Acidized with 3000 gals. 15% MCA acid; recovered load and frac'd well with 20,000 gals. frac fluid and 425 sx. sand.

4-14-82 Set CIBP @ 3801'.
Attempted completion in the Queen by perforating the following: 3389, 3390, 3392, 3397, 3415, 3417, 3419, 3451, 3453, 3454, 3455, 3456, 3457, 3458, 3494, 3496, 3525, 3565, 3729, 3730. (20 Perfs) Acidized with 4000 gals. 15% HCL acid; recovered load.

4-20-82 Set CIBP @ 3360'.
Attempted completion in the Seven Rivers/Yates by perforating the following: 2889, 2890, 2892, 2916, 2918, 2920, 2922, 2924, 2926, 2946, 2948, 2950, 2952, 2970, 2972, 2974, 2976, 2978, 2980, 2982, 2985, 2987, 2988, 3075, 3076, 3078, 3085, 3086, 3087, 3100, 3101, 3120, 3122, 3123, 3124, 3136, 3162, 3199, 3200, 3224, 3235, 3236, 3326. (43 Perfs) Acidized with 3000 gals. 15% NE acid; recovered load, and frac'd well with 60,000 gals. frac fluid and 1310 sx. sand.

18. I hereby certify that the foregoing is true and correct

SIGNED

Robert W. Lansford

TITLE V. Pres/Energy Resources

DATE 6-8-82


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

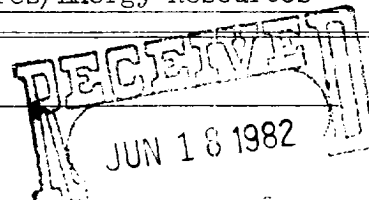

ACCEPTED FOR RECORD

SEP 14 1983

*See Instructions on Reverse Side
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

ROSWELL, NEW MEXICO

CPD 48 88-111 111

SEP 15 1983

SEP 15 1983

RECEIVED
SEP 15 1983
O.C.D.
HOBBS OFFICE