



STATE OF NEW MEXICO  
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT  
OIL CONSERVATION DIVISION  
HOBBS DISTRICT OFFICE

GARREY CARRUTHERS  
GOVERNOR

January 19, 1989

POST OFFICE BOX 1980  
HOBBS, NEW MEXICO 88241-1980  
(505) 393-6161

Estacado, Inc.  
P.O. Box 5587  
Hobbs, NM 88241

Attn: Donald L. Garey

Re: Fields Federal #2-M  
Section 25, T23S, R32E  
Salt Water Disposal Well

Gentlemen:

The revised procedure for plugging the above-referenced well which was approved by the BLM January 6, 1989, is satisfactory with the Oil Conservation Division.

Very truly yours,

OIL CONSERVATION DIVISION

Jerry Sexton  
Supervisor, District I

ed

# ESTACADO, INC.

P.O. BOX 5587

HOBBS, NEW MEXICO 88241

(505) 393-6300

January 16, 1989

Oil JS

Mr. Jerry Sexton  
Oil Conservation Division  
P. O. Box 1980  
Hobbs, New Mexico 88240

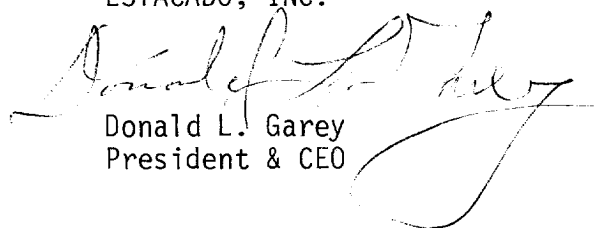
Re: No. 2 Fields Federal  
M-25-23S-32E  
Lea County, New Mexico  
Triste Draw Delaware Field

Dear Mr. Sexton:

The attached "Intention to Abandon" has been approved by the Bureau of Land Management subject to your like approval. With your approval we will initiate the procedures to plug.

Very truly yours,

ESTACADO, INC.

  
Donald L. Garey  
President & CEO

DLG/jb

Attachment

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TR  
(Other Instruct.  
reverse side)

CATE  
or re

Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-063228

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL ☐ GAS ☐ OTHER ☒ SWD Well

2. NAME OF OPERATOR  
Estacado, Inc.

3. ADDRESS OF OPERATOR  
P. O. Box 5587, Hobbs, New Mexico 88241

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

990' FSL & 330' FWL  
UNIT LETTER "M"

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, CR, etc.)

3713 DF

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Fields Federal

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Triste Draw Delaware

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 25, T-23-S, R-32-E NMPM

12. COUNTY OR PARISH 13. STATE

LEA

NM

18. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

REVISED

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETION

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(Note: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

PROCEDURES

1. Move in and rig up plugging equipment. Dig work pit. Install BOP
2. Pick up workstring. RIH & tag CICR at 5000' & spot a 35' cmt plug.
3. PUH to 4900'  $\pm$  mix 10# mud & circulate the hole.
4. PUH to 4765'  $\pm$  (Base of Salt) & spot a 100' cmt plug, POOH w/tubing.
5. Rig up wireline. Perf casing at 1175'  $\pm$  (T/Rustler 1208')
6. Establish circulation down through 4 1/2" casing & up 4 1/2"/7 5/8" annulus.
7. Fill casing with cmt. inside and out from perfs to the surface.
8. Cut off wellhead 3' below ground level and install dry hole marker.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE President

DATE 12/15/88

(This space for Federal or State office use)

APPROVED BY

TITLE

CHIEF, MINERAL RESOURCES

DATE

CONDITIONS OF APPROVAL, IF ANY:

Subject to  
Like Approval  
by State

\*See Instructions on Reverse Side

RECEIVED  
DEC 19 12 25 PM '88  
CARL  
BUREAU  
FEE