

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103  
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. <b>30-025-09045</b>
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input checked="" type="checkbox"/> injection		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator <b>Marathon Oil Company</b>		6. State Oil & Gas Lease No. <b>A-2614</b>
3. Address of Operator <b>P.O. Box 2490, Hobbs, NM 88240</b>		7. Lease Name or Unit Agreement Name: <b>South Eunice (7R/Q) Unit</b>
4. Well Location Unit Letter <b>C</b> : <b>660</b> feet from the <b>North</b> line and <b>1,650</b> feet from the <b>West</b> line Section <b>26</b> Township <b>22-S</b> Range <b>36-E</b> NMPM County <b>Lea</b>		8. Well No. <b>#302</b>
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>3,482' GL; 3,492' KB</b>		9. Pool name or Wildcat <b>South Eunice (7R/Q)</b>

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

04/11/02 Notified OCD, Sylvia Dickey. MIRU, NU BOP. POOH w/ tubing. Tagged CIBP @ 3,554'.

04/12/02 RIH w/ tubing, tagged CIBP previously set @ 3,554'.

04/15/02 Notified OCD, Sylvia Dickey. Circulated hole w/ mud, pumped 25 sx C cmt 3,554 - 3,307'. POOH w/ tbg to 3,200' and pumped 25 sx C cmt 3,200 - 2,953'. POOH w/ tbg. Perforated casing @ 1,300', POOH w/ wireline. RIH w/ AD-1 packer to 900'. Loaded hole, set packer, established rate of 1 BPM @ 1,000 psi and squeezed 40 sx C cmt 1,300 - 1,000'. WOC and POOH w/ packer. RIH w/ wireline, tagged cmt @ 1,000', POOH. Perforated casing @ 396', POOH. RIH w/ packer to 130'. Loaded hole, set packer, established circulation and squeezed 50 sx C cmt, SI well and SDFN.

04/16/02 Notified OCD, Sylvia Dickey. Tagged cmt @ 272'. Pumped 15 sx C cmt 60' to surface.

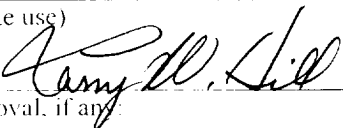
04/19/02 Cut off wellhead, installed dryhole marker. Cut off anchors, backfilled pit & cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE **Engineer** DATE **04/26/02**

Type or print name **James F. Newman, P.E.** **Triple N Services, Inc.** Telephone No. **915-687-1994**

(This space for State use)

APPROVED BY  TITLE **COMPLIANCE OFFICER** DATE **JUN 07 2002**

Conditions of approval, if any

GWW