

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

|                                                    |                                                                        |
|----------------------------------------------------|------------------------------------------------------------------------|
| WELL API NO.                                       | 30 025 10040                                                           |
| 5. Indicate Type of Lease                          | STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> |
| 6. State Oil / Gas Lease No.                       | 806510                                                                 |
| 7. Lease Name or Unit Agreement Name               | STICHER, E. A.                                                         |
| 8. Well No.                                        | 3                                                                      |
| 9. Pool Name or Wildcat                            | TUBB OIL & GAS (OIL)                                                   |
| 10. Elevation (Show whether DF, RKB, RT, GR, etc.) |                                                                        |

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

|                                                    |                                                                                                                                                                                                   |
|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1. Type of Well:                                   | OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>                                                                                     |
| 2. Name of Operator                                | TEXACO EXPLORATION & PRODUCTION INC.                                                                                                                                                              |
| 3. Address of Operator                             | 205 E. Bender, HOBBS, NM 88240                                                                                                                                                                    |
| 4. Well Location                                   | Unit Letter <u>K</u> : <u>1830</u> Feet From The <u>SOUTH</u> Line and <u>1830</u> Feet From The <u>WEST</u> Line<br>Section <u>4</u> Township <u>22S</u> Range <u>37E</u> NMPM <u>LEA</u> COUNTY |
| 10. Elevation (Show whether DF, RKB, RT, GR, etc.) |                                                                                                                                                                                                   |

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐ RECOMPLETE IN THE TUBB ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-10-00: MIRU. WORK ON STUCK PUMP.  
8-11-00: NDWH. NUBOP. REL TAC. TIH W/BIT, CSG SCRAPER, PU WS. STOP BIT @ 1300'.  
8-14-00: TAG @ 6090'. TIH W/PKR ON TBG. PSA 5405'. LOAD CSG W/FW. TEST CSG & PKR TO 500#-LEAK OFF.  
8-15-00: TIH W/RBP & PKR ON TBG. SET RBP @ 5405'. CIRC W/250 BFW. PSA 5373'. TEST RBP TO 700#. UNSET PKR & LOWER TO 4000. SPOT 2 SX SAND ON RBP. TIH W/CMT RET ON TBG TO 3426'.  
8-16-00: SET RET @ 3426'. PRES BACKSIDE TO 500#-OK. PUMP 20 SX CL C. TAIL IN W/161 SX CL C NEAT. TIH W/BIT, DC'S ON TBG TO 1740'.  
8-17-00: TIH W/TBG. TAG CMT @ 3396'. DRILL CMT 3396-3426. DRILL RETAINER 3426-28. DRILL HARD CMT 3428-3519.  
8-18-00: DRILL CMT 3519-3667. TEST SQZ ON CHART FOR 30 MINS TO 550#. TIH W/RET TOOL ON TBG TO 5395'. LATCH & REL RBP. PULL TO 4783'.  
8-21-00: TIH W/CMT RET ON TBG. SET RET @ 5400'. MIX & PUMP 150 SX CL C. TIH W/BIT, DC'S ON TBG. STOP BIT @ 3200'.  
8-22-00: TIH W/TBG & TOOLS. TAG CMT @ 5039'. DRILL OUT CMT 5039-5405'. DRILL ON RET 5405-06.  
8-23-00: DRILL 5406-08. DRILL 8' HARD CMT TO 5416'. TIH W/BIT & DC'S TO 5350'. DRILL 5416-5610. TEST SQZ ON CHART FOR 30 MINS. TIH W/BIT & TAG FILL @ 6085'. C/O FRAC SAND 6085-6278.  
8-25-00: C/O FRAC BALLS & SAND 6278-6295. DRILL CIBP 6295-97. PUSH TO 6446'. TIH W/CIBP & SET @ 6345. TIH W/CMT BAILER & DUMP 15' CMT. NEW PBD 6330'. TIH W/PKR ON TBG. STOP @ 4235'.  
8-28-00: TIH W/TBG & PKR TO 6292'. SET PKR & TEST CIBP & CHART TO 500#. TIH W/PERF GUN. PERF IN TUBB: 6030-40, 6050-60, 6076-86, 6130-42, 6146-58, 6180-92, 6214-20, 6232-36, 6242-56, 6260-66, 6282-88. TIH W/PKR ON TBG & STOP @ 1820'.  
8-29-00: SPOT 6 BBLs 20% NEFE HCL ACR TUBB PERFS 6030-6288. PULL PKR TO 5987'. ACIDIZE W/3000 GALS 20% NEFE HCL. REL PKR & LOWER TO 6240'. C/O TO PBD @ 6330'.  
8-30-00: TIH W/PKR. FRAC TBG TEST TO 8000#. SET PKR @ 5924'. INSTL FRAC TREE.  
8-31-00: FRAC TUBB PERFS 6030-6288 W/21,420 GALS 50% CO2 30# X-LINKED GEL & 24,234 GALS 50% CO2 30# X-LINKED GEL.  
9-01-00: RU PORTABLE WELL TESTER.  
9-05-00: LEAK IN FRAC TANK. REPAIR. STOP PKR @ 2209'.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 10/23/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 915-688-4752

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY. TITLE

Orig. signed by  
Paul F. Smith  
Geologist

DATE


DeSoto/Nichols 12-93 ver 1.0

IC

2A R. L. Leake

9-06-00: TIH W/BIT, FLOAT SUBS, TBG, BAILER. TAG SAND @ 6145'. C/O TO 6168'. DRILL ON TIGHT SPOT. NO HOLE.  
9-07-00: TIH W/MILL, DC'S ON TBG TO 6000'. TAG FILL @ 6156'. C/O SAND TO TIGHT SPOT @ 6168'. MILL OUT 6168-70. C/O FRAC SAND 6170-6330-PBTD.  
9-08-00: LOWER TOOLS & TAG PBTD @ 6330-NO FILL. TIH W/PKR ON TBG. TEST TO 5000#. TEST CSG TO 500#.  
9-11-00: TEST BACKSIDE TO 330# ON CHART. KILL W/30 BBLS 2% KCL WTR. NDBOP. NUWH. RU SWAB. NDWH. NUBOP. UNSET PKR. TIH W/TBG & SET PKR @ 6002'. NDBOP. NUWH.  
9-12-00: FL @ 2800'. FLOWING WIDE OPEN.  
9-13/14-00: PUMP 60 BBLS 2% KCL WTR. NDWH. NUBOP. UNSET PKR. TIH W/OPSMA, SN, TBG, TAC. SN @ 6276'. TAC @ 5955'. TIH W/PUMP, SNKR BARS & RDS.  
9-15-00: TIH W/RDS. RIG DOWN. HOOK UP FLOWLINE. PUMPING @ 6:30 PM.  
10-05-00: ON 24 HR OPT. PUMPED 28 BO, 22 BW, & 224 MCF

FINAL REPORT

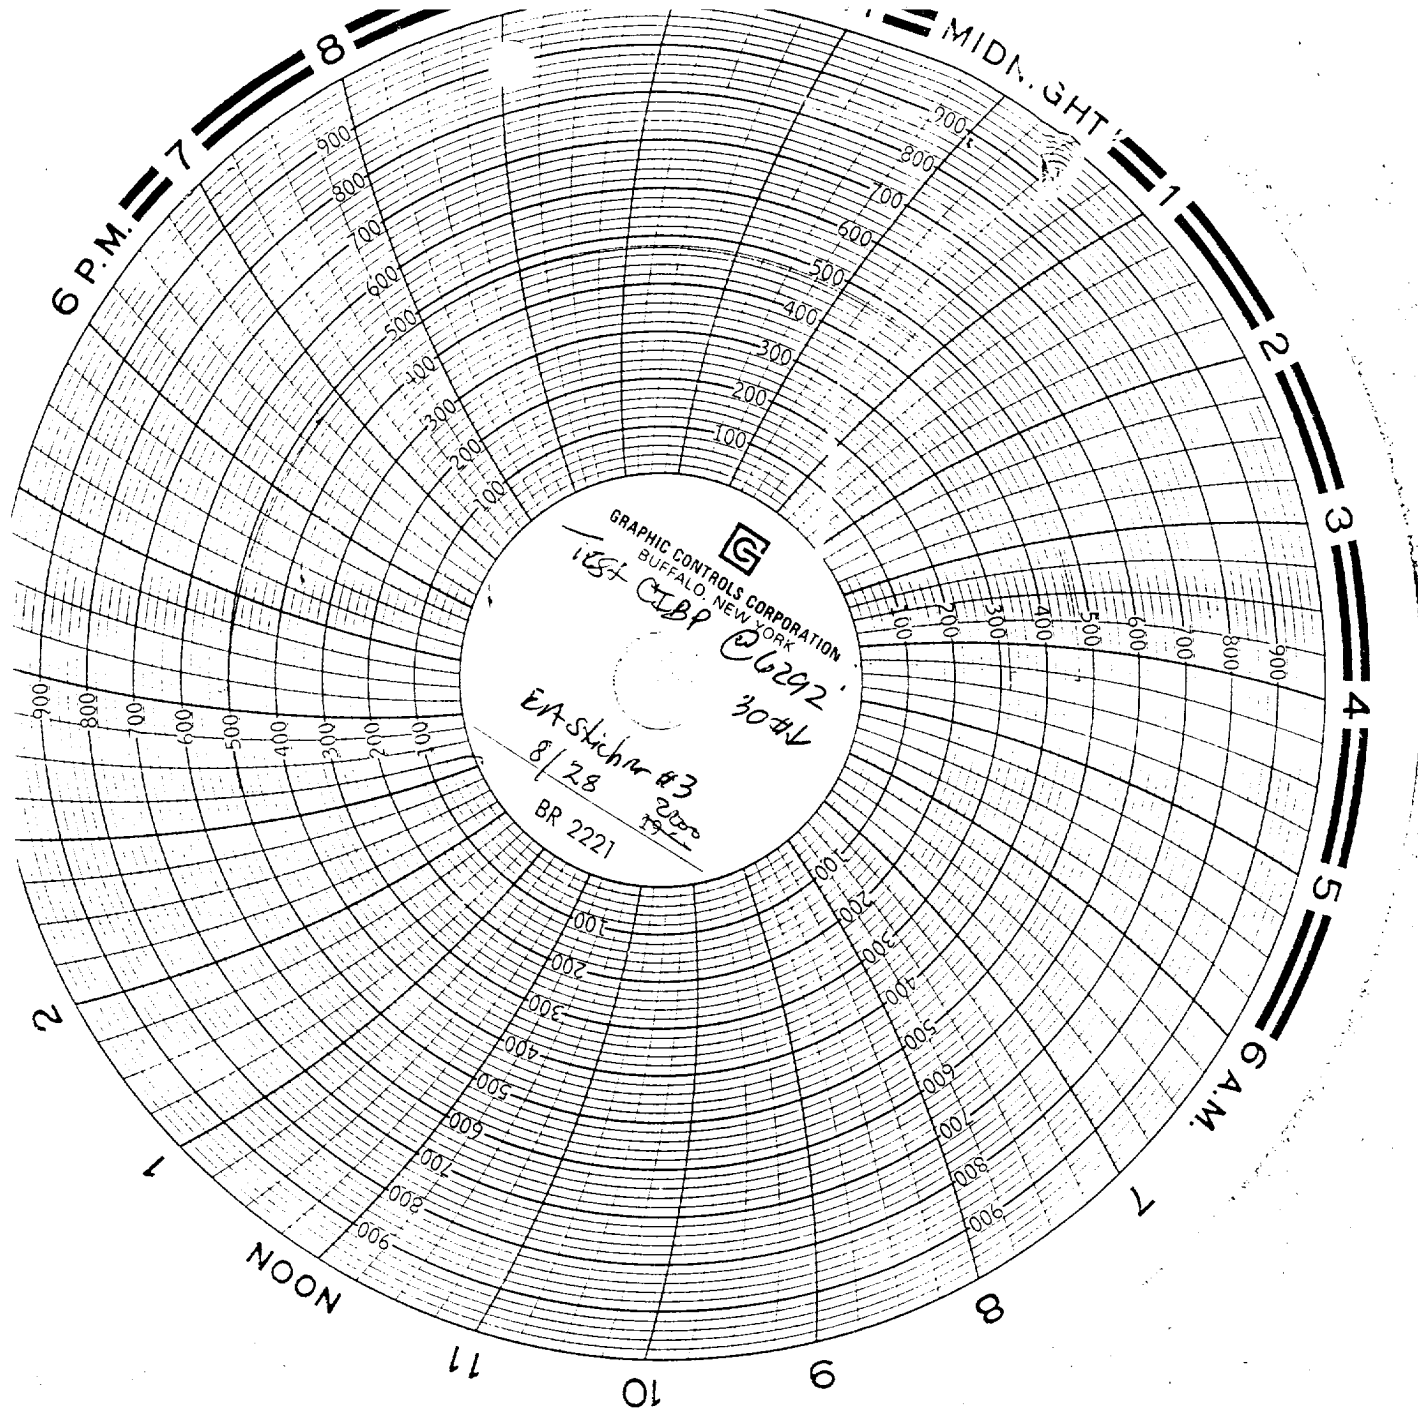

GRAPHIC CONTROLS CORPORATION  
BUFFALO, NEW YORK

Test CIBP 6292  
30#V

EA-Slicker #3  
8/28  
BR 2221