

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on reverse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. UNIT AGREEMENT NAME S. Penrose Skelly Unit	
2. NAME OF OPERATOR GULF OIL CORPORATION		8. FARM OR LEASE NAME	
3. ADDRESS OF OPERATOR P. O. Box 670, Hobbs, NM 88240		9. WELL NO. 130	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 1980' FEL		10. FIELD AND POOL, OR WILDCAT Penrose Skelly	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 6-22S-37E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3453' GL		12. COUNTY OR PARISH Lea	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) Clean sd fill out of hole & stimulate by dump acid job <input checked="" type="checkbox"/>	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3796' TD Lowered tbg string 12 jts in hole, tagging top of fill @ 3743'. WIH w/3½" sd pmp & cleaned form sd out to 3782' by depthometer. WIH w/sd pmp & tagged top of fill @ 3782'. Sd pmp on fill 3 hrs gaining only 5'. POH & found bot section of sd pmp had unscrewed out of top section. Attempted to retrieve fsh. Cavings in hole @ 3782' & 15' barrel of 3½" sd pmp left in open hole after attempting to fish w/no success. WIH w/pump on 3/4" rod string, spaced out & hung on. Ppd 1000 gal 15% HCL dn csg. Flshed w/50 bbls FW. Well now ppg to tst system @ btry.

RECEIVED

APR 22 1980

U. S. GEOLOGICAL SURVEY
HOBBS, NEW MEXICO

18. I hereby certify that the foregoing is true and correct


SIGNED N. B. Sikes, Jr.TITLE Area EngineerDATE 4-21-80

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

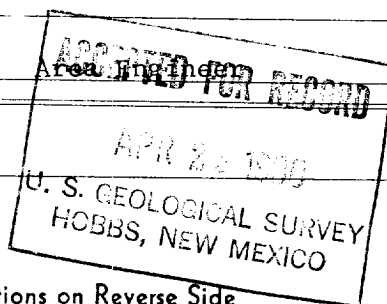

*See Instructions on Reverse Side