

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER- ☐	7. Unit Agreement Name
2. Name of Operator Mobil Oil Corporation	8. Farm or Lease Name S.E. Long
3. Address of Operator Box 633, Midland, Texas	9. Well No. 6
4. Location of Well UNIT LETTER <u>P</u> <u>560</u> FEET FROM THE <u>East</u> LINE AND <u>660</u> FEET FROM THE <u>South</u> LINE, SECTION <u>11</u> TOWNSHIP <u>22-S</u> RANGE <u>38-E</u> NMPM.	10. Field and Pool, or Wildcat Drinkard
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

S. E. Long Well # 6 Drinkard Field, Lea County, New Mexico, Workover Procedure Attached .

Objective: Plug Back and Perforate Additional Pay and Stimulate

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>[Signature]</u>	TITLE <u>Authorized Agent</u>	DATE <u>11-14-68</u>
APPROVED BY <u>[Signature]</u>	TITLE <u></u>	DATE <u></u>
CONDITIONS OF APPROVAL, IF ANY:		

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease and Well No: S.E. Long #6

Field: Drinkard


County and State: Lea, New Mexico

RECOMMENDED PROCEDURE:

- 1) RUV and Kill Well
- 2) Pull 2" tbg (no record of packer in hole)
- 3) Run GR/N collar log from 5800' to TD. Notify
⑧ Vic Inman to pick perforations from log
- 4) Set CIBP above existing perforations by wireline
- 5) Perforate selected interval with 2JSPF. Estimate
20 feet net - 40 shots
- 6) Run tbg and packer
- 7) Wash new perforations with 500 gal. 15% NE acid -
flush with lease crude
- 8) Swab back load
- 9) Treat perts. with 2000 gal. 15% NE acid and
ball sealers - flush with lease crude
- 10) Swab off and potential
- ⑧ Proposed perts - 2JSPF 6268-6390

WHS

Diagrammatic Well Sketch
SE Long Well No. 1
Drinkard (Drinkard) Field
Lea County, New Mexico

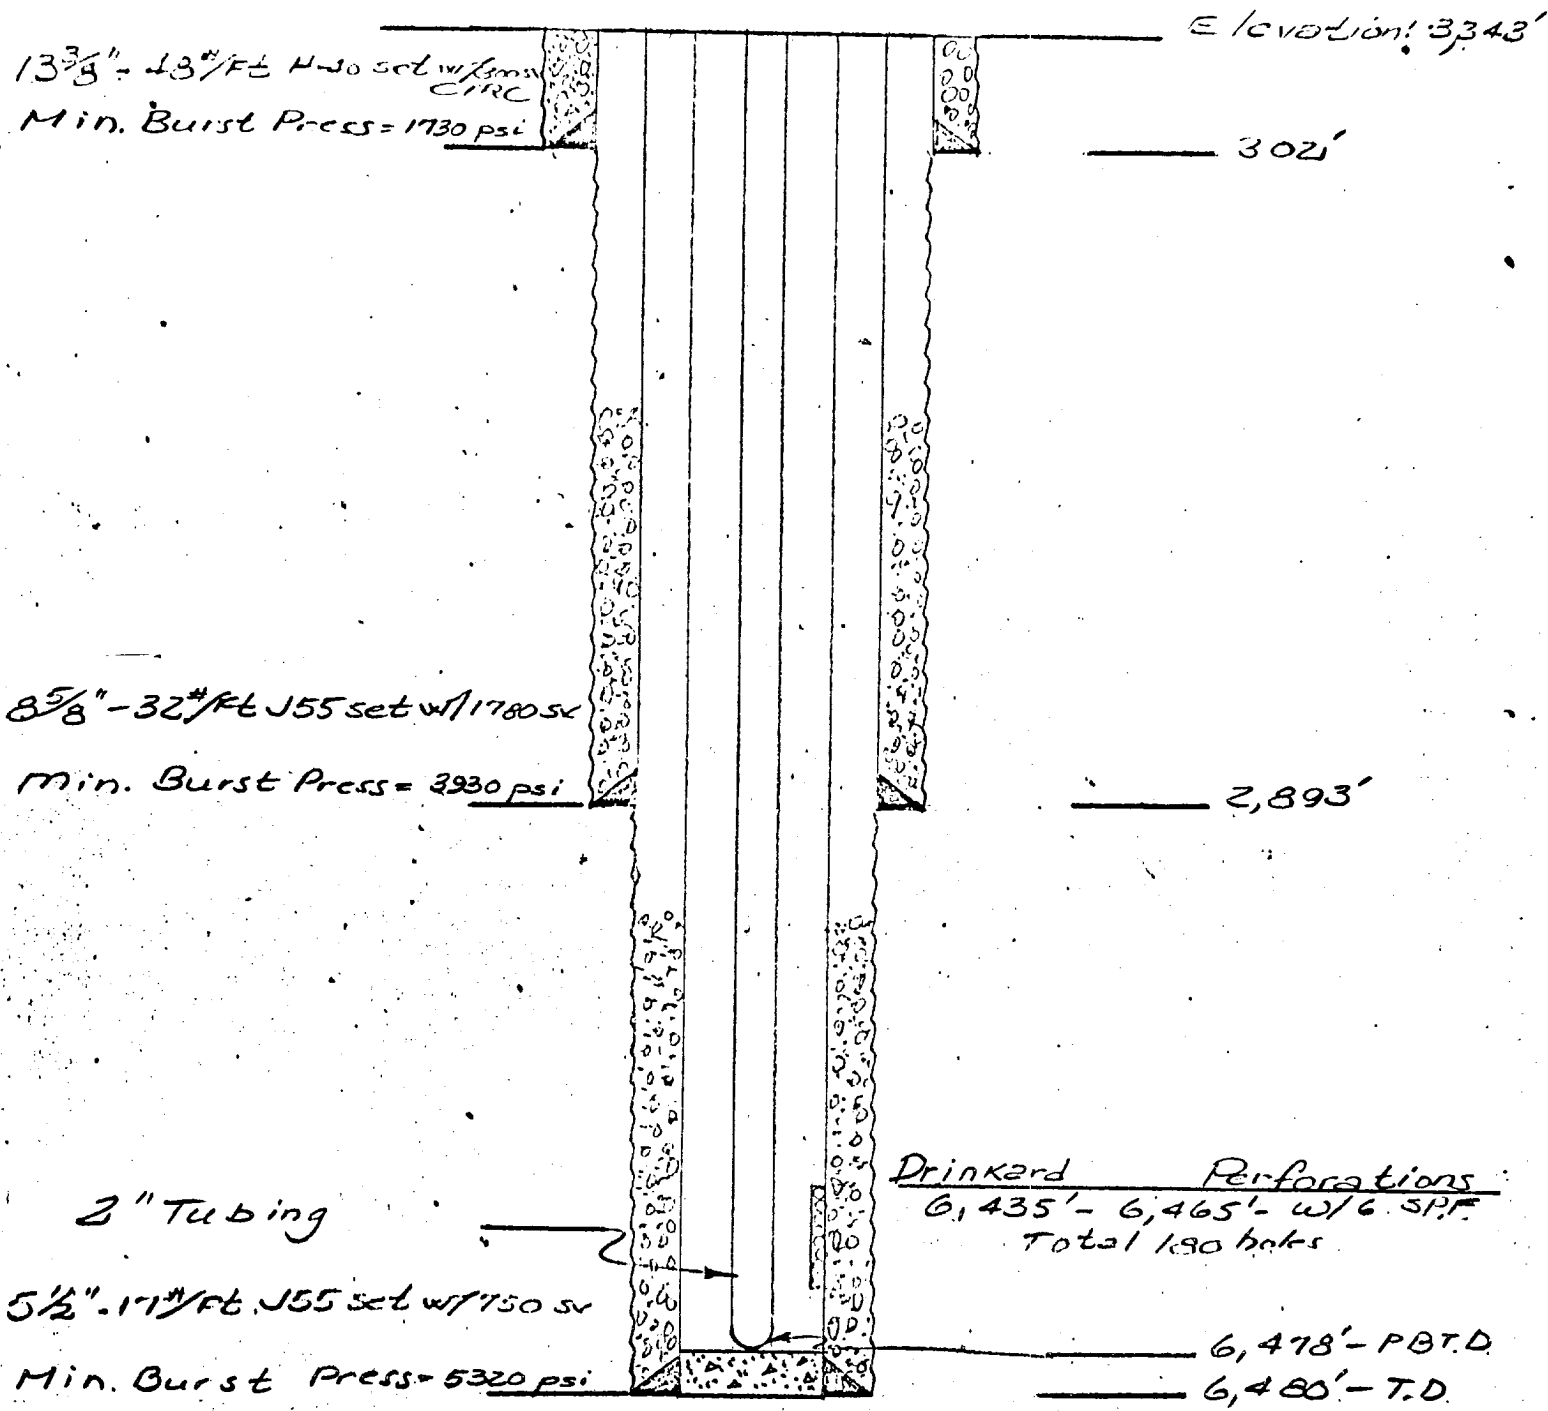

10-1-68
am.