

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20972
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name State "A" A/C - 1
8. Well No. 104
9. Pool name or Wildcat Jalmat-TNSL-YTS-7R

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☒ OTHER	
2. Name of Operator CLAYTON W. WILLIAMS, JR., INC.	
3. Address of Operator 6 Desta Drive, Suite 3000, Midland TX 79705	
4. Well Location Unit Letter K : 1650 Feet From The S Line and 1980 Feet From The W Line Section 9 Township 23S Range 36E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) GR = 3486'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Work will commence upon OCD approval.

- 1) Set CIBP @ $\pm 3,050'$. Dump bail 35' of cement on CIBP.
- 2) Circulate hole w/10 ppg gelled brine.
- 3) Perf 4-1/2" csg. @ $\pm 350'$.
- 4) Circulate cement down 4-1/2" csg. & up 4-1/2"/8-5/8" annulus to surface. (100 sx. C1. C w/2% CaCl₂)
- 5) Cut 4-1/2" & 8-5/8" csg. 3' below G.L. Set P&A marker. Cut deadmen clear location of junk. Plug and Abandon wellbore.

(See attached wellbore diagram)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David G. Grafe TITLE Petroleum Engineer DATE Feb. 23, 1993

TYPE OR PRINT NAME _____ TELEPHONE NO. _____

(This space for State Use)

ORIGINAL SIGNED BY JERRY COXTON
DISTRICT SUPERVISOR

APPROVED BY _____ TITLE _____ DATE FEB 01 1993

CONDITIONS OF APPROVAL, IF ANY:

WELL COMPLETION SKETCHES

Sec 9-235-36 E
LOCATION 1650' FSL + 1980' FWL

WELL Account 1 #104

FIELD Jalmat-TNSL-YTS-7R

DATE 2-19-93

☐ PRESENT COMPLETION

☒ SUGESSTED COMPLETION for P+ A

PERMANENT WELL BORE DATA


Ground Level

WELL HISTORY

8 5/8" 24" @ 345' cmtw/300sx

Tops: Tonsill - 2985
Yates - 3116
Seven Rivers - 3333

4 1/2" 12.24" FJ @ 3358' cmtw/200sx

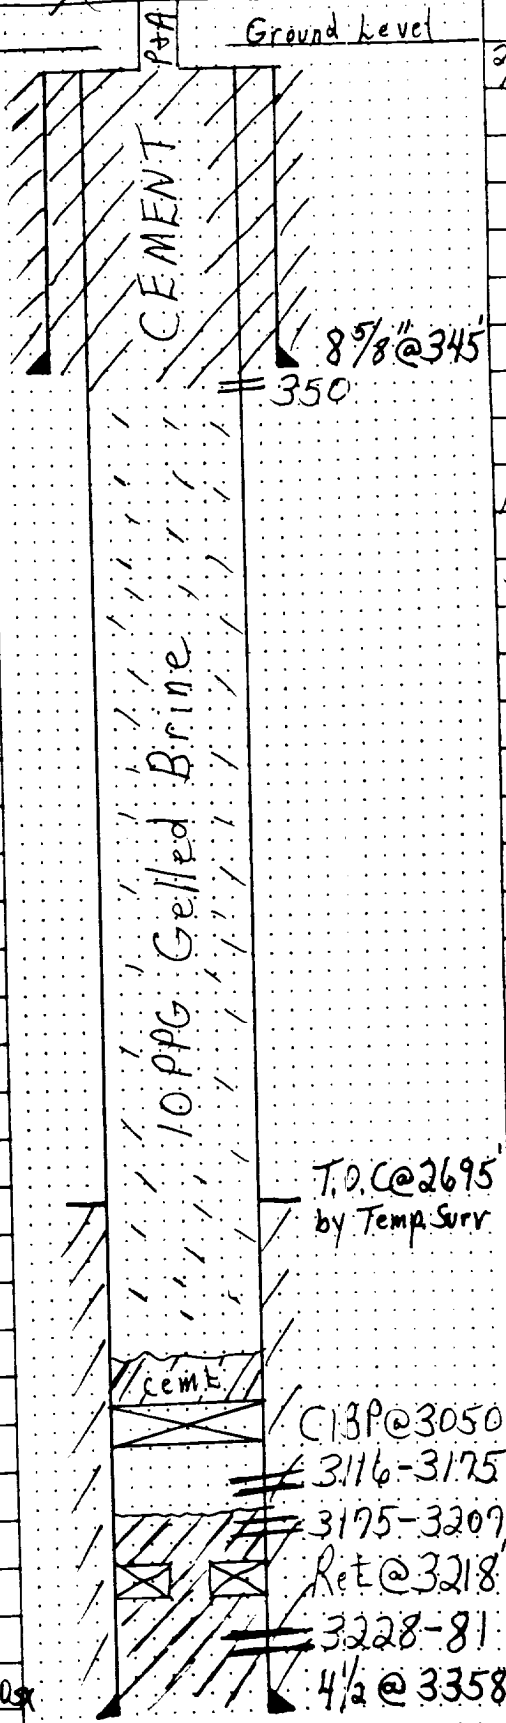

2/64- Perf 3228-81

Acid w/1000g

50T.w/20000g oil + 60000 #sd

Set Ret @ 3218 sqz

Perf 3116-3207

Acid w/1000g

Sqz Perfs w/ cement

Ø out to 3175'

Acid 3116-3175 w/3000g

1965- T A well

5/89- Acid w/1400g. 15%
P.O. P.

Proposed P+A Procedure

1) Set CIBP @ ± 3050
w/35' cement on CIBP

2) Circulate Hole w/10 PPG
Gelled Brine

3) Perf @ 350'

4) Circ Cement Down 4 1/2"
+ Up 4 1/2" 8 5/8" Annulus

5) Set P+A Marker

T.O.C @ 2695'
by Temp. Surv

CIBP @ 3050

3116-3175

3175-3207

Ret @ 3218'

3228-81

4 1/2 @ 3358