

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: September 30, 1990

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

NM-0559539

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Federal Sand 18 #1

9. API Well No

3002525017

10. Field and Pool, or Exploratory Area

Undesignated Deleware

11. County or Parish, State

Lea

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Texaco Exploration and Production Inc.

3. Address and Telephone No.

P.O. Box 730, Hobbs, NM 88240-2528 (505) 393-7191

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL & 660' FEL
Unit Letter H Sec 18, T23S, R32E

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MIRU pulling unit. TOH w/rods and pump. Install BOP. TOH w/2-7/8" production tbq.
2. TIH w/tbg. Spot a 150' cmt plug (approx. 30 sacks of Class 'C' cmt w/2% CaCl, 6.3 gal water/sack, 14.8 ppg, 1.32 cu. ft/sack) from 7150'-7000'. Tag top of plug.
3. Load hole full of salt gel mud consisting of 10 ppg brine with 25 pounds of gel per bbl.
4. Pull tbq uphole. Spot a 100' cmt plug across 10-3/4" csg shoe (approx. 20 sacks of Class 'C' cmt w/2% CaCl, 6.3 gal water/sack, 14.8 ppg, 1.32 cu. ft/sack) from 4700'-4600'. Tag top of plug.
5. Pull tbq uphole. Spot a 100' cmt plug across 13-3/8" csg shoe (approx. 20 sacks of Class 'C' cmt w/2% CaCl, 6.3 gal water/sack, 14.8 ppg, 1.32 cu. ft/sack) from 675'-575'. Tag top of plug.
6. Spot a 50' cmt surface plug (approx. 10 sacks).
7. Cut off wellhead, install dry hole marker. Clean location.

(see reverse side)

14 I hereby certify that the foregoing is true and correct

Signed [Signature]

Title Engr. Asst.

Date 6-26-91

(This space for Federal or State office use)

Approved by [Signature]
Conditions of approval, if any:

Title

Date 7-9-91

* NOTIFY BLM AT - - -


Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

RECEIVED
JUN 26 10 30 AM '91
CARTER
AREA


Federal Survey 18 well No. 1
Unit H, Sec 18, T23S, R-32E
Leon County, New Mexico

Current

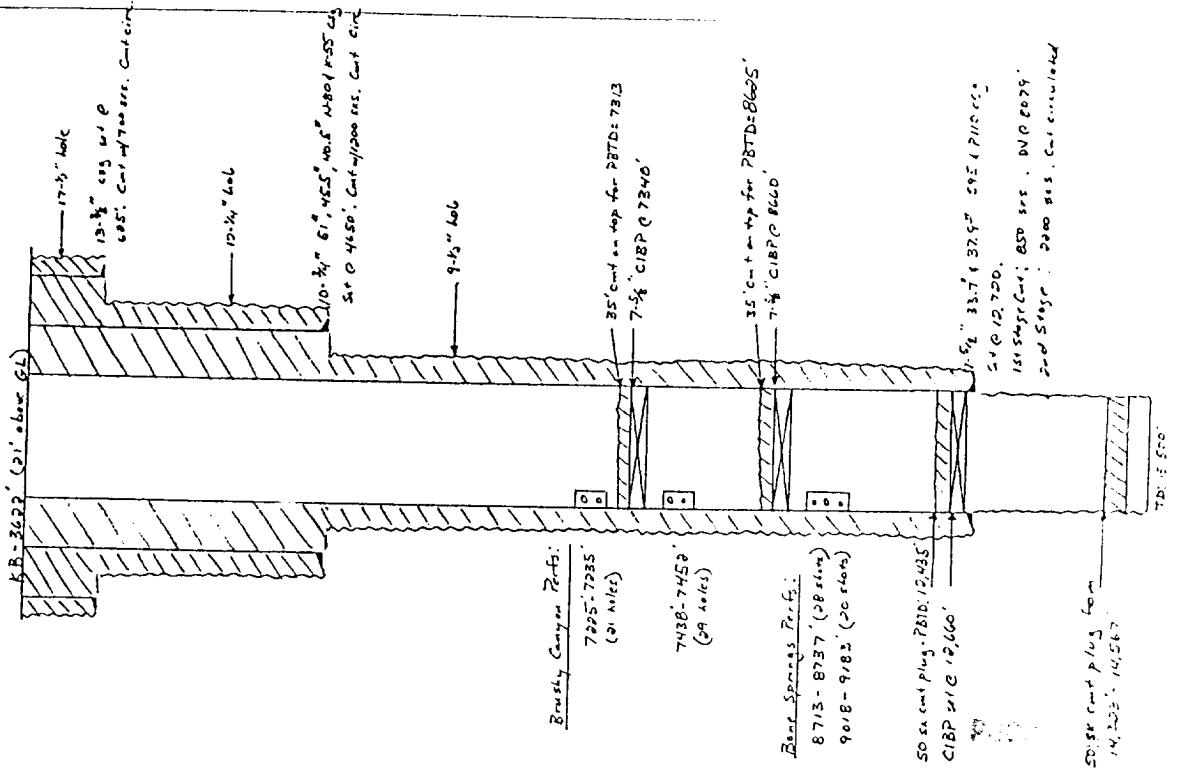

Federal Survey 18 well No. 1
Unit H, Sec 18, T23S, R-32E
Leon County, New Mexico

Proposed

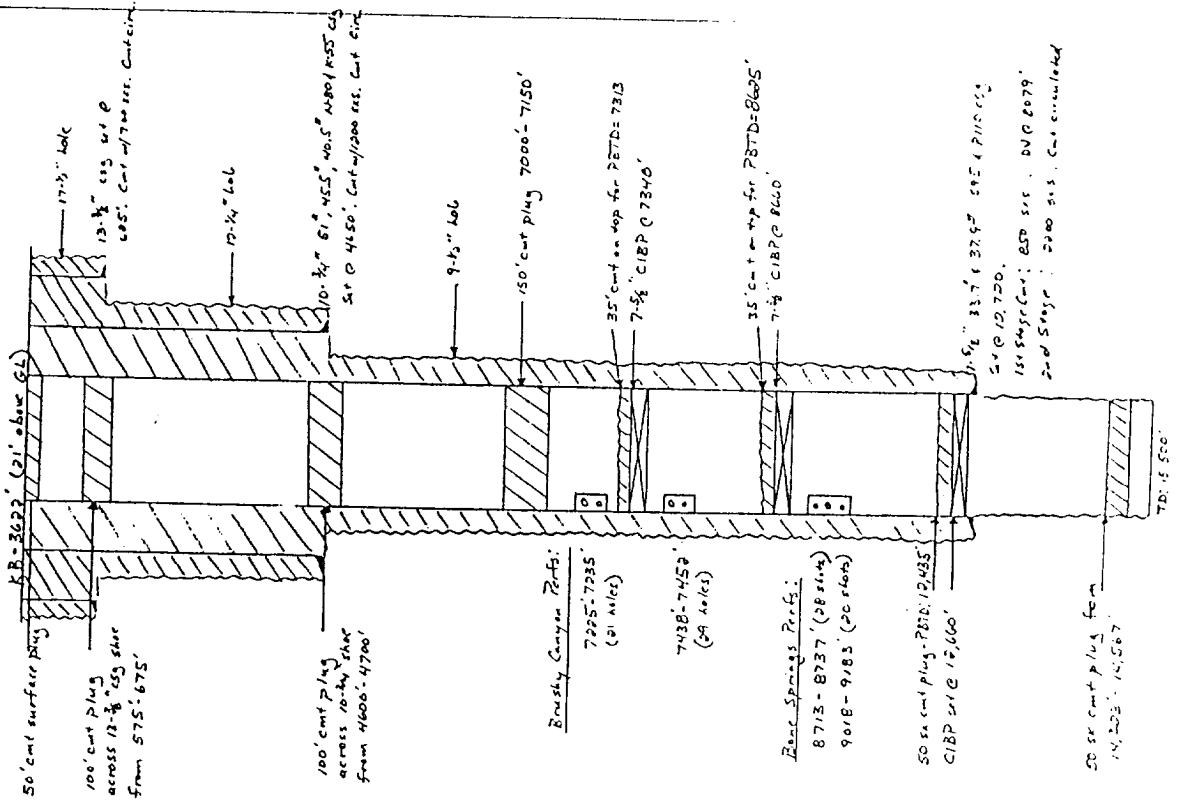

JUL 1 1950
HOL