

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-25113
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd. Midland, Tx 79705		7. Lease Name or Unit Agreement Name: H.T. Mattern(NCT-D)
4. Well Location Unit Letter <u>F</u> : <u>1650</u> feet from the <u>north</u> line and <u>1720</u> feet from the <u>west</u> line Section <u>7</u> Township <u>22-S</u> Range <u>37-E</u> NMPM County <u>Lea</u>		8. Well No. 17
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Blinebry

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24hrs prior to MI & RU
2. Set 5 1/2 CIBP @ 5425, spot 25sx plug 5425-5200(Blinebry)WOC Tag.
3. Displace hole m/MLF, 9.5 # Brine w/25# Gel P/BBL
4. Spot 25sx plug 3400-3200(Queen)
5. Spot 25sx plug 2600-2400(yates, B-salt)WOC Tag.
6. Perf 4 holes @ 1200, sqz 60sx plug 1200-900(T-salt, 8 5/8 shoe) WOC Tag.
7. Perf 4 holes @ 300, sqz 75sx plug 300-surf(surface, F.W.) WOC Tag.
8. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 10/30/2002

Type or print name G.R. Bledsoe Telephone No. 915.687.7153
(This space for State use)

APPROVED BY _____

Conditions of approval, if any:

ORIGINAL SIGNED BY
GARY W. WINK

OCD FIELD REPRESENTATIVE II/STAFF MANAGER

OCT 31 2002

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME H.T. MATTEEN NCT-D


WELL # 17

SECT 7 TWN 22-S RNG 37-E

FROM 1650 NSL 1720 E/WL

TD 6735 FORMATION @ TD Drinkard

PBTD FORMATION @ PBTD Blinberry

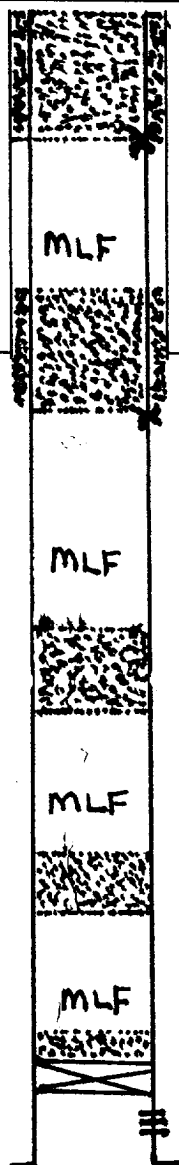

8 5/8
@ 1090
TOC SURF

5 1/2 #
@ 6734
TOC 2230

TD 6735

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1090	SURF	Circ
INTMED 1				
INTMED 2				
PROD	5 1/2	6734	2230	T.S

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	5472-5840
INTMED 2	OPENHOLE	
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	*	1 CIBP	25	5125
YATES		2 QUEEN	25	3600
QUEEN		3 B-SALT	25	2600
GRAYBURG		4 8585	60	1200
SAN ANDRES		5 SURF	75	300
CAPITAN REEF	*			
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA	*			
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				