


YATES PETROLEUM CORPORATION
Quay AQU State #1
Section 10-T23S-R33E
Lea County, New Mexico

SUNDRY NOTICE - CONTINUED:

line and retrieved lost blanking plug inside packer on 2-3/8" crossover for tail-pipe. Unset packer. Circulated hole for 3-1/2 hours.
3-21-97 - POOH with packer. Sent packer in for re-dress. TIH with 2-3/8" mule-shoe collar, 24 joints 2-3/8" N-80 tubing, 2-7/8" X 2-3/8" crossover, 7-5/8" Uni VI packer, 2.25" F nipple and on/off tool and 377 joints of 2-7/8" L-80 6.5# tubing. Bottom of 2-3/8" muleshoe at 12674'. Bottom of packer at 11907'. F nipple at 11900'. Reverse circulated with 400 bbls 10# brine packer fluid. Nippled down BOP and nipped up tree. Set packer with 18000# compression. Tested annulus to 1500#. Bled to 800# in 1 minute and held at 800#. Began swabbing.
3-22-97 - Swabbed. Shut well in.
3-23-97 - Swabbed. Shut well in.
3-24-97 - Swabbed. Shut well in.

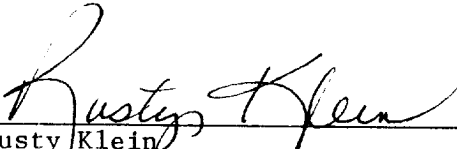

Rusty Klein
Operations Technician
March 25, 1997



