

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TWO COPIES
(Other instructions on reverse side)

Form approved
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Mobil Producing TX & NM Inc.		8. FARM OR LEASE NAME Tristi Draw Federal
3. ADDRESS OF OPERATOR % Mobil Exploration & Producing U.S. Inc. P.O. Box 633, Midland, TX 79702		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980 FSL 1980 FEL		10. FIELD AND POOL, OR WILDCAT Diamond-Wolfcamp BS
14. PERMIT NO.		11. SEC., T., R., OR BLM AND SURVEY OR AREA Sec.14, T-23S, R-32E
15. ELEVATIONS (Show whether SP, ST, OR, etc.) GL - 3705		12. COUNTY OR PARISH 13. STATE LEA NEW MEXICO

16. **Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data**

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	CELL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☒	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANE ☐	(Other) ☐	
(Other) PLUG & ABANDON		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. **DESCRIBE PROPOSED OR COMPLETED OPERATIONS** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. Notify NMOCD & BLM 24 hrs. prior to MIRU.
2. Set CIBP @ 8900' & cap w/35" cmt
3. Cut 7 5/8 csg at 6500'. Pull csg from well.
4. Set cmt plug from 6550-6400. [TAG] SJS
5. Set cmt plug from 5050-4900. [TAG] SJS
6. Set cmt plug from 660-560.
7. Set cmt plug from 50 - 0.
8. Cut off csg. Weld on a steel plate w/P&A marker which meets NMOCD/BLM requirements.
9. Cover pits and clear location per BLM/NMOCD requirements.

18. I hereby certify that the foregoing is true and correct

SIGNED

Shirley Lord

TITLE

Mobil Exploration & Producing U.S. Inc.
as Agent for Mobil Producing TX & NM Inc.

DATE

5-25-89

(This space for Federal or State office use)

APPROVED BY

Shirley Lord

For:
TITLE

CLIENT, MINERAL RESOURCES

DATE


5-25-89

*See Instructions on Reverse Side

TRISTE DRAW FEDERAL #1
DIAMONDTAIL / BONE SPRINGS
LEA COUNTY, NEW MEXICO

GL = 3705'
DF = 3730'
KB = 3731.5'
1980'FEL - 1980'FSL
J - SECTION 14
T23S - R32E

PROPOSED WELLBORE SKETCH

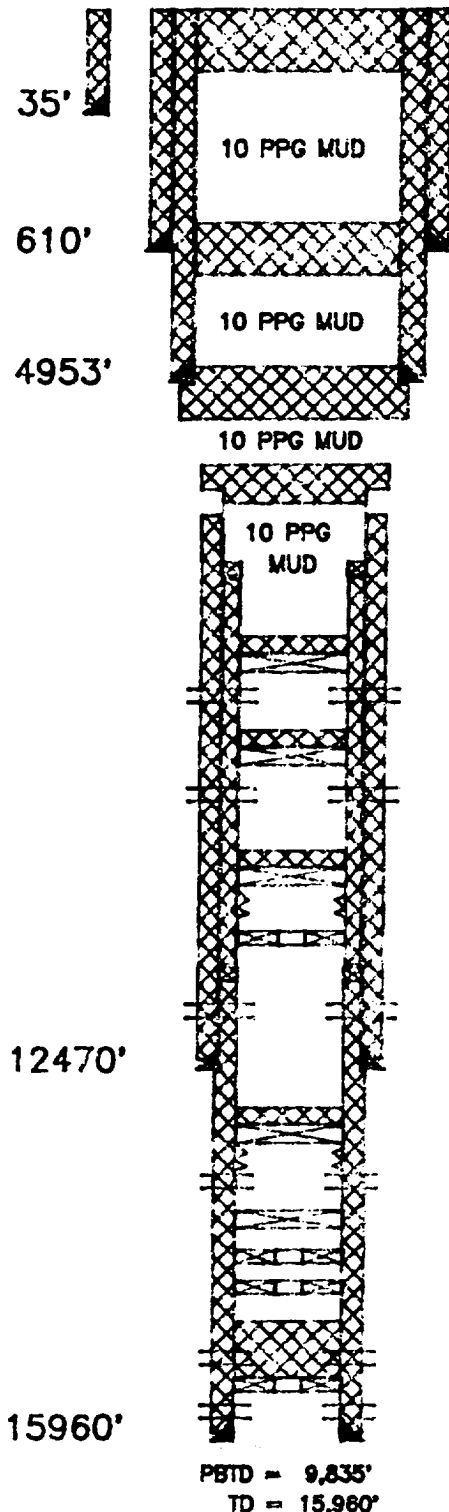

CMT PLUG 0'-50'

20" CONDUCTOR PIPE

13 3/8" 54.5# SET w/730 sx circ.
CMT PLUG 560'-860'

10 3/4" K-55 45.5# SET w/2230sx, circ.
CMT PLUG 4900'-5050'

CMT PLUG 6400'-6550'

TOC @ 6974' est.

TOL @ 7383'

5" CIBP @ 8900' CAPPED w/35' CMT (TOC @ 8865')

BONE SPRINGS PERFORATIONS 8942-8964 2japf (4+ HOLES)

ALPHA 5" CIBP @ 9870' (TOC @ 9835')

BONE SPRINGS PERFORATIONS 9965-10063 OA (43 HOLES)

ALPHA 5" CIBP @ 11950' (TOC @ 11915')

COLLAPSED CASING @ 11987'

BAKER MODEL "D" PKR w/ WILLOUT EXTENSION @ 12000'

BAKER SIMPLEX LINER HANGER w/ TIEBACK RECEPTAL @ 12167'

WOLFCAMP PERFORATIONS 12181-12193, 4japf

7 5/8" S-95 (104)29.7#, (150)26.4# &
(47)29.7# w/875sx

CIBP @ 14340' CAPPED w/ 30sx (TOC @ 14000')

ATOKA PERF'S 14405-14470 OA, LOST FISH COLLAPSED CSG

CIBP @ 14470'

BAKER MODEL "FAB" PKR @ 14500'

BAKER MODEL "FAB" PKR @ 14580'

CMT CAP TOP @ 14700'

MORROW PERFORATIONS 15304-15335 OA

BAKER MODEL "DB" PKR @ 15375'

MORROW PERFORATIONS 15451-15480 OA

5" (4784')15# L-80 & (3793')23.2# C-95 w/660sx

W. P. GOSSETT

04/07/89