

N. M. STATE OFFICE  
P. O. BOX 1400  
HOBBS, NEW MEXICO 78201

Form 3160-5  
(November 1983)  
(Formerly 9-331)

UNITED STATES Submit in Triplicate\*  
DEPARTMENT OF THE INTERIOR (Other Instructions on reverse side)  
BUREAU OF LAND MANAGEMENT

Form approved  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir  
Use "APPLICATION FOR PERMIT -" for such proposals.)

1. OIL GAS  
WELL X WELL OTHER-

2. NAME OF OPERATOR  
Mobil Producing TX & NM Inc.

3. Address of Operator  
c/o Mobil Exploration & Producing U.S. Inc., P.O. Box 633, Midland, TX 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At Surface 1980 FSL 2480 FEL

5. LEASE DESIGNATION & SERIAL NO.  
NM-11967

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
TRISTI DRAW FEDERAL

9. WELL NO.  
2

10. FIELD AND POOL, OR WILDCAT  
DIAMONDTAIL-BONE SPRING

11. SEC., T., R., M., OR BLK, AND  
SURVEY OR AREA

SEC. 14 T-23S R-32E

14. PERMIT NO. 13. ELEVATION (show whether DF, RT, GR, etc)  
GL - 3706

12. COUNTY OR PARISH 13. STATE  
LEA New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF  
FRACTURE TREAT  
SHOOT OR ACIDIZE  
REPAIR WELL  
PULL OR ALTER CASING  
MULTIPLE COMPLETE  
ABANDON\*  
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF  
FRACTURE TREATMENT  
SHOOTING OR ACIDIZING  
(Other)  
REPAIRING WELL  
ALTERING CASING  
ABANDONMENT\*

(Other) PLUG & ABANDON

(Note: Report results of multiple completion on Well Completion  
Completions or Recompletion Report and Log Form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

1. Notify NMOC & BLM 24 hrs. prior to MRO.
2. MRO POH w/rods, pump, & tbq.
3. Set CIBP @ 9460, cap w/35' cmt.
4. Perf csg. @ 4950 & 4800 w/4jsfp.
5. Set cmt retainer @ 4900'. Pump 44' cmt thru retainer. Pump 25' cmt on top of retainer. Circ. hole w/10 ppg mud.
6. Spot 100' cmt plug from 610 - 710
7. Circ. to surf. w/cmt (13 cu.ft)
8. Weld on P & A marker, RDMO, clean location.

DEC 15 11 15 AM '88  
CALLED  
AREA

RECEIVED

18. I hereby certify that the foregoing is true and correct

SIGNED Shirley Ladd TITLE Mobil Exploration & Producing U.S. Inc.  
as Agent for Mobil Producing TX & NM Inc. DATE 12-9-88

(This space for Federal or State office use)


APPROVED BY CHIEF OF BUREAU TITLE DATE 1-4-89

Conditions of Approval: If any:

TRISTE DRAW FEDERAL #2  
DIAMONDTAIL / BONE SPRINGS  
LEA COUNTY, NEW MEXICO

GL = 3706'  
DF = N.A.  
KB = 3728'  
2480'FEL - 1980'FSL  
J - SECTION 14  
T23S - R32E

CURRENT WELLBORE SKETCH

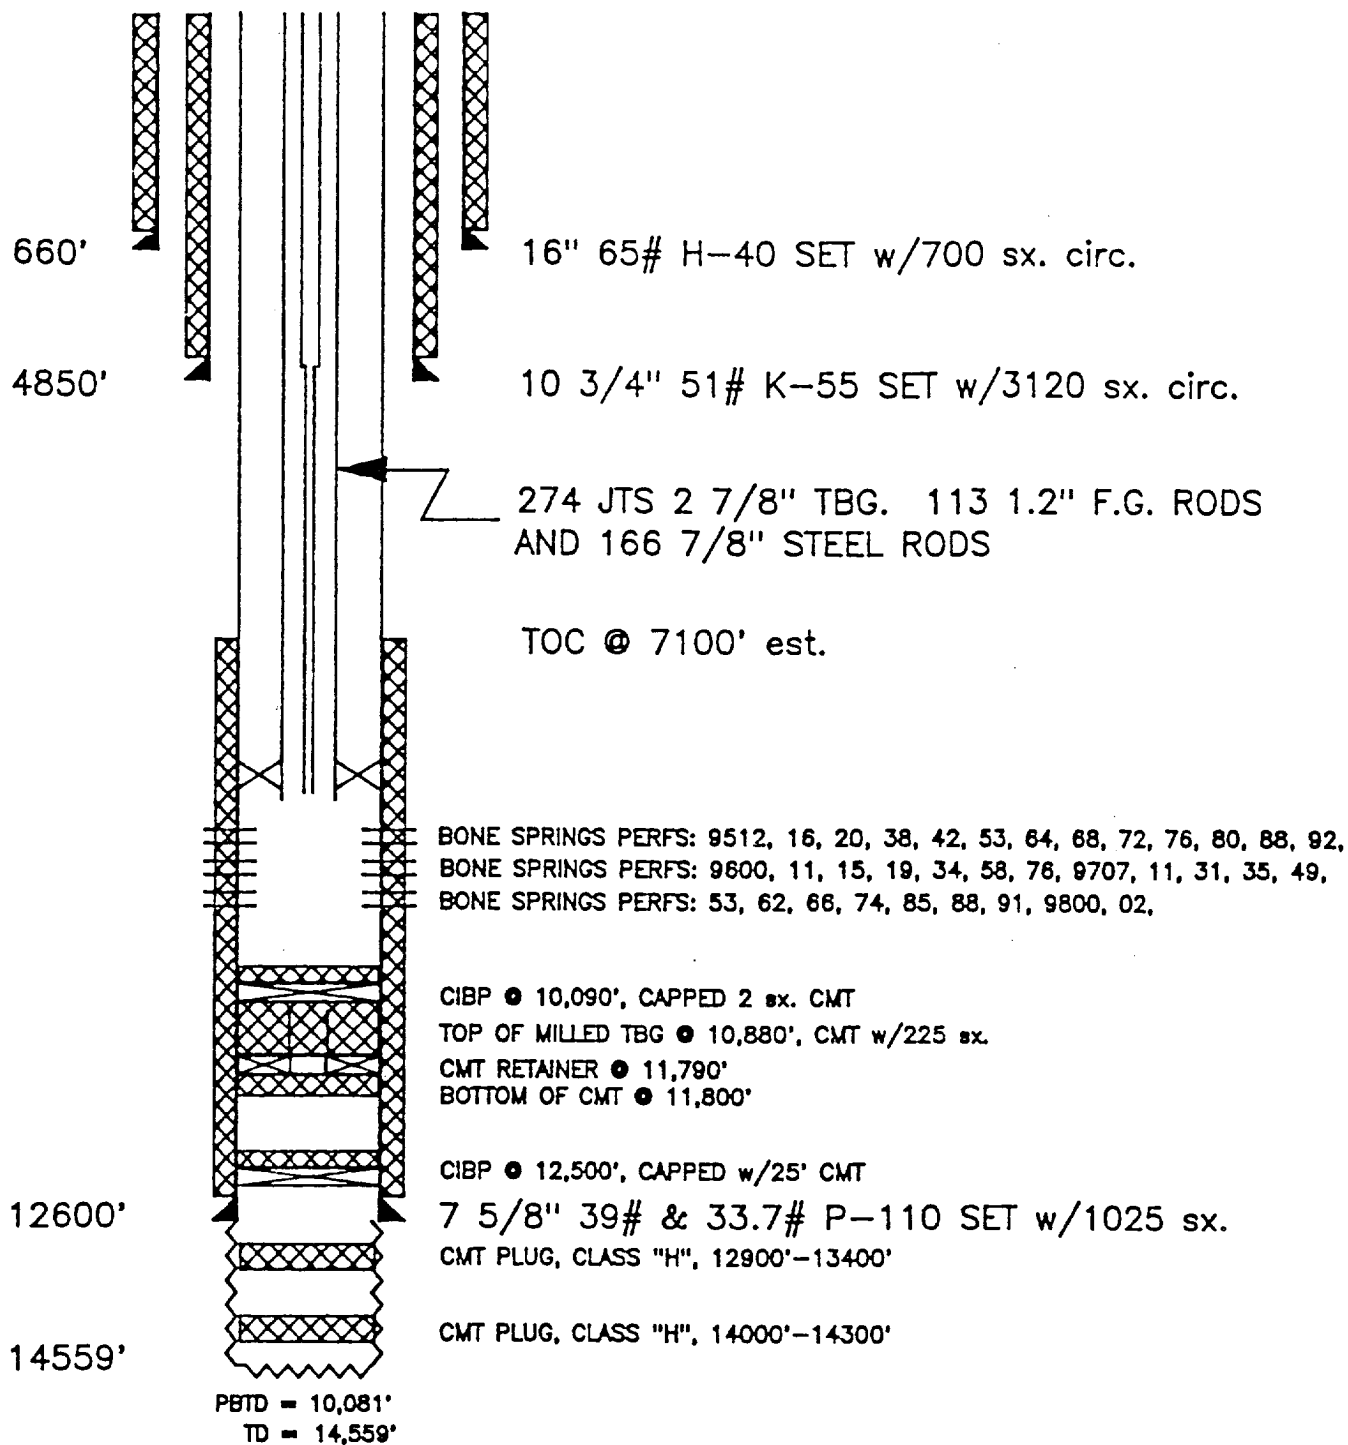

TRISTE DRAW FEDERAL #2  
DIAMONDTAIL / BONE SPRINGS  
LEA COUNTY, NEW MEXICO

GL = 3706'  
DF = N.A.  
KB = 3728'  
2480'FEL - 1980'FSL  
J - SECTION 14  
T23S - R32E

PROPOSED WELLBORE SKETCH

