


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

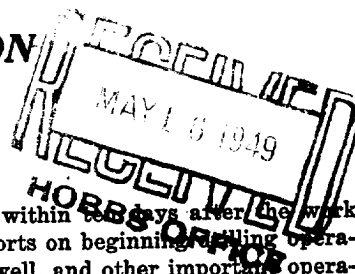

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	XX		

May 13, 1949

Hobbs, New Mexico

Date

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____
Skelly Oil Company **H. O. Sims "D"** Well No. **2** in the _____
 _____ Company or Operator _____ Lease _____
SE 1/4 NW 1/4 of Sec. **3**, T. **23S**, R. **37E**, N. M. P. M.,
South Drinkard Field, _____ **Lea** County.

The dates of this work were as follows: **May 11, 1949**

Notice of intention to do the work was (~~submitted~~) submitted on Form C-102 on **April 28** 19 **49**
 and approval of the proposed plan was (~~submitted~~) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

As production had declined to a point where well was considered to be non-commercial, it was plugged in the following manner:

Ran cement plug of 25 sacks 6620-6396' (5 1/2" casing set at 6440' & cemented w/ 300 sacks) then filled hole w/ heavy mud laden fluid 6396-4800' then ran cement plug of 15 sacks 4800-4674'. Cut off 5 1/2" casing at 4400' & pulled same. Filled hole w/ heavy mud laden fluid 4674-3600' & ran cement plug of 5 1/2 sacks 3600-3400' then filled hole w/ heavy mud laden fluid 3400-2750', ran cement plug of 10 sacks 2750-2720' (8-5/8" casing set at 2790' & cemented to surface) then filled hole w/ heavy mud laden fluid to 20'. Ran cement cap from 20' to surface & installed 4" pipe marker.

Witnessed by **R. L. Calhoon** **Skelly Oil Co.** **Dist. Foreman**
 _____ Name _____ Company _____ Title _____

Subscribed and sworn before me this **13th**

day of **May** 19 **49**

R. L. Calhoon

Notary Public

I hereby swear or affirm that the information given above is true and correct.

Name *R. L. Calhoon*

Position **Dist. Supt.**

Representing **Skelly Oil Company**

Company or Operator

Address **Drawer "D", Hobbs, N. M.**

MY COMMISSION EXPIRES AUG. 19, 1952
 My commission expires _____

Remarks:

APPROVED

Date **MAY 16 1949**

Ray Gundersee
 _____ Name _____
 OIL & GAS INSPECTOR
 _____ Title _____

THE UNIVERSITY OF CHICAGO

LIBRARY

1000 S. MICHIGAN AVE.

CHICAGO, ILL.

1900

1901

1902

1903

1904

1905

1906

1907

1908

1909

1910

1911

1912

1913

1914

1915

1916

1917

1918

1919

1920

1921

1922

1923

1924

1925

1926

1927

1928

1929

1930

1931

1932

1933

1934

1935

1936

1937


1938

1939

1940

1941

1942

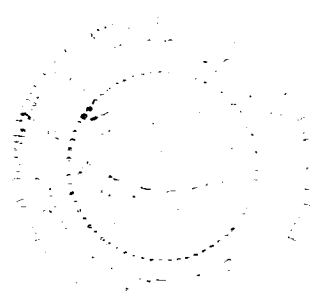

1943