

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30 025 10704
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Skelly Penrose A Unit
8. Well No. 50
9. Pool name or Wildcat Langlie Mattix
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3284' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER Water Injection
2. Name of Operator Texaco Exploration and Production Inc.
3. Address of Operator P. O. Box 730 Hobbs, NM 88240
4. Well Location Unit Letter F : 1980 Feet From The North Line and 1980 Feet From The West Line Section 10 Township 23S Range 37E NMPM Lea
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3284' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: Temporarily Abandon ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 9-30/10-2/92
- 1) Set 5" CIBP @ 3310' & packer @ 3266', test BP to 2000#, held OK
 - 2) Cap CIBP w/cmt - PBTD=3260'
 - 3) Isolate 7" casing leak from 2792' to 3260'
 - 4) Set cmt retainer @ 2749', pump 85 sx class C cmt, tail in w/ 80 sx 50/50 POZ/Bentonite gel, displace to 2737"
 - 5) Sting out of retainer, left 12' cmt on top
 - 6) Test csg to 500# (chart attached, copy on back)
 - 7) Request TA Status

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE L.W. Johnson TITLE Engr Asst DATE 10-30/92
TYPE OR PRINT NAME L.W. Johnson TELEPHONE NO. 393-7191


(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR


APPROVED BY _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

This Approval of Temporary
Abandonment Expires 11-1-97

NOV 04 '92

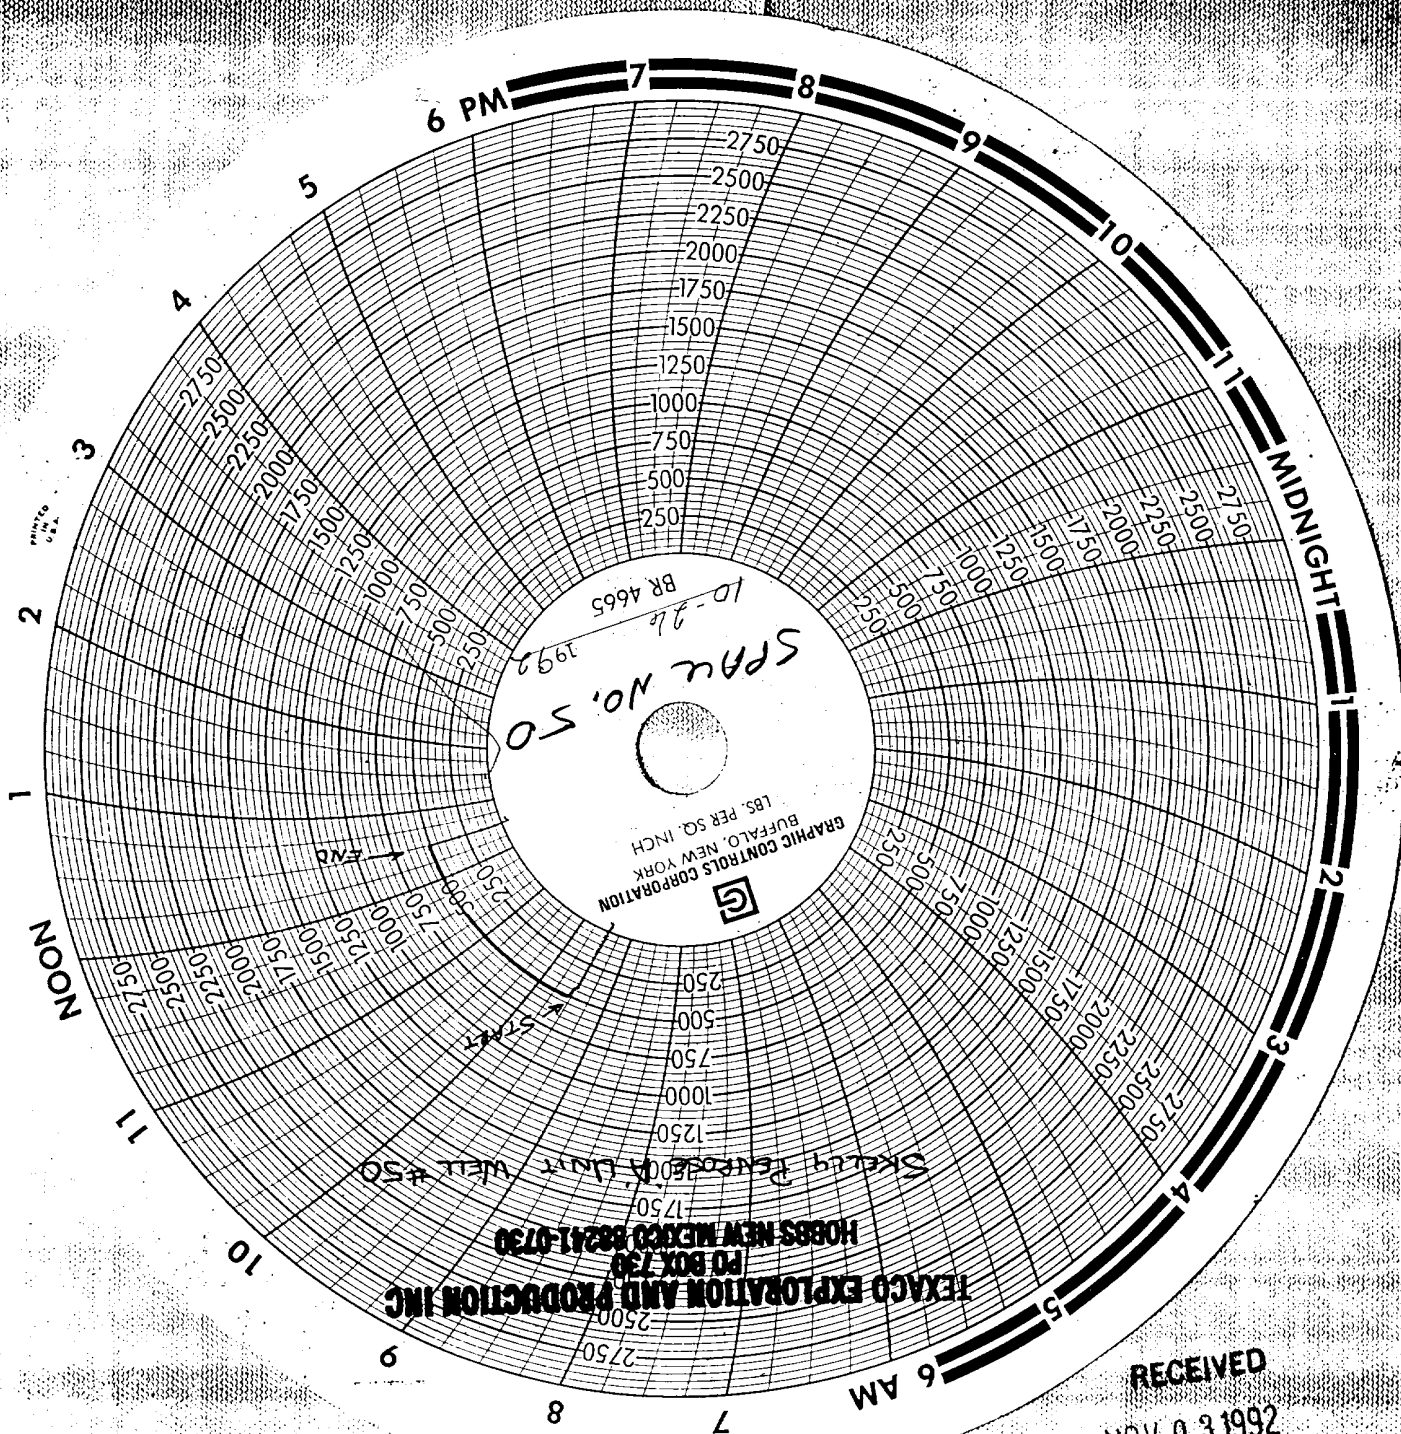

RECEIVED
NOV 03 1992
OCD HOBBS OFFICE

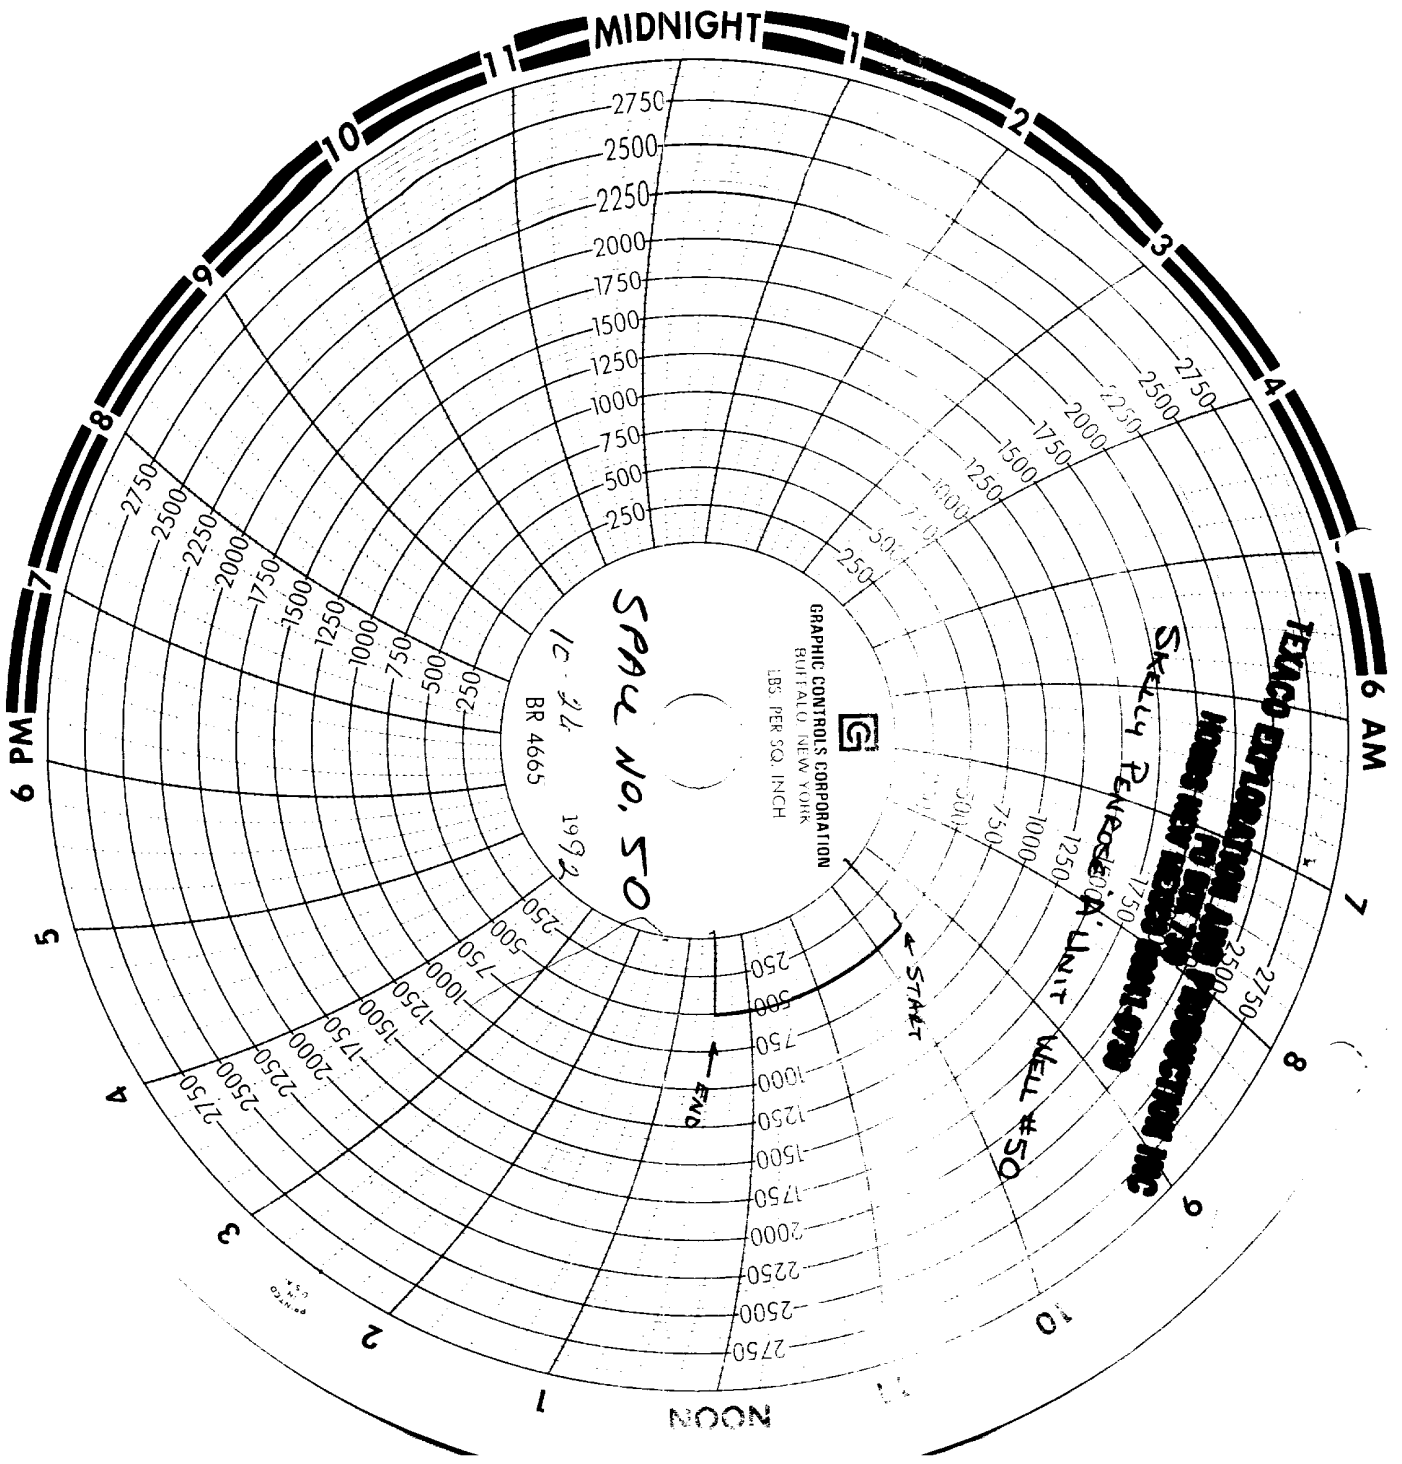

10-26-92
CHAPARRAL SEB.
APRIL JOE DUNCAN

TEXACO Exploration & Production
SHELL Penrose A' SE

RECEIVED
NOV 03 1992
OCD HOBBS OFFICE