

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
P.O. Box 1980
Hobbs, NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

PLAINS PETROLEUM OPERATING COMPANY

3. Address and Telephone No.

415 W. WALL, SUITE 1000, MIDLAND, TX 79701 915/683-4434

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

810' FNL & 660' FEL, Sec 34 (A), T23S, R37E

5. Lease Designation and Serial No.
NMLC064118

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

E. C. HILL "B" FEDERAL #1

9. API Well No.

30-025-10945

10. Field and Pool, or Exploratory Area

TEAGUE PADDOCK-BLINEBRY

11. County or Parish, State

LEA, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Repair tbg & return to production
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water


(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Regarding Non-Compliance Form 3160-9 Reference 43 CFR 3163.1 ()

7-7-98 MI & RU well service co, unhang well, unseat pump. LDPR, POOH w/rods & pump. Change over to tbg, ND WH, unset TAC, NU BOP, POOH w/tbg, find Jt #140 split, replace 4 pitted jts, hydrotest tbg to 5000 psi below slips, test okay. ND BOP, NU WH. RIH w/repairs pump, space, hang on, space out. Leave unit pumping to battery.

EOT @ 4594', SN @ 4557', TAC 3874', 14 K tension.
144 jts 2-7/8" 6.4# J55 EUE 8rd tbg
25-200-RHBC-24-4 pump
75 7/8" sucker rods
1 7/8" shear tool
70 1.2" FG rods
1" steel sucker rods
1-1/4" polish rod

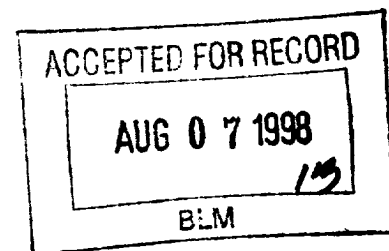

14. I hereby certify that the foregoing is true and correct

Signed

Donna Husband

Title Admin. Assist.

Date 07/24/98

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any: