

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions
reverse side)

W.D.
Re-

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

Las Cruces 064118

DIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Carter Foundation Production Company		8. FARM OR LEASE NAME E. C. Hill "M" Federal
3. ADDRESS OF OPERATOR Box 900, Kermit, Texas		9. WELL NO. 6
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FNL, 1989' FEL, Section 34, T-23-S, R-37-E, Lea County, New Mexico		10. FIELD AND POOL, OR WILDCAT Teague Simpson
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 34-23S-37E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3282 RT 3270 GL		12. COUNTY OR PARISH Lea
		13. STATE N. M. x.

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

Convert to Water Injection

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☐
☒

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Drilled out cement and Bridge Plug at 7595' and cleaned out to original T.D. 9509' to open Simpson perforations. Perforated interval 9320-40', 9360-80', 9390-9450', 9460-85'. Ran Cardinal Select Liners to cover perforations 9320-9420'. Frac perforations 9420-9485' w/10,000 gals. gel water, 8,000# sand. Pulled Select Liners, ran 2-1/2" plastic coated tubing on packer and set at 9251' to inject water into Simpson Formation 9320-9485'. Well put on injection 4-1-65.

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE

Field Manager

DATE

8-18-65


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

*See Instructions on Reverse Side

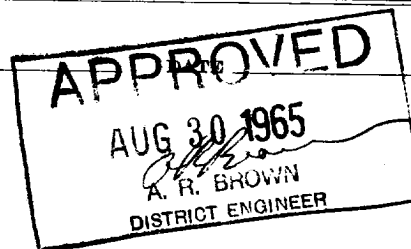

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.