

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE\*  
(Other instructions  
reverse side)

Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		2. NAME OF OPERATOR Plains Petroleum Operating Company		3. ADDRESS OF OPERATOR 415 West Wall, Suite 1000, Midland, TX 79701		4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface Unit E, 1980' FNL & 660' FWL		5. LEASE DESIGNATION AND SERIAL NO.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME LC-064118		7. UNIT AGREEMENT NAME		8. FARM OR LEASE NAME Eva E. Blinbry		9. WELL NO. #5		10. FIELD AND POOL, OR WILDCAT Langlie Mattix 7RVS QN		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 3, T23S, R37E 35		12. COUNTY OR PARISH Lea		13. STATE NM	
14. PERMIT NO. 30-025-10962		15. ELEVATIONS (Show whether DF, RT, CR, etc.) 3254' (-1)																							


16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:				SUBSEQUENT REPORT OF:			
TEST WATER SHUT-OFF	<input type="checkbox"/>	PULL OR ALTER CASING	<input type="checkbox"/>	WATER SHUT-OFF	<input type="checkbox"/>	REPAIRING WELL	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	MULTIPLE COMPLETE	<input type="checkbox"/>	FRACTURE TREATMENT	<input checked="" type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	ABANDON*	<input type="checkbox"/>	SHOOTING OR ACIDIZING	<input checked="" type="checkbox"/>	ABANDONMENT*	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>	(Other)	<input type="checkbox"/>		<input type="checkbox"/>
(Other)	<input type="checkbox"/>		<input type="checkbox"/>	(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)			

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 01-26-93 MIRUSU. POOH w/rods to body break 70 RFS. RIH w/fishing tool. Catch fish. POOH w/rods, pump. ND wellhead. NU BOP. RIH w/tbg. Tag up @ 3437'. POOH tallying pipe. Close BOP. SDFN.
- 01-27-93 RIH w/6-1/8" cut rite shoe, T-dog sub, 2 (5-1/2") WP, XO, jars, 6 (3-1/2") DCs, XO, 97 jts 2-3/8" PH6, P105 tbg, tag up @ 3470.2'KB (74' fill). Rev circ to 3483'. Lost returns, pipe appeared plugged. POOH w/tbg string. Trip in hole w/BHA & 2-3/8" tbg to 3460'. Established circ, washed down to 3483'. Losing returns (50-75%). POOH w/8 jts 2-3/8" tbg to 3216'. (84' above btm of 7" csg). SI BOP. SION.
- 01-28-93 Open well, TIH w/shoe and washpipe to 3483'. RU Power Swivel and begin circ. Washpipe plugged off. LD swivel, TOH. TIH w/washpipe & shoe to 3483'. RU swivel and break circ. Wash down from 3483' - 3492'. Attempt to clean out and tbg plugged. TOH.
- 01-29-93 Pick up 6-1/4" skirted mill tooth bit, bit sub, 6 ea 3-1/2" DCs, & off ground. TIH, tag @ 3480'. Drill to 3537', go back down, tag @ 3503', drill to 3537' second time, work pipe up, down hole heaving, drill to 3517', circ clean, POOH w/6 stands. SDFN.

(CONTINUED ON PAGE 2)

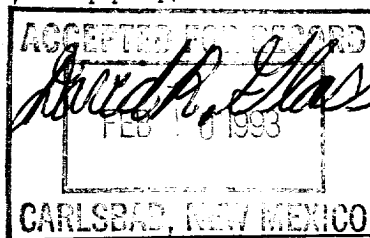

18. I hereby certify that the foregoing is true and correct

SIGNED Mark A. Vanderburg TITLE Petroleum Engineer DATE February 8, 1993

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE\*  
(Other instructions re-  
verse side)

Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO.	
2. NAME OF OPERATOR Plains Petroleum Operating Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME LC-064118	
3. ADDRESS OF OPERATOR 415 West Wall, Suite 1000, Midland, TX 79701		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit E, 1980' FNL & 660' FWL		8. FARM OR LEASE NAME Eva E. Blinbry	
14. PERMIT NO.		9. WELL NO. #5	
15. ELEVATIONS (Show whether DP, RT, GR, etc.)		10. FIELD AND POOL, OR WILDCAT Langlie Mattix 7RVS QN	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 5, T23S, R37E	
		12. COUNTY OR PARISH Lea	
		13. STATE NM	

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETION

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON\*

SHOOTING OR ACIDIZING

ABANDONMENT\*

REPAIR WELL

CHANGE PLANS

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

(CONTINUED FROM PAGE 1)

01-30-93 TIH w/6 stands, PU (1 jt) swivel, Tag fill @ 3512', 5' of fill overnight, drill to 3535', POOH, 1 stand, wait 1/4 hr, tag fill or bridge @ 3517' wash back to bottom @ 3535', circ clean, LD swivel, TOH, pick up 8 joints 4-1/2" 11.6# N80 LT&C casing, put 4-1/2 X 5-1/2 swedge w/5-1/2" collar in last joint, screw in light, RIH w/liner, tag @ 3515' GL, unscrew from liner, top of liner @ 3173'-3194' GL. TOH w/tbg, PU 2 jts 2-3/8" 8nd tbg, ADI packer, TIH w/12 jts. SDFN.

01-31-93 Arrive loc, TIH w/rest of tbg, pkr 3159', tail pipe @ 3221', set pkr, press csg 200#, acidize w/5000 gals 15% NeFe in 4 stages, dropping 300# rock salt. Left well shut in, rig down acid trucks, SD. Will pull pkr, put on prod. 2/1/93.

02-01-93 Blow well down. Release pkr. POOH, PU & RIH w/2-3/8" BPMA, 2-3/8" perf'd tbg sub, 2-3/8" SN, 109 jts 2-3/8" tbg. ND BOP. NU wellhead. RIH w/2" x 1-1/2" x 12' pump, (134) 3/4" rods, 1-1/4" x 16' polished rod. Seated & spaced pump. RU pump truck. Load tbg & attempt to pressure test. Would not hold. RD pump truck. Unseat pump. POOH w/rods & pump. SI well. SDFN.

02-02-93 Open well. RIH w/tbg, tag liner bottom @ 3515'. POOH w/tbg, RU tbg tester. RIH w/2-3/8" BPMA, 2-3/8" perf'd tbg sub, 2-3/8" seating nipple, 109 jts (2-3/8") tbg hydrotesting to 5000#, RD tbg tester. NU wellhead. RIH w/2" X 1-1/2" X 12' pump, 3/4" X 2' pony rod 134 (3/4") rods, and 1-1/4" X 16' polished rod. RDWOSU.

18. I hereby certify that the foregoing is true and correct

Petroleum Engineer

February 8, 1993

SIGNED M.A.N.

TITLE

DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

*Harold R. Mass*  
FEB 10 1993  
BUREAU OF LAND MANAGEMENT  
NEW MEXICO