

STATE OF NEW MEXICO
OIL AND MINERALS DEPARTMENT

| | |
|------------------------|--|
| NO. OF COPIES RECEIVED | |
| DISTRIBUTION | |
| SANTA FE | |
| FILE | |
| U.S.G.S. | |
| LAND OFFICE | |
| OPERATOR | |

CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

| | |
|--------------------------------|---|
| 5a. Indicate Type of Lease | |
| State <input type="checkbox"/> | Fee <input checked="" type="checkbox"/> |
| 5. State Oil & Gas Lease No. | |

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

| | | |
|---|--|---|
| 1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> | | 7. Unit Agreement Name |
| 2. Name of Operator ARCO Oil and Gas Company Division of Atlantic Richfield Company | | 8. Farm or Lease Name W. B. Guthrie WN |
| 3. Address of Operator Box 1710, Hobbs, New Mexico 88240 | | 9. Well No. 2 |
| 4. Location of Well UNIT LETTER <u>H 9</u> 1980 FEET FROM THE <u>South</u> North LINE AND 660 FEET FROM THE <u>East</u> LINE, SECTION <u>8 34</u> TOWNSHIP <u>18S 23</u> RANGE <u>27E 36</u> NMPM. | | 10. Field and Pool, or Wildcat Jalmat Yates 7R |
| 15. Elevation (Show whether DF, RT, GR, etc.) 3493.3' GR | | 12. County Lea |

| | | | |
|--|--|--|---|
| 16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data | | | |
| NOTICE OF INTENTION TO: | | SUBSEQUENT REPORT OF: | |
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input checked="" type="checkbox"/> | REMEDIAL WORK <input type="checkbox"/> | ALTERING CASING <input type="checkbox"/> |
| TEMPORARILY ABANDON <input type="checkbox"/> | CHANGE PLANS <input type="checkbox"/> | COMMENCE DRILLING OPNS. <input type="checkbox"/> | PLUG AND ABANDONMENT <input type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/> | OTHER <input type="checkbox"/> | CASING TEST AND CEMENT JOBS <input type="checkbox"/> | OTHER <input type="checkbox"/> |

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

On 5/2/83 shut in after testing 0 BOPD, 40 BWPD & 0 MCFG.
Propose to plug and abandon in the following manner:
RU & POH w/rods & pump. POH w/tbg. Install BOP. RIH w/cmt retr & set @ 3050', establish inj rate. Cmt squeeze perfs 3112-3454' w/100 sx Cl H cmt. Spot 10 sx cmt on top of retr. Circ hole w/9.5# BW cont'g 25# gel/bbl. Spot cmt plugs 3000-2900', 1650-1550', 480-380' & 10 sx @ surface. Remove wellhead. Install regulation dry hole marker. Clean & level location for abandonment.


WILL NEED TO PERFORM @ 480' - BRING CEMENT TO SURFACE BETWEEN 8 3/4 & 9 1/2

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. E. Ballidge TITLE Drlg. Engr. DATE 9/13/83

APPROVED BY ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE SEP 22 1983

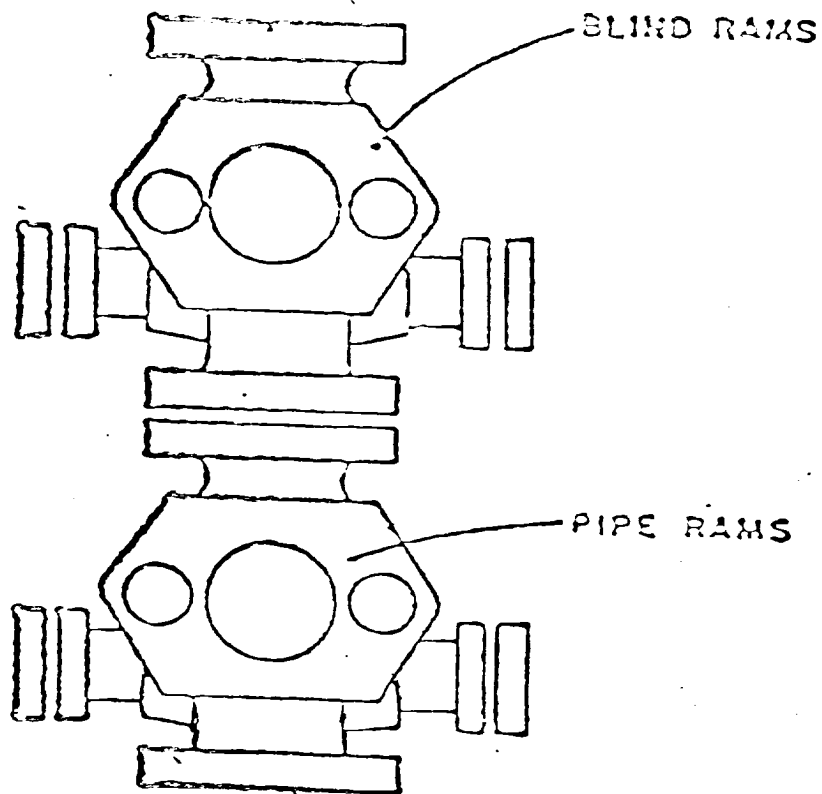

ARCO Oil & Gas Company
Division of Atlantic Richfield Company
Blow Out Preventer Program

Lease Name W. B. Guthrie WN

Well No. 2

Location 1980' FNL & 660' FEL
Sec 8-18S-27E, Lea County

BOP to be tested when installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.

SEP 22 1983

RECEIVED

RECEIVED

SEP 14 1992

SEP 14 1992

O.C.O.

1050

HC-25 OFFICE

HC-25 OFFICE